

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933 TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

AUTO & GENERAL INSURANCE (S) PL (BUDGET DIRECT INSURANCE) 190 CLEMENCEAU AVENUE #03-01 SINGAPORE SHOPPING CENTRE SINGAPORE 239924

INV No. AC2007072

INV Date 19/10/2020

Reference CS/AGI20009109/Avf3q2

Code AGI

PROFESSIONAL SERVICE FEE

Vehicle No. SLU 6408R

Insured Veh. SLD 4023U

Claim No. C10007128

Policy No.

Accident Date 27/08/2020

Inspection Date 28/08/2020

Description	Total
Survey Inspection	250.00
Resurvey Inspection	
Digital Photographs	
Transportation	
Subtotal	250.00
GST (7%)	17.50
Grand Total	267.50

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to 'LKK Auto Consultants Pte Ltd'

LKK Auto Consultants Pte Ltd

LKM



5b.

LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

	The grade is the state of the grade is the state of the grade is the state of the s					
		Affiliated to Federation Internation	nale Des Experts En Automob	ile		
AUT	AUTO & GENERAL INSURANCE (S) PL Ref: CS/AGI20009109/Avf3q2					
190 SIN	(BUDGET DIRECT INSURANCE) 190 CLEMENCEAU AVENUE #03-01 SINGAPORE SHOPPING CENTRESINGAPORE 239924		Date: 19-10-2020			
			Code: AGI			
1.		Policy Particulars	:- THIRD PARTY CLAIM			
	Insured Veh.	SLD 4023U	Veh. Inspected	SLU 6408R		
	Policy No.		Coverage (\$)	0.00		
	Claim No.	C10007128	Excess (\$)	0.00		
	Assign From	IVY RATILLA	Assign Date	28/08/2020		
2. Vehicle Particulars & Condition						
	Make & Model	HONDA VEZEL HYBRID	c.c	1496		
	Engine No.	HIDDEN	Year of Reg.	2017		
	Chassis No.	RU31265243	Colour	SILVER		
	Odometer	216353	Steering	IN ORDER		
	Brakes	IN ORDER	Modification	SPORTS RIM		
	General	GOOD				
3.		Condition	ons of Tyres			
	Size Make Balance					
	R/H Front Tyre	215/60 R16	DAVANTI	6 mm		
	L/H Front Tyre	215/60 R16	DAVANTI	6 mm		
	R/H Rear Tyre	215/60 R16	DAVANTI	6 mm		
	L/H Rear Tyre	215/60 R16	DAVANTI	6 mm		
4.		Description	on of Damages			
	THE VEHICLE SU	STAINED DAMAGES AT THE N/S	BODY.			
	DAMAGES SEE DETAILS.					
5.	5. General Information					
	Accident Date	27/08/2020	Inspection Date	28/08/2020		
	Survey held at	N-51 AUTOMOTIVE PL				
		2 KAKI BUKIT AVE 2 #01-17 KAKI BUKIT AUTOHUB SINGAPORE 417921				
5a.		Re	emarks			

A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS.

ESTIMATED NORMAL PERIOD FOR REPAIR:

B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.

Estimate Days of Repair

5 Working Days



51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 3

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SLU 6408R

Qty	Description of Parts	Condition	Estimate By Workshop (\$))	Our Adjusted (\$)
	REPLACEMENT OF PARTS			
1	FRONT LH DOOR	DENTED	1,080.50	1,080.50
1	FRONT LH DOOR FRAME BLACK TAPE STICKER	NECESSARY	33.00	33.00
1	FRONT LH DOOR INNER PLASTIC SEAL COVER	NOT NECESSARY	35.50	-
1	FRONT LH DOOR LOWER HINGE	NOT NECESSARY	38.50	-
1	FRONT LH DOOR LOWER WEATHER STRIP SEAL	NECESSARY	28.00	28.00
1	FRONT LH DOOR SIDE MIRROR COVER	NOT NECESSARY	80.00	-
1	FRONT LH DOOR VERTICAL WEATHER STRIP SEAL	CUT	20.00	20.00
1	FRONT LH DOOR WEATHER STRIP SEAL	NOT NECESSARY	71.00	-
1	FRONT LH FENDER	TO REPAIR SEE LABOUR	580.00	-
1	FRONT LH FENDER 'HYBRID' EMBLEM	NECESSARY	95.00	95.00
1	FRONT LH FENDER ARCH GARNISH	CUT	220.00	220.00
1	LH SIDE SKIRT GARNISH	DEFORMED	377.50	377.50
1	REAR LH DOOR	DENTED	930.60	930.60
1	REAR LH DOOR CENTER WEATHER STRIP SEAL	NOT NECESSARY	36.50	-
1	REAR LH DOOR FRAME BLACK TAPE STICKER	NECESSARY	33.00	33.00
1	REAR LH DOOR INNER PLASTIC SEAL COVER	NOT NECESSARY	35.50	-
1	REAR LH DOOR LOWER HINGE	NOT NECESSARY	38.50	-
1	REAR LH DOOR LOWER WEATHER STRIP SEAL	NECESSARY	14.90	14.90
1	REAR LH DOOR TRANSPARENT STICKER	NECESSARY	35.00	35.00
1	REAR LH DOOR WEATHER STRIP SEAL	NECESSARY	18.50	18.50
1	REAR LH FENDER ARCH GARNISH	CUT	195.00	195.00
1	REAR LH WHEEL BEARING HUB	DAMAGED	263.50	263.50
	LESS 20% DISCOUNT		-852.00	-668.90
			3,408.00	2,675.60
1	REAR LH SPORT RIM (SN)	СИТ	813.00	500.00
'	LESS 20% DISCOUNT		-162.60	
	200 20% 510000111		650.40	500.00

Report Ref No. CS/AGI20009109/Avf3q2



51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$))	Our Adjusted (\$)
	SPECIAL NETT ITEMS			
1	SET FRONT LH DOOR INNER TRIM BOARD CLIPS (SN)	NOT NECESSARY	50.00	-
1	SET FRONT LH FENDER ARCH GARNISH CLIPS (SN)	NECESSARY	30.00	30.00
1	SET FRONT LH FENDER INNER SHIELD CLIPS (SN)	NOT NECESSARY	50.00	-
1	SET LH SIDE SKIRT GARNISH CLIPS (SN)	NECESSARY	50.00	30.00
1	SET REAR LH DOOR INNER TRIM BOARD CLIPS (SN)	NOT NECESSARY	50.00	-
1	SET REAR LH FENDER ARCH GARNISH CLIPS (SN)	NECESSARY	30.00	30.00
1	REAR LH TYRE (SN)	NOT NECESSARY	300.00	-
			560.00	90.00
	<u>LABOUR</u>			
	TO REMOVE ,REINSTALL ELECTRICAL WIRING HARNESS ,CHECK LIGHTING. (TO FR).		50.00	30.00
	TO REMOVE ,REINSTALL REAR SUSPENSION AND UNDERCARRIAGE PART .(TO FR).		200.00	50.00
	TO ROAD TEST DRIVING ,CHECK AND RESETTING WHEEL ALIGNMENTS SYSTEM.		100.00	80.00
	TO REMOVE, REINSTALL ROOF TOP TRIM UPHOLSTERY, CUSHION SEAT, TRIM GARNISH ,TRIM LINER CARPET.(TO FR).	NOT NECESSARY	100.00	-
	TO TRANSFER DOOR GLASS ,REGULATOR GEAR ,MOTOR ,RAILING ,CHANNEL ,TRIM BOARD ,MECHANISM LOCK AND HANDLE.		200.00	160.00
	TO RE-SPRAY PAINTING ON THE CHARGE BODYPARTS,REPAIR PORTION ,AND WHERE CONSISTENT TO THE ACCIDENT .		1,300.00	800.00
	TO PROVIDE LABOUR , WORKMANSHIP TO CHARGE THE ABOVE DAMAGED BODYPARTS , REPAIR , RECONSTRUCT AND RE-ALIGN BODY STRUCTURE BODY ALIGNMENTS AND DAMAGED CONSISTENT TO THE ACCIDENT .INCLUSIVE OF THE REPAIR OF FRONT LH FENDER .		900.00	600.00
	TO APPLY ANTI-RUST CHEMICAL ON REPAIRED AND REPLACED PANEL.		100.00	50.00
			2,950.00	1,770.00
	GRAND TOTAL		7,568.40	5,035.60

RECOMMENDED COST OF LUMP SUM REPAIRS		4,000.00
(TO ITS PRE-ACCIDENT CONDITION)		

Report Ref No. CS/AGI20009109/Avf3q2





Report Ref No. CS/AGI20009109/Avf3q2



ADRIAN LING WAI PING

B.Eng,AMSOE,AMIRTE,AMSAE-A,M.MATAI

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contact or tort, is accepted to any third party who may reply on the Report wholly or in part. Any third party acting or replying on this Report, in whole or in part, does so at his or her own risk.



51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933 TEL: 6256 3561 FAX: 6256 4315


Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SLU 6408R

INSPECTION





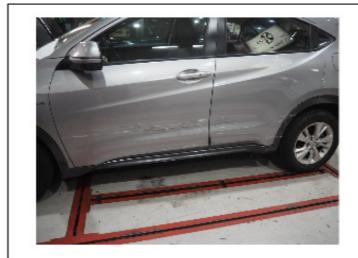











51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933 TEL: 6256 3561 FAX: 6256 4315

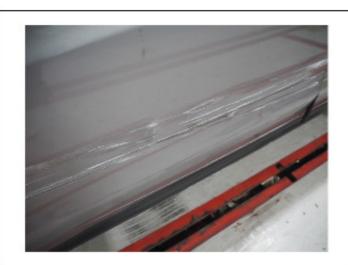


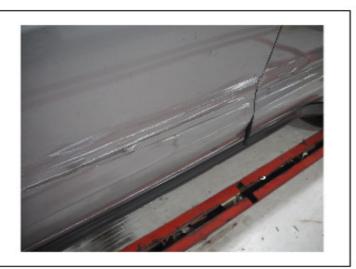







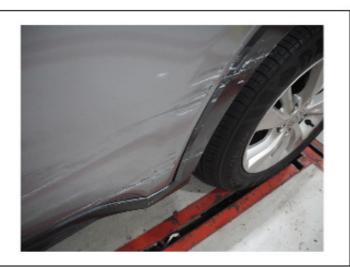



51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933 TEL: 6256 3561 FAX: 6256 4315
















51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933 TEL: 6256 3561 FAX: 6256 4315







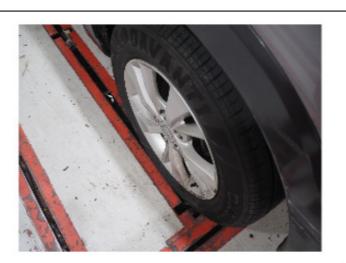







51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933 TEL: 6256 3561 FAX: 6256 4315















51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933 TEL: 6256 3561 FAX: 6256 4315









51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933 TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SLU 6408R

RE-INSPECTION












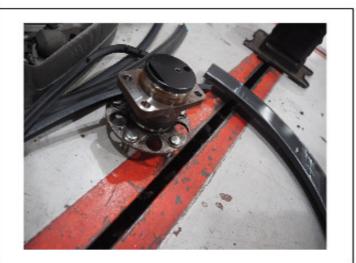



51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933 TEL: 6256 3561 FAX: 6256 4315









51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933 TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SLU 6408R

RE-INSPECTION



