



## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

### TAX INVOICE

CHINA TAIPING INSURANCE (S) PTE LTD	INV No.	AC2102198
3 ANSON ROAD #16-00	INV Date	05/04/2021
SPRINGLEAF TOWER	Reference	CC6/CTI20009160/Kga3q2
SINGAPORE 079909	Code	CTI

### PROFESSIONAL SERVICE FEE

Vehicle No.	SMN 9429K
Insured Veh.	GBK 3352H
Claim No.	SNM20D203116
Policy No.	DMCVSNW00044072000
Accident Date	28/08/2020
Inspection Date	31/08/2020

Description	Total
Third Party Express Settlement	400.00
<b>Subtotal</b>	<b>400.00</b>
<b>GST (7%)</b>	<b>28.00</b>
<b>Grand Total</b>	<b>428.00</b>

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

**LKM**



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile			
CHINA TAIPING INSURANCE (S) PTE LTD 3 ANSON ROAD #16-00 SPRINGLEAF TOWERSINGAPORE 079909		Ref: CC6/CTI20009160/Kga3q2 Date: 05/04/2021 Code: CTI	
1. Policy Particulars :- THIRD PARTY CLAIM			
Insured Veh.	GBK 3352H	Veh. Inspected	SMN 9429K
Policy No.	DMCVSNW00044072000	Coverage (\$)	0.00
Claim No.	SNM20D203116	Excess (\$)	0.00
Assign From		Assign Date	31/08/2020
2. Vehicle Particulars & Condition			
Make & Model	TOYOTA NOAH (A)	c.c	1797
Engine No.	HIDDEN	Year of Reg.	2019
Chassis No.	ZWR800399810	Colour	METALLIC SILVER
Odometer	104392 KM	Steering	IN ORDER
Brakes	IN ORDER	Modification	STANDARD ALLOY RIM
General	GOOD		
3. Conditions of Tyres			
	Size	Make	Balance
R/H Front Tyre	195/65 R15	CHAMPIRO	8 mm
L/H Front Tyre	195/65 R15	CHAMPIRO	8 mm
R/H Rear Tyre	195/65 R15	WANLI	3 mm
L/H Rear Tyre	195/65 R15	WANLI	3 mm
4. Description of Damages			
THE VEHICLE SUSTAINED DAMAGES AT THE REAR PORTION. DAMAGES SEE DETAILS.			
5. General Information			
Accident Date	28/08/2020	Inspection Date	31/08/2020
Survey held at	HUI YANG MOTOR PTE LTD BLOCK 176 SIN MING DRIVE #04-02 SIN MING AUTOCARE SINGAPORE 575721		
5a. Remarks			
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.			
5b. Estimate Days of Repair			
ESTIMATED NORMAL PERIOD FOR REPAIR:		6 Working Days	



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

## ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SMN 9429K

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
<b><u>REPLACEMENT OF PARTS</u></b>				
1	REAR TAILGATE	BENT	1,712.85	1,712.85
1	REAR TAILGATE 'HYBRID' EMBLEM	NECESSARY	132.25	132.25
1	REAR TAILGATE WINDSCREEN GLASS	SHATTERED	1,850.50	1,850.50
1	REAR TAILGATE WINDSCREEN MOULDING	NECESSARY	172.80	172.80
1	REAR TAILGATE OUTER CHROME	CRACKED	581.90	581.90
1	REAR TAILGATE 'TOYOTA' LOGO	NECESSARY	121.10	121.10
1	REAR TAILGATE INNER LOCK	DENTED	581.90	561.25
1	REAR TAILGATE INNER RUBBER	DISTORTED / DENTED	371.85	371.85
1	REAR TAILGATE INNER GARNISH	MTG CRACKED	371.75	371.75
2	REAR TAILLAMP @\$781.55	O/S CUT	1,563.10	781.55
2	REAR TAILLAMP LOWER GARNISH @\$371.85	O/S CRACKED	743.70	371.85
2	REAR TAILLAMP LOWER GARNISH SIDE RETAINER @\$172.25	O/S DISTORTED	344.50	172.25
1	REAR BUMPER	BENT	1,217.45	1,217.45
2	REAR BUMPER SIDE RETAINER @\$172.10	O/S DISTORTED	344.20	172.10
1	REAR BUMPER RH SIDE REFLECTOR	SERVICEABLE	181.90	-
10	REAR BUMPER CLIP @\$5.00	NECESSARY	50.00	50.00
1	REAR END PANEL	BENT	781.10	610.30
1	REAR END PANEL INNER GARNISH	MTG DISTORTED	378.85	288.90
1	REAR END PANEL OUTER SENSOR	DENTED	381.50	381.50
1	REAR FLOOR PANEL INNER TRIM	DEFORMED / CRACKED	581.90	581.90
1	REAR FLOOR PANEL TOP BOARD TRIM	DEFORMED	1,238.00	845.10
1	REAR FENDER RH INNER GARNISH	BUCKLED	731.35	681.00
	LESS 25% DISCOUNT		-3,608.61	-3,007.54
			10,825.84	9,022.61
<b><u>SPECIAL NETT ITEMS</u></b>				
1	SET REAR PARKING SENSOR (SN)	SHORTED	280.00	200.00
1	SET REAR WINDSCREEN GLASS PRIVATE HIRE CAR DECAL (SN)	NECESSARY	20.00	20.00

Report Ref No. CC6/CTI20009160/Kga3q2



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	SEALANT (SN)	NECESSARY	80.00	40.00
			380.00	260.00
	<b>LABOUR</b>			
	REMOVE & REFIT REAR WINDSCREEN GLASS .		120.00	120.00
	WIRING .		180.00	20.00
	TUFFKOTE.		180.00	60.00
	SPRAY PAINTING .		1,400.00	900.00
	LABOUR CHARGES.		1,400.00	700.00
		3,280.00	1,800.00	
<b>GRAND TOTAL</b>			<b>14,485.84</b>	<b>11,082.61</b>
<b>RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)</b>				<b>8,850.00</b>

Report Ref No. CC6/CTI20009160/Kga3q2

**KONG SENG CHEONG**

Licensed Appraiser

**DISCLAIMER OF LIABILITY TO THIRD PARTIES:-** This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

## PHOTOGRAPHS FOR VEHICLE NO. SMN 9429K

## INSPECTION





# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R







# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

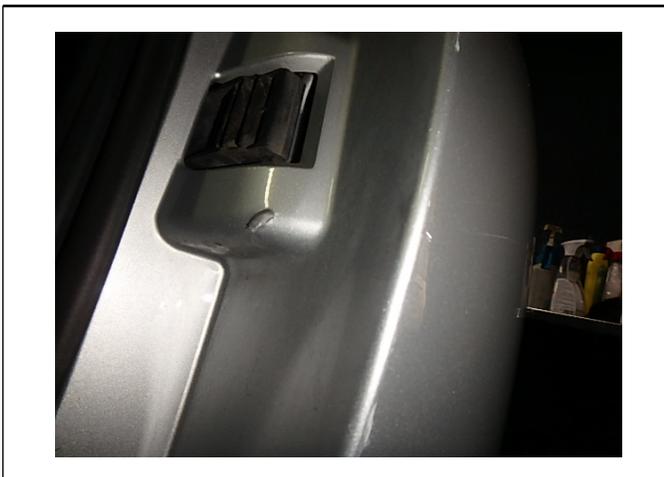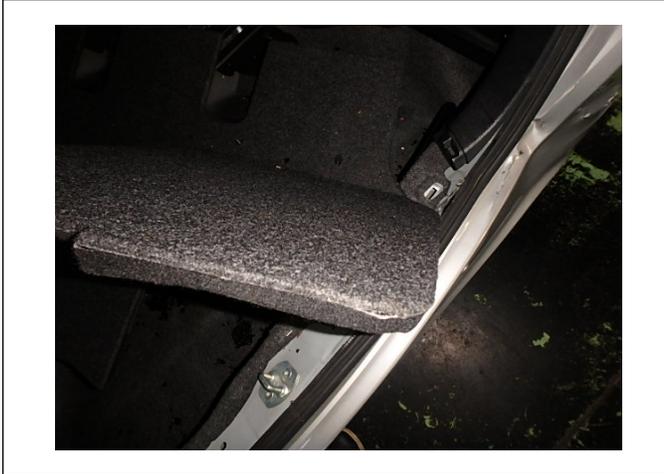



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

## PHOTOGRAPHS FOR VEHICLE NO. SMN 9429K

## RE-INSPECTION





# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

## PHOTOGRAPHS FOR VEHICLE NO. SMN 9429K

## RE-INSPECTION

