



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

LONPAC INSURANCE BHD
300 BEACH ROAD
#17-04/07 THE CONCOURSE
SINGAPORE 199555

INV No. AC2101012
INV Date 17/02/2021
Reference CC4/LPC20009635/Kgs3q2
Code LPC2

PROFESSIONAL SERVICE FEE

Vehicle No. GBD 2653H
Insured Veh. GBA 612E
Claim No. 20/20/20/VC05/023634
Policy No. Z20V05004404
Accident Date 05/09/2020
Inspection Date 08/09/2020

Description	Total
Third Party Express Settlement	400.00
Subtotal	400.00
GST (7%)	28.00
Grand Total	428.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile			
LONPAC INSURANCE BHD 300 BEACH ROAD #17-04/07 THE CONCOURSESINGAPORE 199555		Ref: CC4/LPC20009635/Kgs3q2 Date: 17/02/2021 Code: LPC2	
1. Policy Particulars :- THIRD PARTY CLAIM			
Insured Veh.	GBA 612E	Veh. Inspected	GBD 2653H
Policy No.	Z20V05004404	Coverage (\$)	0.00
Claim No.	20/20/20/VC05/023634	Excess (\$)	0.00
Assign From	ONG LI LI	Assign Date	08/09/2020
2. Vehicle Particulars & Condition			
Make & Model	TOYOTA HIACE	c.c	2982
Engine No.	HIDDEN	Year of Reg.	2014
Chassis No.	JTFHT02P800145783	Colour	SILVER
Odometer	232176 KM	Steering	IN ORDER
Brakes	IN ORDER	Modification	NIL
General	GOOD		
3. Conditions of Tyres			
	Size	Make	Balance
R/H Front Tyre	195 R15X8	SUMITOMO	6 mm
L/H Front Tyre	195 R15X8	SUMITOMO	6 mm
R/H Rear Tyre	195 R15X8	PETLAS	9 mm
L/H Rear Tyre	195 R15X8	PETLAS	9 mm
4. Description of Damages			
THE VEHICLE SUSTAINED DAMAGES AT THE REAR PORTION. DAMAGES SEE DETAILS.			
5. General Information			
Accident Date	05/09/2020	Inspection Date	08/09/2020
Survey held at	COMPLETE VMS PTE LTD BLK 176 SIN MING DRIVE #03-14 SIN MING AUTOCARE COMPLEX SINGAPORE 575721		
5a. Remarks			
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.			
5b. Estimate Days of Repair			
ESTIMATED NORMAL PERIOD FOR REPAIR:		7 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. GBD 2653H

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
REPLACEMENT OF PARTS				
1	TAIL GATE	BENT	2,278.20	1,700.00
1	REAR W/SCREEN MOULDING	NECESSARY	138.70	138.70
1	REAR WIPER BLADE	SERVICEABLE	65.57	-
1	REAR WIPER ARM	SERVICEABLE	98.57	-
1	REAR WIPER MOTOR	SERVICEABLE	650.42	-
1	REAR WINDSCREEN GLASS	SHATTERED	1,440.00	1,115.70
1	TAIL GATE LOCK	JAMMED	286.68	286.68
1	TAIL GATE INNER BOARD	BUCKLED	193.64	193.64
1	TAIL GATE OUTER GARNISH	MTG CRACKED	386.00	220.00
2	REAR NUMBER PLATE LAMP @\$71.50	SERVICEABLE	143.00	-
1	TAIL GATE OUTER HANDLE	WARPED	147.58	147.58
1	TOYOTA LOGO	NECESSARY	68.59	68.59
1	TOYOTA HIACE STICKER	NECESSARY	58.31	58.31
1	TAIL LAMP R/H	CRACKED	311.86	311.86
1	TAIL LAMP LOWER PANEL R/H	BENT	239.62	239.62
1	REAR FENDER R/H	TO REPAIR SEE LABOUR	1,470.66	-
1	TAIL LAMP L/H	CRACKED	311.86	311.86
1	REAR BUMPER	BENT	425.30	374.45
1	REAR VIEW MIRROR	MISSING	362.05	362.05
6	REAR BUMPER CLIP @\$8.00	NECESSARY	48.00	48.00
2	REAR BUMPER BRACKET @\$88.36	CRACKED	176.72	176.72
1	REAR END PANEL OUTER	BENT	466.82	466.82
1	REAR END PANEL TOP PLATE	DENTED	291.65	291.65
1	SPARE TIRE CARRIAGE TOOL COVER	SERVICEABLE	63.00	-
1	SPARE TIRE CARRIAGE	DISTORTED	280.05	172.10
1	REAR END CORNER PANEL R/H (ADDITIONAL)	BENT	452.00	452.00
1	REAR EXHAUST SILENCER (ADDITIONAL)	TO REPAIR SEE LABOUR	565.00	-
	LESS 25% DISCOUNT		-2,854.96	-1,784.08
			8,564.89	5,352.25



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	BOOT WEATHERSTRIP (50%)(SN) LESS 25% DISCOUNT	DENTED / CUT	346.82 -86.71	173.41 -
			260.11	173.41
	<u>SPECIAL NETT ITEMS</u>			
1	REAR W/SCREEN SEALANT (SN)	NECESSARY	65.00	40.00
1	70KM/H STICKER (SN)	NECESSARY	15.00	15.00
1	REAR NUMBER PLATE (SN)	DENTED	25.00	25.00
1	REVERSE SENSOR (SN)	CRACKED	280.00	200.00
1	REAR FLOOR ALUMINUM PLATE (ADDITIONAL)(SN)	BENT	850.00	850.00
			1,235.00	1,130.00
	<u>LABOUR</u>			
	REMOVE & REINSTALL REAR EXHAUST SILENCER BOX (ADDITIONAL).		120.00	60.00
	REMOVE & REINSTALL REAR W/SCREEN GLASS.	NOT NECESSARY	180.00	-
	TRANSFER TAILGATE COMPONENT TO NEW GATE.		150.00	60.00
	RUST PROOFING TREATMENT.		100.00	60.00
	SPRAY PAINT DAMAGED AREA AFFECTED.		1,200.00	750.00
	COMPANY LOGO, LETTERING AND TEL NO STICKER ON TAIL GATE.		380.00	180.00
	LOGO STICKER / TEL NO ON R/H REAR FENDER.		300.00	200.00
	TO CUT OFF REAR FENDER R/H, REAR END PANEL OUTER, KNOCK AND STRAIGHTEN REAR CHASSIS FRAME AND CHANGE ALL NECESSARY PARTS. INCLUSIVE OF THE REPAIR OF REAR FENDER R/H AND REAR EXHAUST SILENCER.		1,800.00	900.00
			4,230.00	2,210.00
	GRAND TOTAL		14,290.00	8,865.66

RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)			7,050.00
---	--	--	-----------------

Report Ref No. CC4/LPC20009635/Kgs3q2

KONG SENG CHEONG

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd



51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. GBD 2653H

INSPECTION

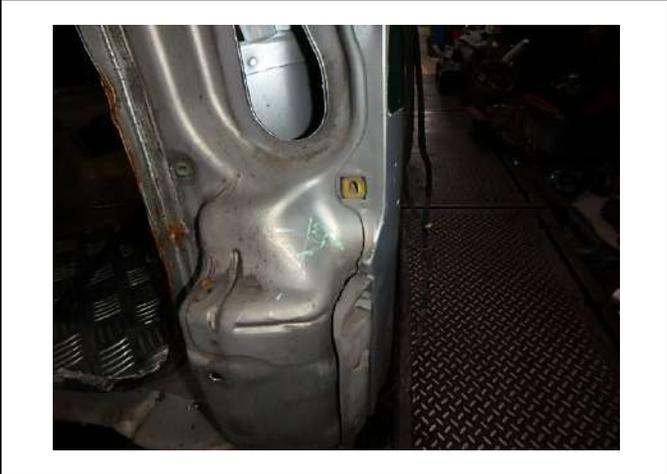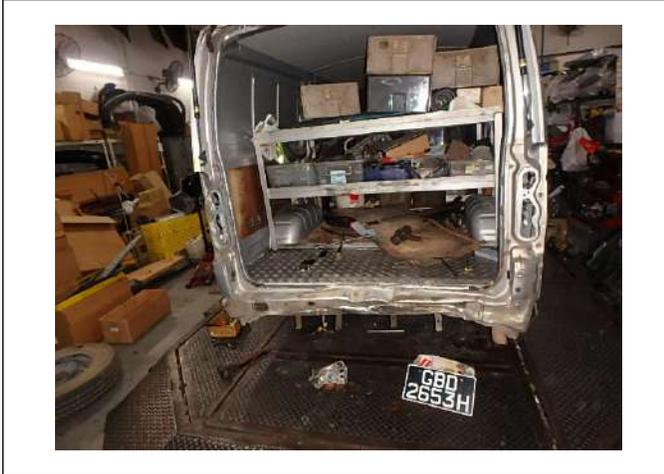



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

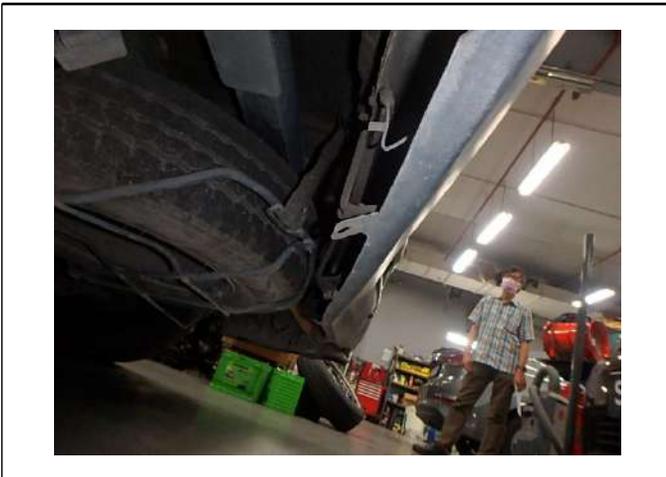






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

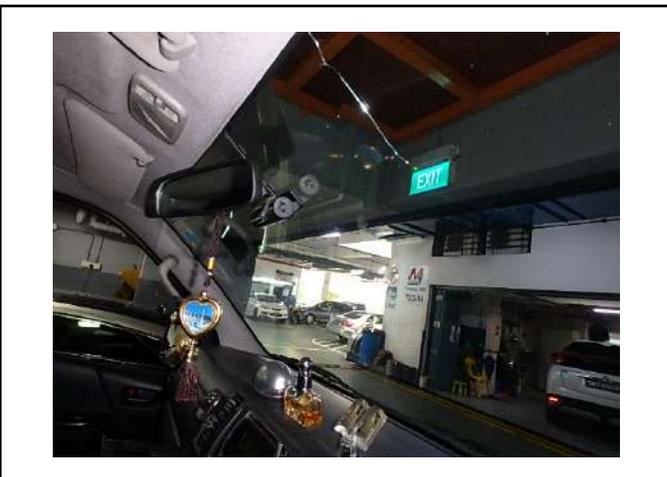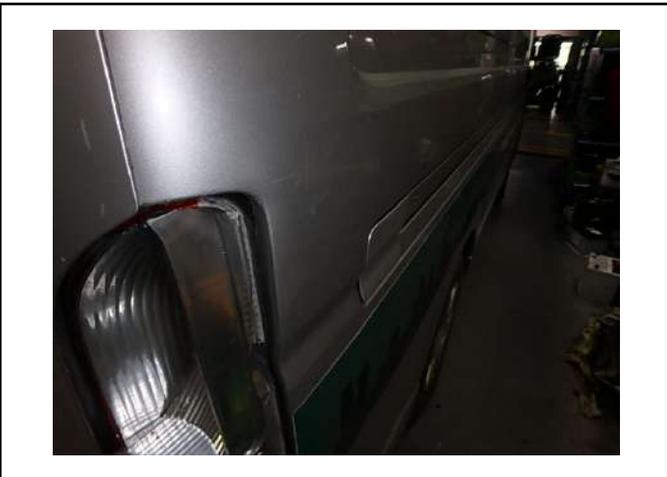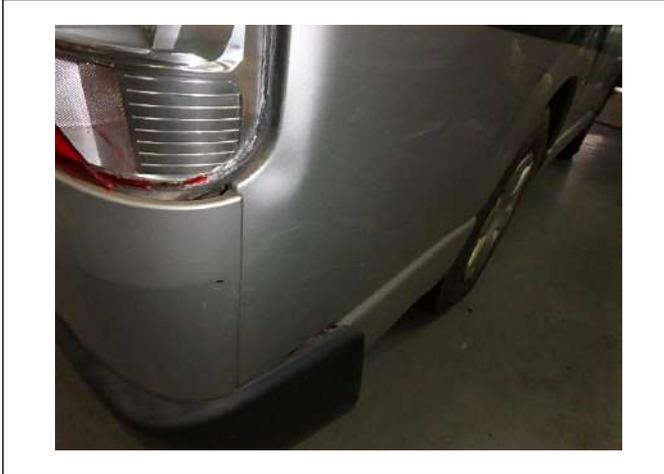



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd


51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. GBD 2653H

RE-INSPECTION

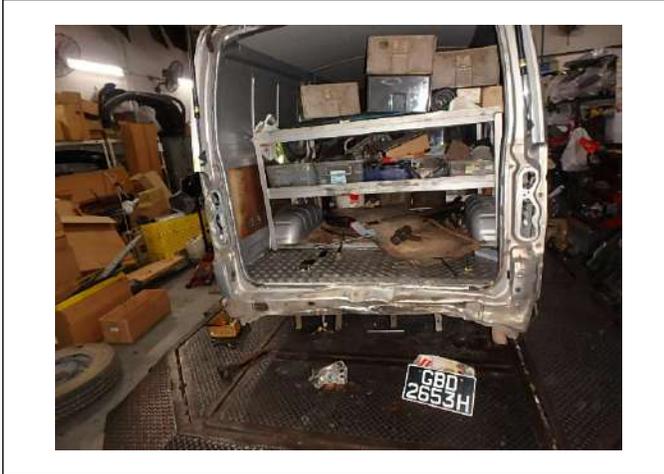




LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

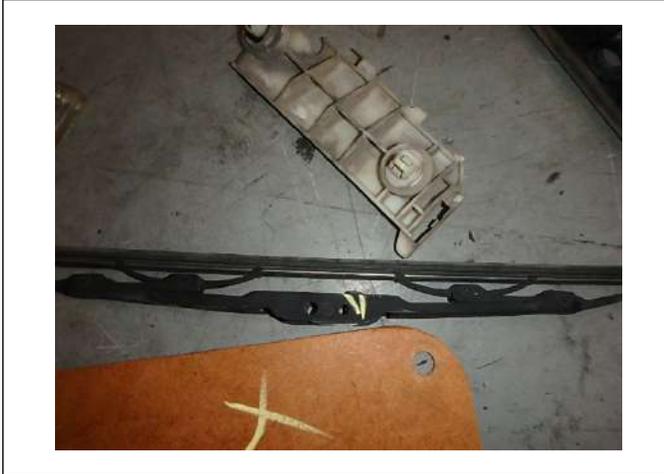



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. GBD 2653H

RE-INSPECTION

