



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

MS FIRST CAPITAL INSURANCE LTD

INV No. AC2100295

36 ROBINSON ROAD
#16-01 CITY HOUSE
SINGAPORE 068877

INV Date 14/01/2021
Reference CC4/FCI20009655/Ues3q2
Code FCI2

PROFESSIONAL SERVICE FEE

Vehicle No. SMN 4073K
Insured Veh. SHA 7897H
Claim No. D20003599MFSH
Policy No. D-20094922MFSH
Accident Date 04/09/2020
Inspection Date 09/09/2020

Description	Total
Third Party Express Settlement	500.00
Subtotal	500.00
GST (7%)	35.00
Grand Total	535.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
MS FIRST CAPITAL INSURANCE LTD 36 ROBINSON ROAD #16-01 CITY HOUSESINGAPORE 068877			Ref: CC4/FCI20009655/Ues3q2	
			Date: 14/01/2021	
			Code: FCI2	
1. Policy Particulars :- THIRD PARTY CLAIM				
Insured Veh.	SHA 7897H	Veh. Inspected	SMN 4073K	
Policy No.	D-20094922MFSH	Coverage (\$)	0.00	
Claim No.	D20003599MFSH	Excess (\$)	0.00	
Assign From	CHRIS LIM	Assign Date	09/09/2020	
2. Vehicle Particulars & Condition				
Make & Model	TOYOTA SIENTA HYBRID (A)	c.c	1496	
Engine No.	HIDDEN	Year of Reg.	2019	
Chassis No.	NHP1707121443	Colour	RED	
Odometer	80839 KM	Steering	IN ORDER	
Brakes	IN ORDER	Modification	SPORTS RIM	
General	GOOD			
3. Conditions of Tyres				
	Size	Make	Balance	
R/H Front Tyre	195/55 R15	CST TIRES	6 mm	
L/H Front Tyre	195/55 R15	CST TIRES	6 mm	
R/H Rear Tyre	195/55 R15	CST TIRES	6 mm	
L/H Rear Tyre	195/55 R15	CST TIRES	6 mm	
4. Description of Damages				
THE VEHICLE SUSTAINED DAMAGES AT THE FRONT O/S PORTION. DAMAGES SEE DETAILS.				
5. General Information				
Accident Date	04/09/2020	Inspection Date	09/09/2020	
Survey held at	FOCUS AUTO PTE LTD NO 1 KAKI BUKIT AVE 6 AUTOBAY #02-48 SINGAPORE 417883			
5a. Remarks				
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.				
5b. Estimate Days of Repair				
ESTIMATED NORMAL PERIOD FOR REPAIR:			6 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SMN 4073K

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	FRONT BONNET	BENT / BUCKLED	856.90	845.10
1	FRONT BONNET LOCK	SERVICEABLE	96.90	-
1	FRONT BONNET INSULATOR	NOT NECESSARY	279.60	-
5	FRONT BONNET INSULATOR CLIPSE @\$12.90	NOT NECESSARY	64.50	-
2	FRONT BONNET HINGES @\$101.90	NOT NECESSARY	203.80	-
1	FRONT SUPPORT PANEL	BENT /TWISTED	1,099.50	788.10
1	FRONT HEADLAMP -RH	BROKEN	3,145.90	727.20
1	FRONT FENDER -RH	DISTORTED	654.60	654.60
1	FRONT FENDER DUST COVER -RH	TORN	199.00	199.00
1	SET FRONT FENDER DUST COVER CLIPS-RH	NECESSARY	33.00	33.00
1	FRONT FENDER EMBLEM -RH	NECESSARY	49.80	49.80
1	FRONT FENDER TOP INNER GARNISH -RH	TWISTED / CRACKED	46.90	46.90
1	FRONT WASHER TANK	DEFORMED	168.90	168.90
1	FRONT BUMPER	DISTORTED	864.20	679.10
1	FRONT BUMPER SIDE PROTECTOR -RH	DISTORTED	189.60	189.60
1	FRONT BUMPER LOWER RUBBER	NOT NECESSARY	298.40	-
1	FRONT BUMPER INNER SPONGE	TORN	75.90	75.90
1	FRONT BUMPER REINFORCEMENT	BENT	381.90	381.90
1	FRONT BUMPER REINFORCEMENT BRACKET -RH	BENT	151.60	151.60
1	FRONT TOWING COVER	NOT NECESSARY	36.90	-
1	FRONT GRILLE	DISTORTED	859.60	605.10
1	FRONT GRILLE MOULD	SCRATCHED	188.90	188.90
1	FRONT BUMPER TOP RUBBER	NECESSARY	96.90	96.90
1	SET FRONT BUMPER CLIPS	NECESSARY	103.20	50.00
1	FRONT BUMPER REINFORCEMENT SIDE GARNISH	TORN	90.40	90.40
1	FRONT ENGINE DUST COVER	TORN	181.60	181.60
1	SET FRONT ENGINE DUST COVER CLIPSE	NECESSARY	51.60	30.00
1	FRONT CROSSMEMBER SUPPORT ARM-RH	TO REPAIR SEE LABOUR	298.40	-
1	FRONT AIR CON CONDENSER COVER-RH	NOT NECESSARY	98.40	-



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	FRONT BUMPER TOP BEAM LESS 25% DISCOUNT	BENT	96.20 -2,740.75 8,222.25	96.20 -1,582.45 4,747.35
	<u>LABOUR</u>			
	TOWING .		50.00	50.00
	PANEL BEATING.INCLUSIVE OF THE REPAIR OF FRONT CROSSMEMBER SUPPORT ARM-RH .		1,200.00	780.00
	CHECK WIRING AND DIAGNOSE TEST.		150.00	30.00
	ALIGNMENT.	NOT NECESSARY	50.00	-
	TO REMOVED & REPLACE SUPPORT ARM.	NOT NECESSARY	60.00	-
	TO SPRAY PAINT.		900.00	880.00
	TO REMOVED & REFIT AIR CON CONDENSER AND CHARGE GAS.		160.00	100.00
			2,570.00	1,840.00
GRAND TOTAL			10,792.25	6,587.35
RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)				5,200.00

Report Ref No. CC4/FCI20009655/Ues3q2

CHUA KANG SENG

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd



51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SMN 4073K

INSPECTION

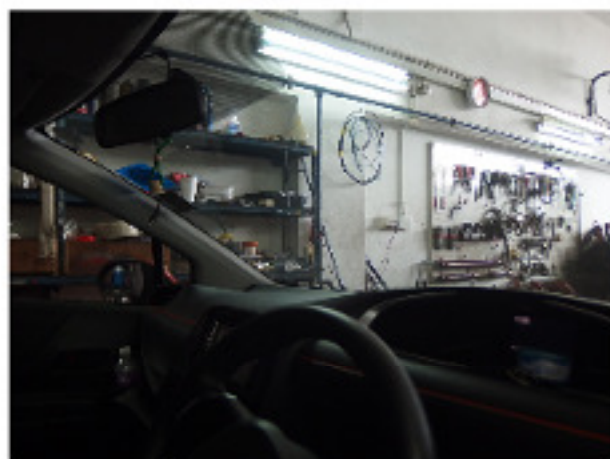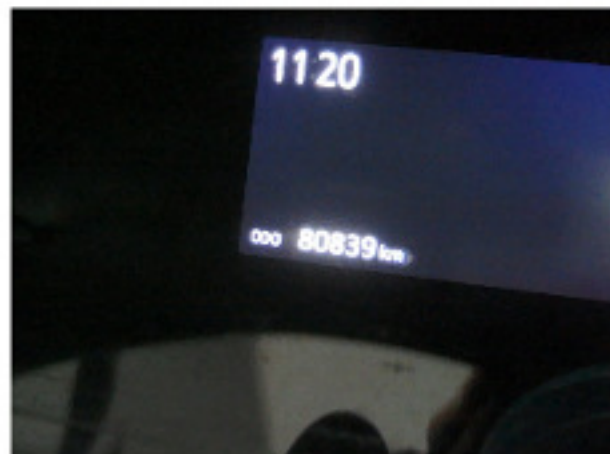



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R







LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

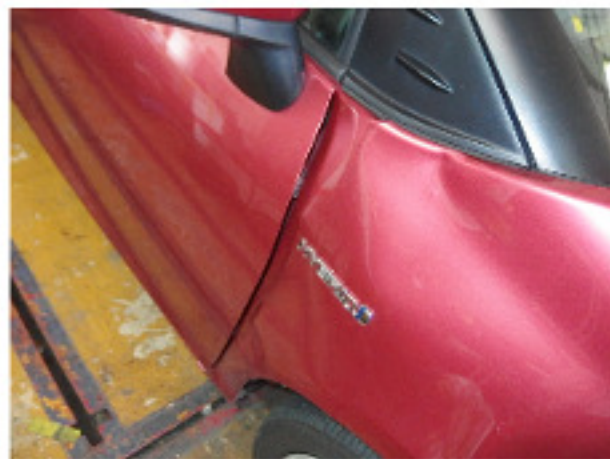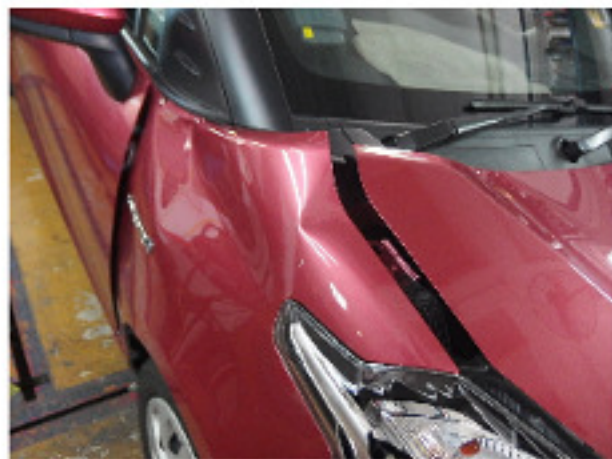




LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

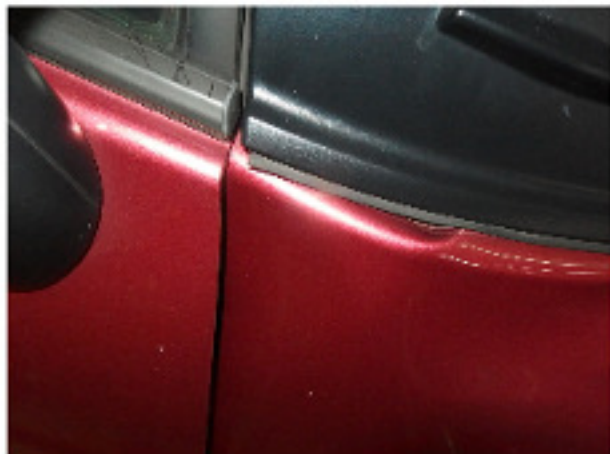



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

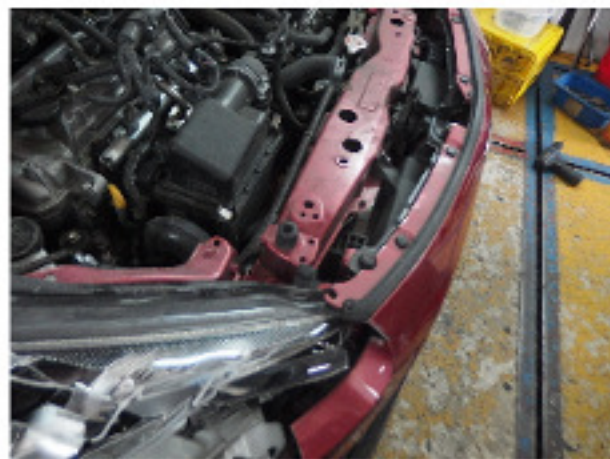



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

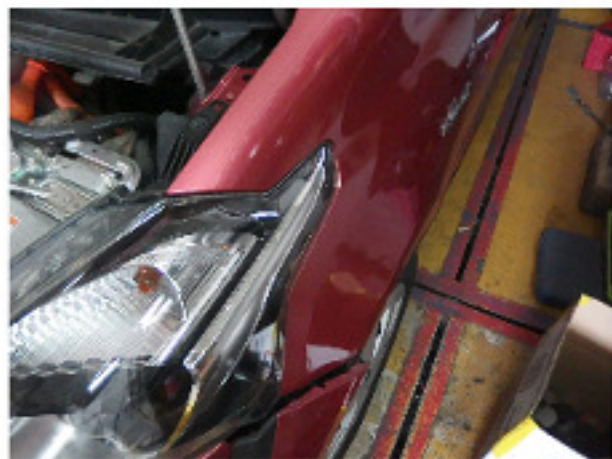



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd



51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SMN 4073K

RE-INSPECTION

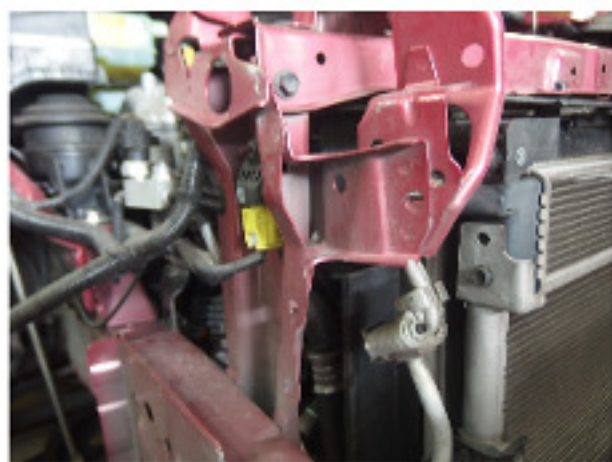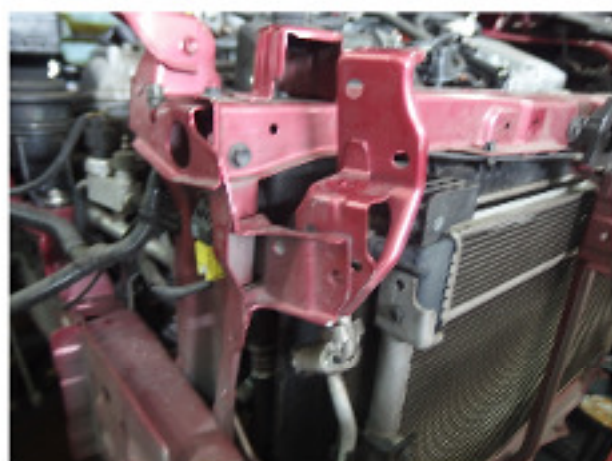






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

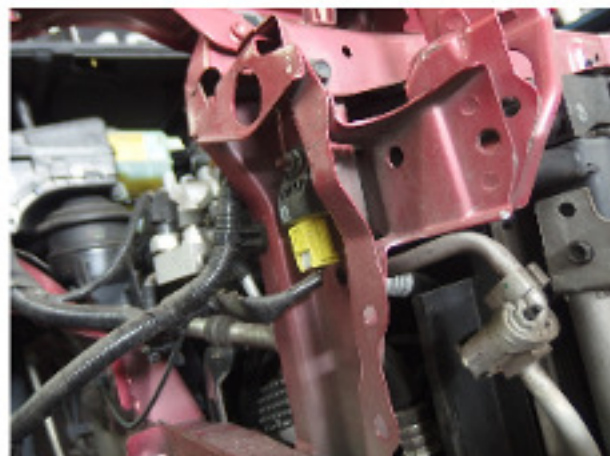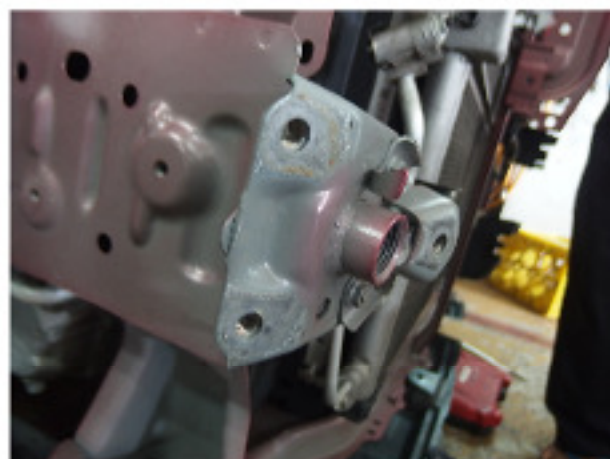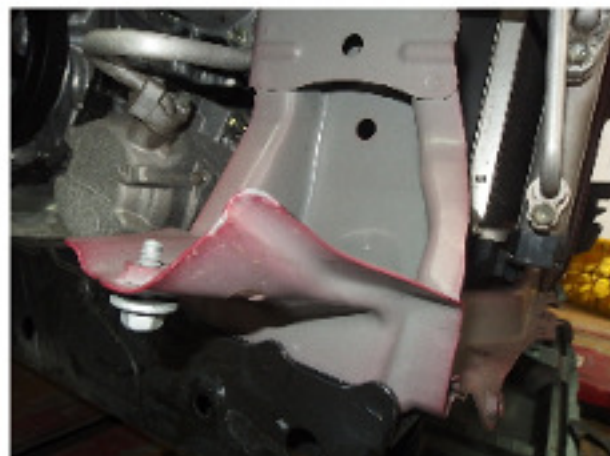



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SMN 4073K

RE-INSPECTION

