



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

MS FIRST CAPITAL INSURANCE LTD
36 ROBINSON ROAD
#16-01 CITY HOUSE
SINGAPORE 068877

INV No. AC2007952
INV Date 26/11/2020
Reference CC3/FCI20009832/Kda3q2
Code FCI2



PROFESSIONAL SERVICE FEE

Vehicle No. SHD 9231A
Insured Veh. SHA 1406G
Claim No. D20003676MFSH
Policy No. D-18088937MFSH
Accident Date 10/09/2020
Inspection Date 11/09/2020

Description	Total
Third Party Express Settlement	500.00
Subtotal	500.00
GST (7%)	35.00
Grand Total	535.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile

MS FIRST CAPITAL INSURANCE LTD	Ref : CC3/FCI20009832/Kda3q2
36 ROBINSON ROAD #16-01 CITY HOUSESINGAPORE 068877	Date : 26-11-2020
	Code : FCI2



1. Policy Particulars :- THIRD PARTY CLAIM

Insured Veh.	SHA 1406G	Veh. Inspected	SHD 9231A
Policy No.	D-18088937MFSH	Coverage (\$)	0.00
Claim No.	D20003676MFSH	Excess (\$)	0.00
Assign From	CHRIS	Assign Date	11/09/2020

2. Vehicle Particulars & Condition

Make & Model	TOYOTA PRIUS (A)	c.c	1798
Engine No.	HIDDEN	Year of Reg.	2019
Chassis No.	JTDKB3FU403083400	Colour	M. P. WHITE / RED
Odometer	136581	Steering	IN ORDER
Brakes	IN ORDER	Modification	STANDARD ALLOY RIM
General	GOOD		

3. Conditions of Tyres

	Size	Make	Balance
R/H Front Tyre	195/65 R15	SAILUN	9 mm
L/H Front Tyre	195/65 R15	SAILUN	9 mm
R/H Rear Tyre	195/65 R15	GOODYEAR	5 mm
L/H Rear Tyre	195/65 R15	GOODYEAR	5 mm

4. Description of Damages

	THE VEHICLE SUSTAINED DAMAGES AT THE O/S BODY. DAMAGES SEE DETAILS.
--	--

5. General Information

Accident Date	10/09/2020	Inspection Date	11/09/2020
Survey held at	TRANS-CAB AUTO SERVICES PTE LTD NO.2 ANG MO KIO ST 63 SINGAPORE 569111		

5a. Remarks

	A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.
--	--

5b. Estimate Days of Repair

	ESTIMATED NORMAL PERIOD FOR REPAIR:	3 Working Days
--	-------------------------------------	-----------------------



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 3

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SHD 9231A

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
<u>REPLACEMENT OF PARTS</u>				
1	PANEL SUB-ASSY ,FRONT DOOR ,RH	BENT	1,300.70	1,300.70
1	HINGE ASSY ,FRONT DOOR ,UPPER RH	TO REPAIR SEE LABOUR	97.50	-
1	HINGE ASSY ,FRONT DOOR ,LOWER RH	SERVICEABLE	110.60	-
1	CHECK ASSY ,FRONT DOOR	SERVICEABLE	183.80	-
1	HANDLE ASSY ,FRONT DOOR ,OUTSIDE RH	SERVICEABLE	390.60	-
1	FRAME SUB-ASSY ,FRONT DOOR OUTSIDE HANDLE ,RH	SERVICEABLE	193.50	-
1	MOTOR ASSY ,POWER WINDOW REGULATOR ,FRONT RH	SERVICEABLE	926.00	-
1	REGULATOR SUB-ASSY ,FRONT DOOR WINDOW ,RH	SERVICEABLE	238.30	-
1	TAPE, BLACK OUT ,NO 1 FRT RH	NECESSARY	13.30	13.30
1	TAPE, BLACK OUT ,NO 2 FRT RH	NECESSARY	43.50	43.50
1	TAPE, BLACK OUT ,NO 3 FRT RH	NECESSARY	26.30	26.30
1	LOCK ASSY ,FRONT DOOR W/MOTOR ,RH	TO REPAIR SEE LABOUR	603.20	-
1	PANEL SUB -ASSY ,REAR DOOR, RH	BENT	1,294.90	1,294.90
1	TAPE ,BLACK OUT ,NO.1 REAR RH	NECESSARY	21.90	21.90
1	TAPE ,BLACK OUT ,NO.2 REAR RH	NECESSARY	34.90	34.90
1	TAPE ,BLACK OUT ,NO.3 REAR RH	NECESSARY	15.40	15.40
1	HINGE ASSY ,REAR DOOR ,LOWER RH	TO REPAIR SEE LABOUR	87.10	-
1	MOTOR ASSY ,POWER WINDOW REGULATOR ,REAR RH	SERVICEABLE	926.00	-
1	REGULATOR SUB-ASSY ,REAR DOOR WINDOW RH	SERVICEABLE	206.70	-
1	MOLDING ASSY ,BODY ROCKER PANEL ,RH	SERVICEABLE	594.80	-
1	FENDER SUB-ASSY ,FRONT RH	BENT	977.80	977.80
1	LINER ,FRONT FENDER ,RH	SERVICEABLE	206.70	-
1	EMBLEM SIDE PANEL	NECESSARY	54.60	54.60
1	PROTECTOR ,FRONT FENDER SIDE PANEL ,RH	SERVICEABLE	93.90	-
1	COVER SUB -ASSY ,FRONT PILLAR ,UPR RH	SERVICEABLE	100.40	-
1	COVER ,FRONT BUMPER	SERVICEABLE	516.00	-
1	PANEL SUB-ASSY ,QUARTER, RH	TO REPAIR SEE LABOUR	871.50	-



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	LINER ,REAR WHEEL HOUSE ,RH	SERVICEABLE	139.80	-
	LESS 25% DISCOUNT		-2,567.43	-945.82
			7,702.27	2,837.48
	<u>SPECIAL NETT ITEMS</u>			
1	FRONT DOOR STICKER 'TRANS-CAB' (SN)	NECESSARY	100.00	60.00
1	REAR DOOR STICKER '6555-3333' (SN)	NECESSARY	100.00	60.00
1	FRONT WHEEL RIM COVER (SN)	SERVICEABLE	211.50	-
1	REAR WHEEL RIM COVER (SN)	SERVICEABLE	211.50	-
2	WINDSCREEN SEALANT (SN)	NOT NECESSARY	150.00	-
1	WINDSCREEN MOULDING (SN)	NOT NECESSARY	200.00	-
1	WINDSCREEN INER SPONGE SEAL (SN)	NOT NECESSARY	130.00	-
1	SET FRONT FENDER LINER CLIP (SN)	NOT NECESSARY	70.00	-
1	SET ROCKER PANEL MOULDING CLIP (SN)	NOT NECESSARY	60.00	-
1	FRONT BUMPER CLIP (SN)	NOT NECESSARY	80.00	-
1	SET FRONT RETAINER CLIP (SN)	NOT NECESSARY	70.00	-
1	REAR FENDER LINER CLIP (SN)	NOT NECESSARY	70.00	-
1	REAR BUMPER CLIP (SN)	NOT NECESSARY	80.00	-
			1,533.00	120.00
	<u>LABOUR</u>			
	TO TRANSFER OF FRONT DOOR FITTINGS ,ATTACHMENTS AND PERFORM WATER SEEPAGE TEST.		170.00	60.00
	PANEL BEATING ,KNOCKING AND STRAIGHTENING THE NECESSARY PORTION,REMOVE AND RENEWAL OF PARTS ,ADJUST AND REALIGN THE SAME.INCLUSIVE OF THE REPAIR OF HINGE ASSY ,FRONT DOOR ,UPPER RH,LOCK ASSY ,FRONT DOOR W/MOTOR ,RH ,HINGE ASSY ,REAR DOOR ,LOWER RH AND PANEL SUB-ASSY ,QUARTER, RH .		1,600.00	500.00
	TO TRANSFER OF REAR DOOR FITTINGS ,ATTACHMENTS AND PERFORM WATER SEEPAGE TEST.		170.00	60.00
	TO RUST-PROOFING AND APPLY UNDERCOAT OF THE AFFECTED AREAS.		250.00	90.00
	TO CHECK STEERING GEOMETRY AND COMPUTER WHEEL ALIGNMENT.	NOT NECESSARY	220.00	-



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:3 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	TO REMOVE AND REFIT INTERIOR FITTINGS, TRIMINGS, GARNISH, FITTINGS AND OTHER, TO ENABLE REPAIR.	NOT NECESSARY	380.00	-
	PUTTY AND SPRAY PAINTING OF THE AFFECTED PORTION .		1,600.00	880.00
	TO TRANSFER OF TIRE, RIM AND ON WHEEL BALANCING.	NOT NECESSARY	170.00	-
	TO CHECK ELECTRICAL LIGHTING CONCERNED.		170.00	20.00
	TO TRANSFER OF WINDSCREEN GLASS TO FACILITATE BODYWORK REPAIR .	NOT NECESSARY	170.00	-
	TO REMOVE AND REFIT FENDER FITTINGS, ATTACHMENT TO FACILITATE BODYWORK REPAIR .	NOT NECESSARY	350.00	-
			5,250.00	1,610.00
GRAND TOTAL			14,485.27	4,567.48
RECOMMENDED COST OF REPAIRS				4,567.48

Report Ref No. CC3/FCI20009832/Kda3q2

KONG SENG CHEONG

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contact or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd



51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SHD 9231A

INSPECTION

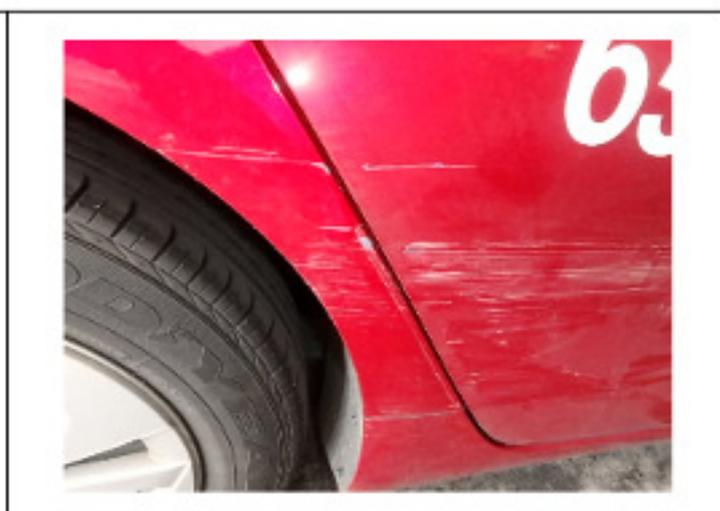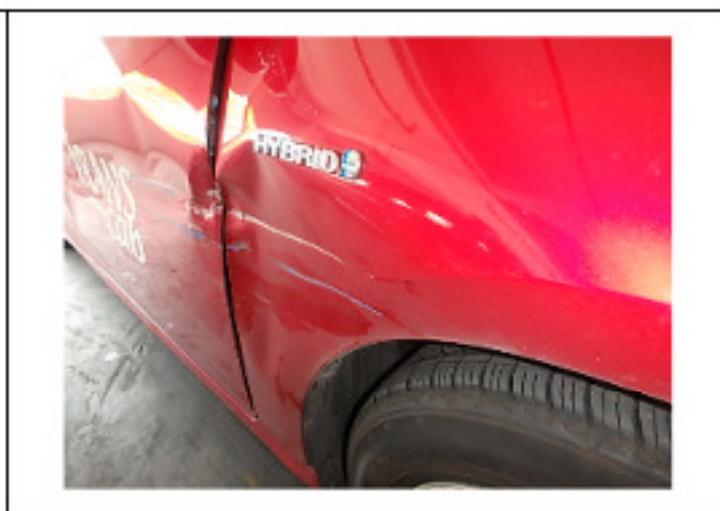




LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

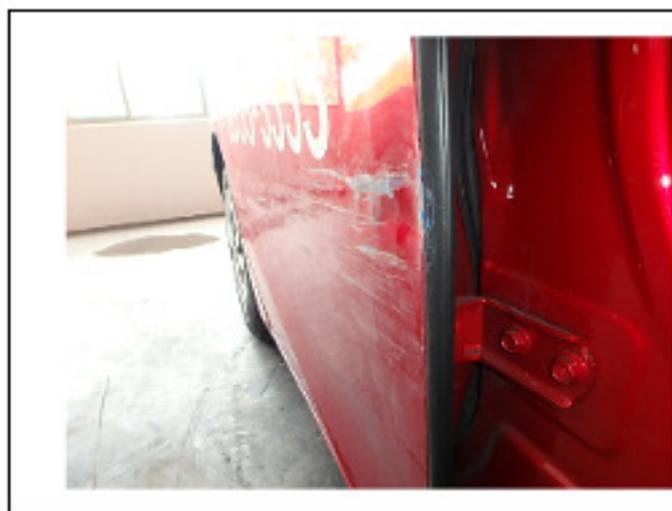



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

