



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

CHINA TAIPING INSURANCE (S) PTE LTD

INV No. AC2102630

3 ANSON ROAD #16-00
SPRINGLEAF TOWER
SINGAPORE 079909

INV Date 15/04/2021
Reference CC3/CTI20010006/Krs3q2
Code CTI

PROFESSIONAL SERVICE FEE

Vehicle No. SHD 9567G
Insured Veh. SLH 1671Y
Claim No. SNM20D203396/C02
Policy No. DMPCSNA00010102003
Accident Date 14/09/2020
Inspection Date 16/09/2020

Description	Total
Third Party Express Settlement	400.00
Subtotal	400.00
GST (7%)	28.00
Grand Total	428.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
CHINA TAIPING INSURANCE (S) PTE LTD 3 ANSON ROAD #16-00 SPRINGLEAF TOWERSINGAPORE 079909			Ref: CC3/CTI20010006/Krs3q2 Date: 15/04/2021 Code: CTI	
1. Policy Particulars :- THIRD PARTY CLAIM				
Insured Veh.	SLH 1671Y	Veh. Inspected	SHD 9567G	
Policy No.	DMPCSNA00010102003	Coverage (\$)	0.00	
Claim No.	SNM20D203396/C02	Excess (\$)	0.00	
Assign From		Assign Date	16/09/2020	
2. Vehicle Particulars & Condition				
Make & Model	TOYOTA PRIUS (A)	c.c	1798	
Engine No.	HIDDEN	Year of Reg.	2019	
Chassis No.	JTDKB3FU503082028	Colour	M . P. WHITE / RED	
Odometer	106622 KM	Steering	IN ORDER	
Brakes	IN ORDER	Modification	STANDARD ALLOY RIM	
General	GOOD			
3. Conditions of Tyres				
	Size	Make	Balance	
R/H Front Tyre	195/65 R15	SAILUN	9 mm	
L/H Front Tyre	195/65 R15	SAILUN	9 mm	
R/H Rear Tyre	195/65 R15	SAILUN	8 mm	
L/H Rear Tyre	195/65 R15	SAILUN	8 mm	
4. Description of Damages				
THE VEHICLE SUSTAINED DAMAGES AT THE N/S BODY. DAMAGES SEE DETAILS.				
5. General Information				
Accident Date	14/09/2020	Inspection Date	16/09/2020	
Survey held at	TRANS-CAB AUTO SERVICES PTE LTD NO.2 ANG MO KIO ST 63 SINGAPORE 569111			
5a. Remarks				
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.				
5b. Estimate Days of Repair				
ESTIMATED NORMAL PERIOD FOR REPAIR:		3 Working Days		



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SHD 9567G

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
<u>REPLACEMENT OF PARTS</u>				
1	PANEL SUB-ASSY ,FRONT DOOR LH	BENT / WARPED	1,300.70	1,300.70
1	MOTOR ASSY ,POWER WINDOW REGULATOR ,FRONT LH	SERVICEABLE	926.00	-
1	REGULATOR SUB-ASSY ,FRONT DOOR WINDOW ,LH	SERVICEABLE	238.30	-
1	TAPE ,BLACK OUT ,NO.1 FRT LH	NECESSARY	13.30	13.30
1	TAPE ,BLACK OUT ,NO.2 FRT LH	NECESSARY	43.50	43.50
1	TAPE ,BLACK OUT ,NO.3 FRT LH	NECESSARY	26.30	26.30
1	PANEL SUB-ASSY ,REAR DOOR ,LH	TO REPAIR SEE LABOUR	1,294.90	-
1	TAPE, BLACK OUT,NO.1 REAR LH	NOT NECESSARY	21.90	-
1	TAPE, BLACK OUT,NO.2 REAR LH	NOT NECESSARY	34.90	-
1	TAPE, BLACK OUT,NO.3 REAR LH	NOT NECESSARY	15.40	-
1	HINGE ASSY ,REAR DOOR ,LOWER LH	TO REPAIR SEE LABOUR	87.10	-
1	MOTOR ASSY ,POWER WINDOW REGULATOR ,REAR LH	SERVICEABLE	926.00	-
1	REGULATOR SUB-ASSY ,REAR DOOR WINDOW ,LH	SERVICEABLE	206.70	-
1	MOULDING ASSY ,BODY ROCKER PANEL LH	SERVICEABLE	594.80	-
1	REINFORCEMENT SUB-ASSY ,ROCKER ,OUTER LH	TO REPAIR SEE LABOUR	583.40	-
1	PANEL SUB-ASSY ,QUARTER LH	TO REPAIR SEE LABOUR	871.50	-
1	LINER ,REAR WHEEL HOUSE ,LH	SERVICEABLE	139.80	-
	LESS 25% DISCOUNT		-1,831.13	-345.95
			5,493.37	1,037.85
<u>SPECIAL NETT ITEMS</u>				
1	FRONT DOOR STICKER 'TRANS-CAB' (SN)	NECESSARY	100.00	60.00
1	REAR DOOR STICKER '6555-3333' (SN)	NECESSARY	100.00	60.00
1	WHEEL ,RIM (SN)	SERVICEABLE	1,879.40	-
2	WINDSCREEN SEALANT (SN)	NOT NECESSARY	150.00	-
1	WINDSCREEN MOULDING (SN)	NOT NECESSARY	200.00	-
1	WINDSCREEN INNER SPONGE SEAL (SN)	NOT NECESSARY	130.00	-
1	REAR FENDER LINER CLIP (SN)	NOT NECESSARY	75.00	-

Report Ref No. CC3/CTI20010006/Krs3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	REAR BUMPER CLIP (SN)	NOT NECESSARY	85.00	-
1	SET ROCKER PANEL MOULDING CLIP (SN)	NOT NECESSARY	65.00	-
			2,784.40	120.00
	LABOUR			
	TO TRANSFER OF DOOR FITTINGS ,ATTACHMENTS AND PERFORM WATER SEEPAGE TEST.		300.00	60.00
	PANEL BEATING ,KNOCKING AND STRAIGHTENING THE NECESSARY PORTION,REMOVE AND RENEWAL OF PARTS ,ADJUST AND REALIGN THE SAME.INCLUSIVE OF THE REPAIR OF PANEL SUB-ASSY ,REAR DOOR ,LH,HINGE ASSY ,REAR DOOR ,LOWER LH ,REINFORCEMENT SUB-ASSY ,ROCKER ,OUTER LH AND PANEL SUB-ASSY ,QUARTER LH .		1,400.00	500.00
	TO RUST-PROOFING AND APPLY UNDERCOAT OF THE AFFECTED AREAS.		250.00	30.00
	TO CHECK STEERING GEOMETRY AND COMPUTER WHEEL ALIGNMENT .	NOT NECESSARY	220.00	-
	TO REMOVE AND REFIT INTERIOR FITTINGS,TRIMINGS,GARNISH,FITTINGS AND OTHER ,TO ENABLE REPAIR.		380.00	60.00
	PUTTY AND SPRAY PAINTING OF THE AFFECTED PORTION .		1,400.00	880.00
	TO TRANSFER OF TIRE ,RIM AND ON WHEEL BALANCING .	NOT NECESSARY	170.00	-
	TO CHECK ELECTRICAL LIGHTING CONCERNED .		170.00	20.00
	TO TRANSFER OF WINDSCREEN GLASS TO FACILITATE BODYWORK REPAIR .	NOT NECESSARY	170.00	-
			4,460.00	1,550.00
GRAND TOTAL			12,737.77	2,707.85
RECOMMENDED COST OF REPAIRS				2,707.85

Report Ref No. CC3/CTI20010006/Krs3q2

KONG SENG CHEONG

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd


51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SHD 9567G

INSPECTION

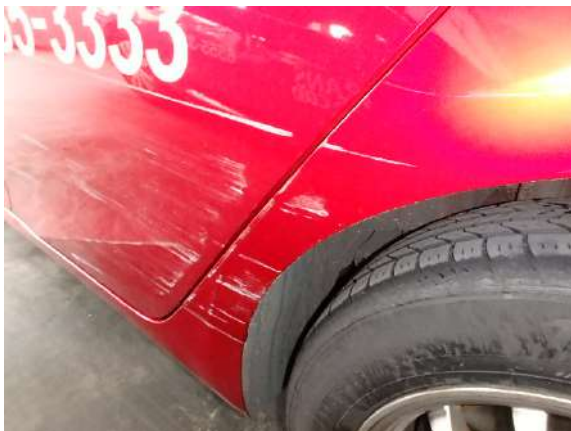




LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

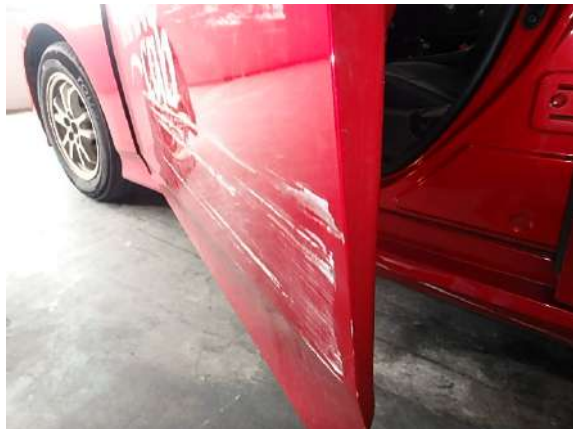



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SHD 9567G

RE-INSPECTION

