



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

MS FIRST CAPITAL INSURANCE LTD

INV No. AC2101504

36 ROBINSON ROAD
#16-01 CITY HOUSE
SINGAPORE 068877

INV Date 10/03/2021
Reference CC4/FCI20010111/Aea3q2
Code FCI2

PROFESSIONAL SERVICE FEE

Vehicle No. SKX 4822L
Insured Veh. SHD 6937S
Claim No. D20003773MFSH
Policy No. D-18088936MFSH
Accident Date 16/09/2020
Inspection Date 22/09/2020

Description	Total
Third Party Express Settlement	500.00
Subtotal	500.00
GST (7%)	35.00
Grand Total	535.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
MS FIRST CAPITAL INSURANCE LTD 36 ROBINSON ROAD #16-01 CITY HOUSESINGAPORE 068877			Ref: CC4/FCI20010111/Aea3q2	
			Date: 10/03/2021	
			Code: FCI2	
1. Policy Particulars :- THIRD PARTY CLAIM				
Insured Veh.	SHD 6937S	Veh. Inspected	SKX 4822L	
Policy No.	D-18088936MFSH	Coverage (\$)	0.00	
Claim No.	D20003773MFSH	Excess (\$)	0.00	
Assign From	CHRIS	Assign Date	21/09/2020	
2. Vehicle Particulars & Condition				
Make & Model	TOYOTA ALTIS	c.c	1598	
Engine No.	HIDDEN	Year of Reg.	2015	
Chassis No.	MR053REH104543958	Colour	RED	
Odometer	92308 KM	Steering	IN ORDER	
Brakes	IN ORDER	Modification	SPORTS RIM	
General	GOOD			
3. Conditions of Tyres				
	Size	Make	Balance	
R/H Front Tyre	205/55 R16	YOKOHAMA	6 mm	
L/H Front Tyre	205/55 R16	YOKOHAMA	6 mm	
R/H Rear Tyre	205/55 R16	YOKOHAMA	6 mm	
L/H Rear Tyre	205/55 R16	YOKOHAMA	6 mm	
4. Description of Damages				
THE VEHICLE SUSTAINED DAMAGES AT THE FRONT N/S PORTION. DAMAGES SEE DETAILS.				
5. General Information				
Accident Date	16/09/2020	Inspection Date	22/09/2020	
Survey held at	COMFORTDELGRO ENGINEERING PTE LTD NO : 320 UBI ROAD 3 SINGAPORE 408649			
5a. Remarks				
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.				
5b. Estimate Days of Repair				
ESTIMATED NORMAL PERIOD FOR REPAIR:			5 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SKX 4822L

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	BONNET	DENTED	1,685.88	1,140.40
1	BONNET HINGE RH	NOT NECESSARY	79.51	-
1	BONNET HINGE LH	NOT NECESSARY	79.51	-
1	BONNET RUBBER	NOT NECESSARY	43.20	-
1	BONNET LOCK	NOT NECESSARY	182.25	-
1	LHF HEADLAMP	CRACKED	3,602.50	2,568.00
1	LHF FENDER	DISTORTED	1,226.74	790.40
1	LHF FENDER COWLING	DEFORMED	282.28	282.28
8	LHF FENDER COWLING CLIPS	NECESSARY	24.88	24.88
1	LHF FENDER DUAL VVT-I	NECESSARY	47.92	47.92
1	RADIATOR GRILLE ASSY	NOT NECESSARY	868.05	-
1	RADIATOR SUPPORT PANEL	TO REPAIR SEE LABOUR	1,534.00	-
1	FRONT BUMPER	DISTORTED	716.98	589.70
15	FRONT BUMPER CLIPS	NECESSARY	91.05	30.00
1	FRONT BUMPER SIDE RETAINER LH	DAMAGED	115.42	55.90
1	FRONT BUMPER SPONGE	NOT NECESSARY	121.63	-
1	FRONT BUMPER REINFORCEMENT	NOT NECESSARY	539.32	-
1	FOG LAMP LH	NOT NECESSARY	419.04	-
1	FOG LAMP COVER LH	NOT NECESSARY	152.14	-
1	RESONATOR TANK	CRACKED	144.45	144.45
1	RESONATOR TANK TUBE UPPER	NOT NECESSARY	181.03	-
1	RESONATOR TANK TUBE LOWER	DISTORTED	258.52	258.52
1	HEADLAMP CHROME MOULDING LH (ADDITIONAL)	CUT	250.00	184.00
1	HEADLAMP RH (ADDITIONAL)	CRACKED	3,602.50	2,568.00
	LESS 25% DISCOUNT		-4,062.20	-2,171.11
			12,186.60	6,513.34
	<u>LABOUR</u>			
	TO DISCONNECT AND CHECK ELECTRICAL WIRING ,WIRE SOCKETS ,ETC ,REMOVE REINSTALL DAMAGE PARTS ,TEST AND RETIFY FOR PROPER FUNCTIONING.		100.00	30.00



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	TO CUT AND WELD RADIATOR SUPPORT PANEL,KNOCK & REPAIR LHF FENDER INNER PANEL ,LHF WHEEL HOUSE,LHF DOOR AND AFFECTED AREA.INCLUSIVE OF THE REPAIR OF RADIATOR SUPPORT PANEL.		1,050.00	600.00
	TO PUTTY & SPRAY PAINT FRT BONNET ,FRT BUMPER ,FRT FENDER ,INNER PANEL ,WHEEL HOUSE ,LHF DOOR AND AFFECTED AREA.		1,200.00	800.00
	REPROGRAM HEADLAMP.	NOT NECESSARY	280.00	-
			2,630.00	1,430.00
GRAND TOTAL			14,816.60	7,943.34
RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)				6,350.00

Report Ref No. CC4/FCI20010111/Aea3q2

ADRIAN LING WAI PING

B.Eng,AMSOE,AMIRTE,AMSAE-A,M.MATAI

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SKX 4822L

INSPECTION






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

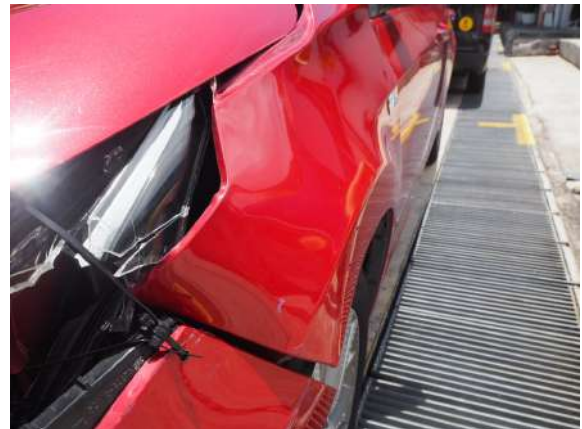



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R







LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

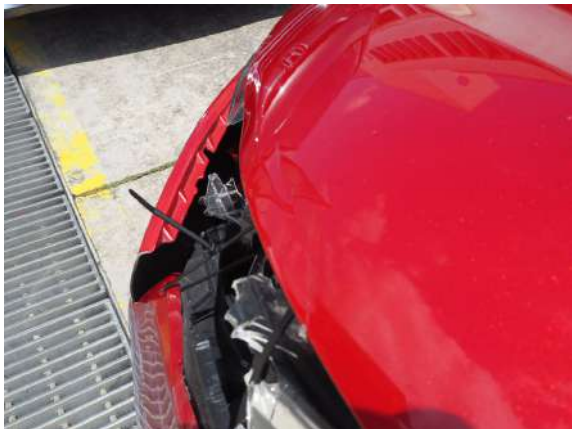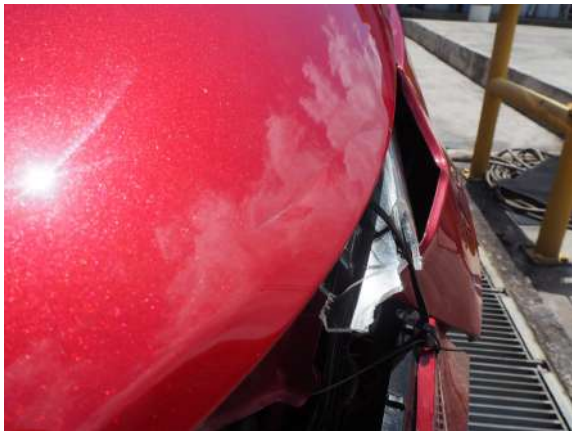



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SKX 4822L

RE-INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SKX 4822L

RE-INSPECTION

