

LAW

REF: C S1/Im120010 K31 K+13

Special Instruction:

4/Sum: \$14850.00

ASSIGNMENT (Office)

From (Person): Stella ow of TKA Date/Time: 23-9-2020

Estimated Cost: Bill to:

Third Parties:

Claimant:

Surveyor:

Workshop: Hui Yang Motor

OD/TP Re-inspection / Evaluation

To Inspect Vehicle No: SJM 7710B Insured: VAQ 6200

at Workshop m/s Hui yang motor Tel: 6451 5752

of 176 sin ming Drive sin ming Autocare #104-02

Policy No: CF.MKC.so.0302.19-tm(m) Claim No: A0258513

Sum Insured: Excess:

Make of Veh: D.O.A. 05-06-2019

(Client's Record)

H.O.D. Endorsement/Date:

Date/Time: Person Contacted: Vehicle IN / OUT

Date/Time: Confirmed with Final Fig , days (Red \$ / %; Original /2 days)

Date/Time: 3/11/2020 Submit Final Fig 9150 , 10 days (Red \$ 5700 / 38 %; Original days)

Date/Time	Action/Instruction
23/9/20	SJM 7710B - X
	VAQ 6200B - X
	SGN Dam.
	bill to tokio malaysia

Para(1) : Parts found not replaced (To highlight R or UB, LR, Etc)

Para(2) : Comments on consistency of damages (Parts Not Consistent : NC)

Para(3) : Nett Value

Market Value : _____

Salvage Value : _____

Nett Value : _____

Inspected/
Evaluated by:

Fee Charged:

Basic & Add

Transport

Photos

Others

Total

Date:

- 1) Date/Time _____ File Pass to _____
- 2) Date/Time _____ File Return to _____
- 3) Date/Time _____ File Pass to _____
- 4) Date/Time _____ File Return to _____
- 5) Date/Time _____ File Pass to _____
- 6) Date/Time _____ File Return to _____

INFINITI

APPRAISAL SERVICE
ROC No: 53196942L

c/o Hui Yang Motor Pte Ltd
176 Sin Ming Drive Sin Ming Autocare
#04-02 Singapore 575721

VEHICLE DAMAGE INSPECTION REPORT

CLAIM REFERENCE

Our Ref. No.	: 21740	Claim Number	: TBA
Accident Date	: 05-06-2018	Insured Vehicle	: VAQ6200
Survey Date	: 06-06-2018	Claim Type	: Third Party
Report Date	: 26-06-2018		

DESCRIPTION AND IDENTIFICATION OF VEHICLE

Vehicle No.	: SJM7710B	Chassis No.	: JTDER12W403001637
Registration Date	: 15-01-2009	Engine No.	: 1ZZ3222588
Make	: TOYOTA	Engine Cap.	: 1794 cc
Model	: WISH 1.8 AUTO	Transmission	: Automatic
		Colour	: White

CONDITION OF VEHICLE AT THE TIME OF SURVEY

Foot Brake	: Serviceable	Steering	: Serviceable
Hand Brake	: Serviceable	Modification	: None
Odometer	: 162059		

<u>TYRES</u>	<u>SIZE</u>	<u>MAKE</u>	<u>BALANCE</u>
FRONT RH	195/60 R15	TOYO	5 mm
FRONT LH	195/60 R15	TOYO	5 mm
REAR RH	195/60 R15	TOYO	5 mm
REAR LH	195/60 R15	TOYO	5 mm

SURVEY CONDUCTED PLACE

HUI YANG MOTOR PTE LTD
BLK 176 SIN MING DRIVE
#04-02 SIN MING AUTOCARE
SINGAPORE 575721

INSPECTION SUMMARY

Workshop Estimate	: S\$ 23838.11
Our Recommendation	: S\$ 14850.00 (lumpsum)
Estimated Repair Period	: 12 working days

We have not authorised repairs. This survey was carried out on without prejudice basis.

'INFINITI APPRAISAL SERVICE
RECOMMENDED SPARE PARTS

SJM7710B-05062018

#	Qty	Parts Description	Condition	Repairer's Estimate (\$)	Our Adjustment (\$)
LIST ITEM					
1	1	Front Rhfender	Dented	690.50	690.50
2	1	Front Rhfender Lamp	Broken	145.80	145.80
3	1	Front Rhfender Inner Shield	Deformed	218.00	218.00
4	8	Front Rhfender Inner Shield Clips @\$12.90	Necessary	103.20	103.20
5	1	Front Rhwheel House	Bent	<i>R</i> 890.00	890.00 X
6	1	Front Rhknuckle Arm	Bent	448.00	448.00
7	1	Front Rhknuckle Arm Bearing	Affected	218.00	218.00
8	1	Front Rhlinkage	Bent	<i>Sm</i> 229.00	229.00 X
9	1	Front Rhabsorber	Bent	698.00	698.00
10	1	Front Rhpillar	Bent	<i>R</i> 758.00	758.00 X
11	1	Front Rhdoor <i>1295.</i>	Buckled	1460.00	1460.00
12	2	Front Rhdoor Hinge @\$158.00	Bent	316.00	316.00
13	1	Front Rhdoor Side Mirror	Broken	971.45	971.45
14	1	Front Rhdoor Side Mirror Cover	Grazed	190.00	190.00
15	1	Front Rhdoor Handle	Broken	185.00	185.00
16	1	Front Rhdoor Handle Key Lock Cover	Broken	168.00	168.00
17	2	Front Rhdoor Handle Rubber @\$148.00	Necessary	296.00	296.00
18	1	Front Rhdoor Glass <i>399-70</i>	Shattered	650.00	650.00
19	1	Front Rhdoor Glass Moulding	Necessary	190.00	190.00
20	1	Front Rhdoor Glass Motor <i>401.90</i>	Malfunction	620.00	620.00
21	1	Front Rhdoor Glass Motor Gear <i>131.80</i>	Bent	320.00	320.00
22	1	Front Rhdoor Moulding	Necessary	195.00	195.00
23	1	Front Rhdoor Inner Rubber	Necessary	295.00	295.00 <i>50/in</i>
24	1	Front Rhdoor Inner Lock <i>426.60</i>	Jammed	580.00	580.00
25	1	Front Rhdoor Inner Trim	Deformed	785.00	785.00
26	1	Rear Rhdoor <i>1198</i>	Grazed	1350.00	1350.00
27	1	Rear Rhdoor Hinge @\$158.00	Bent	316.00	316.00
28	1	Rear Rhdoor Inner Rubber	Necessary	<i>Sm</i> 295.00	295.00 X
29	1	Rear Rhinner Lock	Reuse	580.00	0.00
30	1	Rear Rhside Centre Pillar	Bent	<i>R</i> 780.00	780.00 X
31	1	Rear Rhfender	Dented	<i>R</i> 1400.00	1400.00 X
32	1	Rear Rhfender Inner Shield	Deformed	<i>Sm</i> 320.00	320.00 X
33	8	Rear Rhfender Inner Shield Clips @\$12.90	Necessary	<i>Sm</i> 103.20	103.20 X
34	1	Rear Rhabsorber	Bent	<i>Sm</i> 350.00	350.00 X
35	1	Rear Axle	Reuse	3200.00	0.00
36	1	Rear Axle Rh Wheel Bearing	Affected	<i>Sm</i> 580.00	580.00 X
37	1	Rear Bumper <i>545.00</i>	Deformed	985.00	985.00
38	1	Rear Bumper Rh Side Retainer	Necessary	185.00	185.00
Subtotal				22064.15	18284.15
Less 25 %				5516.04	4571.04
TOTAL				16548.11	13713.11

SPECIAL NETT ITEM

1	1	Front Rh Door Glass Solar Film	Necessary	200.00	150.00
---	---	--------------------------------	-----------	--------	--------

**INFINITI APPRAISAL SERVICE
RECOMMENDED LABOUR**

SJM7710B-05062018

#	Job Description	Repairer's Estimate (S\$)	Our Adjustment (S\$)
1	Remove & refix undercarriage.	580.00	300.00 <i>200</i>
2	Remove & n refix dashboard.	<i>NRV</i> 380.00	250.00 <i>X</i>
3	Remove & refix front rh door glass.	120.00	60.00
4	Alignment.	100.00	80.00
5	Tuffkote.	300.00	120.00
6	Wiring.	250.00	120.00 <i>40</i>
7	Spray painting.	1800.00	1400.00
8	Labour charges.	2000.00	1400.00 <i>1200</i>
TOTAL LABOUR COST		5530.00	3730.00

COST OF CLAIM

Description	Repairer's Estimate (S\$)	Our Adjustment (S\$)
Total Recommended Parts	18308.11	14863.11
Total Recommended Labour	5530.00	3730.00
Total Cost of Claim	23838.11	18593.11

INFINITI APPRAISAL SERVICE
OUR FINDINGS AND RECOMMENDATION

SJM7710B-05062018

OUR FINDINGS

At the place of survey, we saw this vehicle sustained damage.

The damages seen during our survey were rhs & undercarriage and etc being damaged. The detailed description of the damages is listed as 'RECOMMENDED SPARE PARTS'.

OUR RECOMMENDATION

HUI YANG MOTOR PTE LTD estimated a repair cost of S\$23838.11. We adjusted it to S\$18593.11 on a part-by-part basis.


We recommend repairs to this vehicle be carried out on a lumpsum basis at S\$14850.00 .

repairs would require a period of 12 working days.

We submit our inspection report for your kind attention and would add the inspection was carried out to the best of our ability, knowledge and experience.



Edward Cho
INFINITI APPRAISAL SERVICE

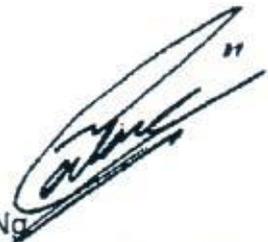

Cedric Ng
INFINITI APPRAISAL SERVICE