



## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

### TAX INVOICE

CHINA TAIPING INSURANCE (S) PTE LTD  
3 ANSON ROAD #16-00  
SPRINGLEAF TOWER  
SINGAPORE 079909

INV No. AC2007998  
INV Date 27/11/2020  
Reference CC3/CTI20010339/T1ds3q2  
Code CTI



### PROFESSIONAL SERVICE FEE

Vehicle No. SHD 1547S  
Insured Veh. GBH 8597B  
Claim No. SNM20D203543  
Policy No. DMCVSNW00016522001  
Accident Date 23/09/2020  
Inspection Date 28/09/2020

Description	Total
Third Party Express Settlement	400.00
<b>Subtotal</b>	<b>400.00</b>
<b>GST (7%)</b>	<b>28.00</b>
<b>Grand Total</b>	<b>428.00</b>

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd



## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

### Affiliated to Federation Internationale Des Experts En Automobile

CHINA TAIPING INSURANCE (S) PTE LTD

Ref : CC3/CTI20010339/T1ds3q2

3 ANSON ROAD #16-00  
SPRINGLEAF TOWERS SINGAPORE 079909

Date : 27-11-2020



Code : CTI

#### 1. Policy Particulars :- THIRD PARTY CLAIM

Insured Veh.	GBH 8597B	Veh. Inspected	SHD 1547S
Policy No.	DMCVSNW00016522001	Coverage (\$)	0.00
Claim No.	SNM20D203543	Excess (\$)	0.00
Assign From		Assign Date	28/09/2020

#### 2. Vehicle Particulars & Condition

Make & Model	HYUNDAI I30	c.c	1582
Engine No.	HIDDEN	Year of Reg.	2017
Chassis No.	TMAD281UVHJ134092	Colour	SILVER
Odometer	288214	Steering	IN ORDER
Brakes	IN ORDER	Modification	SPORTS RIM
General	GOOD		

#### 3. Conditions of Tyres

	Size	Make	Balance
R/H Front Tyre	195/65 R15	MAXXIS	6 mm
L/H Front Tyre	195/65 R15	MAXXIS	6 mm
R/H Rear Tyre	195/65 R15	MAXXIS	6 mm
L/H Rear Tyre	195/65 R15	MAXXIS	6 mm

#### 4. Description of Damages

THE VEHICLE SUSTAINED DAMAGES AT THE REAR PORTION. DAMAGES SEE DETAILS.
--

#### 5. General Information

Accident Date	23/09/2020	Inspection Date	28/09/2020
Survey held at	PREMIER AUTOMOTIVE SERVICES PTE LTD 23 CHANGI SOUTH AVENUE 2 #01-02 SINGAPORE 486443		

#### 5a. Remarks

A) THE INSPECTION WAS CONDUCTED ON A "WITHOUT PREJUDICE" BASIS. B) IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.
---

#### 5b. Estimate Days of Repair

ESTIMATED NORMAL PERIOD FOR REPAIR:	3 Working Days
-------------------------------------	----------------



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

## ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SHD 1547S

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
<b><u>REPLACEMENT OF PARTS</u></b>				
2	N/S & O/S REFLECTOR @\$295.10	NOT NECESSARY	590.20	-
1	TAILGATE	TO REPAIR SEE LABOUR	2,292.30	-
1	TAILGATE LOWER GARNISH	CRACKED	362.61	362.61
1	TAILGATE WEATHERSTRIP	NOT NECESSARY	276.98	-
1	TAILGATE LOCK	NOT NECESSARY	216.48	-
2	REAR LICENSE PLATE LAMP @\$18.60	NOT NECESSARY	37.20	-
1	END PANEL TOP GARNISH	NOT NECESSARY	90.00	-
1	EMBLEM I30	NECESSARY	27.80	27.80
1	EMBLEM CRDI	NECESSARY	29.40	29.40
1	EMBLEM HYUNDAI	NECESSARY	29.40	29.40
1	REAR BUMPER	DEFORMED	811.11	811.11
1	REAR BUMPER SPONGE	NOT NECESSARY	79.20	-
1	REAR BUMPER REINFORCEMENT	NOT NECESSARY	815.64	-
1	REAR BUMPER REINFORCEMENT CENTRE	NOT NECESSARY	79.20	-
2	REAR BUMPER N/S & O/S SIDE BRACKET @\$52.20	NOT NECESSARY	104.40	-
2	REAR BUMPER N/S & O/S REFLECTOR @\$107.50	NOT NECESSARY	215.00	-
	LESS 20% DISCOUNT		-1,211.38	-252.06
			4,845.54	1,008.26
<b><u>SPECIAL NETT ITEMS</u></b>				
1	SET REAR BUMPER CLIPS (SN)	NECESSARY	48.00	30.00
1	SET REVERSE SENSOR (SN)	NOT WORKING	280.00	200.00
1	SET TAILGATE STICKERS (SN)	NECESSARY	100.00	100.00
1	SET TAILGATE LOWER GARNISH CLIPS (SN)	NECESSARY	38.00	20.00
1	SET END PANEL INNER GARNISH CLIPS (SN)	NOT NECESSARY	38.00	-
1	REAR NUMBER PLATE (SN)	NOT NECESSARY	50.00	-
1	SET SEALANT (SN)	NOT NECESSARY	50.00	-
1	REAR BUMPER TOP PROTECTOR (SN)	NOT NECESSARY	80.00	-
1	SUNDRY (SN)	NECESSARY	50.00	20.00
			734.00	370.00

Report Ref No. CC3/CTI20010339/T1ds3q2



## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<b>LABOUR</b>			
	TOWING FEE.	NOT NECESSARY	50.00	-
	TO DISMANTLE/REFIT REAR WINDSCREEN GLASS ONTO NEW TAILGATE.	NOT NECESSARY	120.00	-
	TO DISMANTLE AND REFIT THE INNER COMPONENTS OF WIPER ONTO NEW TAILGATE,TEST WIPER MOTOR AND WATER ETC.	NOT NECESSARY	120.00	-
	TO DISMANTLE AND REPLACE REVERSE SENSOR AND TEST SYSTEM.		80.00	30.00
	TO LABOUR CHARGE FOR DISMANTLE AND RENEWAL OF THE ACCIDENT DAMAGED PARTS.TO HEAT/WELD & CUT END PANEL.INCLUDING KNOCK-OUT,STRAIGHTEN,REPAIR,RESHAPE OF THE SAME.INCLUSIVE OF THE REPAIR OF TAILGATE.		1,000.00	400.00
	TO PUTTY AND SPRAY PAINTING ON THE REAR BUMPER,TAILGATE,TAILGATE LOWER GARNISH,TAILGATE,END PANEL.		800.00	500.00
	TO APPLY RUSTPROOFING ON THE REPAIRED AND REPLACED PANELS.	NOT NECESSARY	150.00	-
			2,320.00	930.00
	<b>GRAND TOTAL</b>		<b>7,899.54</b>	<b>2,308.26</b>
	<b>RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)</b>			<b>1,800.00</b>

Report Ref No. CC3/CTI20010339/T1ds3q2

MOHAMAD TAUFIKH

M.MATAI, AMSAE-A

Automotive Assessor

HO LEONG CHUAN

Automotive Assessor

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SHD 1547S

INSPECTION







## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R







## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R








## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

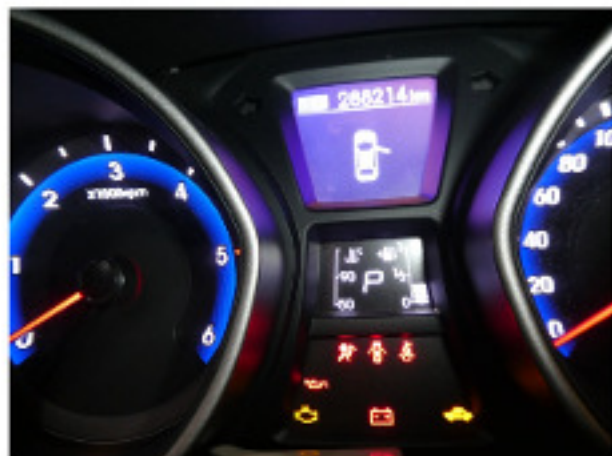



## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SHD 1547S

RE-INSPECTION

