

No.25 Kaki Bukit Road 4 #06-46 Synergy @KB Singapore 417800 Hotline: 6385 1171

Our reference:

20-08-9348

Date:

10/8/2020

INVOICE NO.

9348

Enforce Automatics Global Pte Ltd c/o Assure Auto Assist Pte Ltd 23 Tuas Avenue 18 Singapore 638902

Registration No.

GBB5074U

We enclose our fee note for your kind attention, which remains payable irrespective of the outcome of this case.

S/No.	Description of Services Provided	Qty	A	Amount
1	Being vehicle damage assessment report, inspection, photographs, transport and miscellaneous.	1	\$	421.00
		Total amount	\$	421.00

Please kindly cross all cheques made payable to "Impact Analysis Consultant".

We thank you in anticipation for your prompt payment.

~

L. L. Tan (Ms)
Principal Consultant



No.25 Kaki Bukit Road 4 #06-46 Synergy @KB Singapore 41780

Hotline: 6385 1171

Our reference:

20-08-9348

Date:

10/8/2020

c/o Assure Auto Assist Pte Ltd 23 Tuas Avenue 18 Singapore 638902

Dear Sirs

RE:

Road Traffic Accident on 17/7/2020 Enforce Automatics Global Pte Ltd

In accordance with your instructions received in this office on

28/7/2020

, we made arrangements to

examine the vehicle on

28/7/2020

at above-mentioned address. The following data was

recorded:

Vehicle details


Make	Toyota	Registration	GBB5074U	
Model	Dyna	Chassis	JTFAT35Y10K200506	
Colour	White	Gearbox	Manual	
Odometer	330743km	Paintwork	Good	
Steering	In order	Brakes In order		
Condition	Good			

Tyre Depths

Front left	195R15C	90% Yokohama
Front right	195R15C	90% Yokohama
Rear left	155R12C	90% Yokohama
Rear right	155R12C	90% Yokohama

Status	REPAIRABLE		
Magnitude	Medium		
Legal status	Unroadworthy		

Impact Direction & Area of Damage:

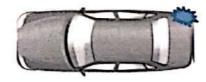

Following our examination of the accident damage, we have calculated repair times and method, which are detailed on page 2 & 3. We would recommend a sum of \$2,653.86 and 4 working days for repair, which is sufficiently lower than the pre accident value to render the vehicle an economically and physically reliable proposition.

- Impact Analysis Consulting Pte Ltd Impact Analysis Academy Pte Ltd IA Racking Solutions Pte Ltd
- IA Accounting & Consultancy Pte Ltd
 Infoknights International Services (Philippines)
 IABN Pte Ltd
 www.iaconsultingsg.com



No.25 Kaki Bukit Road 4 #06-46 Synergy @KB Singapore 41780

Hotline: 6385 1171

Our reference

20-08-9348

Date

10/8/2020

Page

2

Section A: Damaged Parts Assessment

Part's Description	Qty	Condition As inspected	Repairer's Estimate	Our Adjustment
List Items:				markanturation and the
Side gate rh ★ Repair	1	dented/warped	1325.40	1325.40
Side gate lower hinges @\$45.00 ★ Repair	6	damaged	270.00	270.00
Side gate lock rh X Repair	1	bent	215.40	215.40
Side gate lower end panel rh X Repair	1	repair.respray	554.70	0.00
Rear wheel rear guard rh X Repair	1	damaged	102.40	102.40
Rear wheel front guard rh X Repair	1	damaged	102.40	102.40
	Sub- Tota	l costs	2570.30	2015.60
Percentage of	discount :	25%	642.58	503.90
Sub-	Total cost	ts for parts	1927.73	1511.70
Special Nett Items: Side gate company advertisment sticker rh		necessary ts for parts	615.00 615.00	615.00 615.00
Parts Repair	Total cos	is for puris	013.00	013.00
		**	0.00	0.00
	Sub- Tota	al costs	0.00	0.00
Ta	tal costs	for parts	2542.73	2126.70

[•] Impact Analysis Consulting Pte Ltd • Impact Analysis Academy Pte Ltd • IA Racking Solutions Pte Ltd

[•] IA Accounting & Consultancy Pte Ltd • Infoknights International Services (Philippines) • IABN Pte Ltd www.iaconsultingsg.com



No.25 Kaki Bukit Road 4 #06-46 Synergy @KB Singapore 41780 Hotline: 6385 1171

Our reference

20-08-9348

Date

10/8/2020

Page

3

Section B: Labour Cost Calculation

	Hourl	y rate	Manhr. Req.	Total	
To dismantle, replace, cut, weld, knock out dents to straighten accident parts as-mentioned on the 'Parts Repair' column inclusive of replacement parts.		\$ 45.00 10		\$ 450.00	200
Putty & Spray painting to adjacent panels. Job allowance. Paint / material.	Sub-contract work.		\$ 450.00	/	
Apply rust proofing on the adjacent panels.	Sı	ub-cont	ract work.	\$ 30.00	×
Wiring and bulb checking	\$ 4	15.00	0.5	\$ 22.50	×
	T	otal lal	our cost	\$ 952.50	

Manhour rate and the number of manhours required for each repairing task are formulated based on individual workshop's operating cost and in-house@ IA Research Guidelines respectively.

950

2 days

[•] Impact Analysis Consulting Pte Ltd • Impact Analysis Academy Pte Ltd • IA Racking Solutions Pte Ltd

 [◆] IA Accounting & Consultancy Pte Ltd
 ◆ Infoknights International Services (Philippines)
 ◆ IABN Pte Ltd www.iaconsultingsg.com



No.25 Kaki Bukit Road 4 #06-46 Synergy @KB Singapore 41780 Hotline: 6385 1171

Our reference

20-08-9348

Date

10/8/2020

Section C: Summary Table of Total Repair Cost

Description Damaged Parts Assessment (See section A)		Cost	
		\$2,126.70	
Further discount	20%	\$425.34	
Recommended cost of parts replacement		\$1,701.36	(1)
Labour Cost Calculation (See section B)		\$952.50	(2)
Total Repair Cost (Round off to hundred)		\$2,653.86	(1) + (2)

We would recommend a sum of	\$2,653.86	and	4	working days for repair
No further items will be approved w	vithout our expresse	ed written agreem	ent. Any signi	ficant additional
items will be subject to a supplement	ntary report.			

Mechanical Engineer, Accident Expert Witness, Licensed Appraiser (Automobile)

B.Eng. (Hons, NUS)

Diploma.Mechanical Engineering

NTC-2 Automovite Technology

Sr.MIES, Institution of Engineers, Singapore (#20100091)

MATAI, Maryland Association of Traffic Accident Investigators

IAARS, International Association of Accident Reconstruction Specialists

PMC of Singapore Business Advisors & Consultants Council

ACTA certified Trainer, Singapore

SPRING- Recognised Certification for Management Consultants

- Impact Analysis Consulting Pte Ltd
 Impact Analysis Academy Pte Ltd
 IA Racking Solutions Pte Ltd
- IA Accounting & Consultancy Pte Ltd ◆ Infoknights International Services (Philippines) ◆ IABN Pte Ltd www.iaconsultingsg.com



R.155R.12.8(D) : F.195/75R.18













