



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

MS FIRST CAPITAL INSURANCE LTD

INV No. AC2106039

36 ROBINSON ROAD
#16-01 CITY HOUSE
SINGAPORE 068877

INV Date 26/08/2021
Reference CC4/FCI20010726/Aes3q2
Code FCI2

PROFESSIONAL SERVICE FEE

Vehicle No. SJG 5236Z
Insured Veh. SHA 3260X
Claim No. D20004041MFSH
Policy No. D-20094922MFSH
Accident Date 04/10/2020
Inspection Date 06/10/2020

Description	Total
Third Party Express Settlement	600.00
Subtotal	600.00
GST (7%)	42.00
Grand Total	642.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
MS FIRST CAPITAL INSURANCE LTD 36 ROBINSON ROAD #16-01 CITY HOUSESINGAPORE 068877			Ref: CC4/FCI20010726/Aes3q2	
			Date: 26/08/2021	
			Code: FCI2	
1. Policy Particulars :- THIRD PARTY CLAIM				
	Insured Veh.	SHA 3260X	Veh. Inspected	SJG 5236Z
	Policy No.	D-20094922MFSH	Coverage (\$)	0.00
	Claim No.	D20004041MFSH	Excess (\$)	0.00
	Assign From	VIC	Assign Date	06/10/2020
2. Vehicle Particulars & Condition				
	Make & Model	HONDA ACCORD	c.c	1998
	Engine No.	HIDDEN	Year of Reg.	2008
	Chassis No.	CL73304409	Colour	WHITE
	Odometer	313406 KM	Steering	IN ORDER
	Brakes	IN ORDER	Modification	SPORTS RIM
	General	GOOD		
3. Conditions of Tyres				
		Size	Make	Balance
	R/H Front Tyre	225/50 R17	CONTINENTAL	6 mm
	L/H Front Tyre	225/50 R17	CONTINENTAL	6 mm
	R/H Rear Tyre	225/50 R17	CONTINENTAL	6 mm
	L/H Rear Tyre	225/50 R17	CONTINENTAL	6 mm
4. Description of Damages				
	THE VEHICLE SUSTAINED DAMAGES AT THE FRONT AND REAR PORTION. DAMAGES SEE DETAILS.			
5. General Information				
	Accident Date	04/10/2020	Inspection Date	06/10/2020
	Survey held at	TWINCAR AUTOMOTIVE PTE LTD 2 KAKI BUKIT AVE 2 #01-17 KAKI BUKIT AUTOHUB SINGAPORE 417921		
5a. Remarks				
	A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.			
5b. Estimate Days of Repair				
	ESTIMATED NORMAL PERIOD FOR REPAIR:		18 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 6

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SJG 5236Z

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	AIRCON CONDENSER	BENT	632.30	632.30
1	AIRCON CONDENSER ALUMINIUM PIPE	NOT NECESSARY	175.00	-
1	AIRCON CONDENSER DISCHARGE HOSE	NOT NECESSARY	385.00	-
1	AIRCON CONDENSER FAN BLADE	NOT NECESSARY	62.00	-
1	AIRCON CONDENSER FAN COWLING	CRACKED	135.00	135.00
1	AIRCON CONDENSER FAN MOTOR	NOT NECESSARY	315.00	-
1	AIRCON CONDENSER SUCTION HOSE	NOT NECESSARY	550.00	-
1	AIRCON OUTSIDE TEMPERATURE SENSOR	NOT NECESSARY	50.00	-
1	AUTO TRANSMISSION OIL COOLER	DENTED	980.00	980.00
1	AUTO TRANSMISSION OIL COOLER DISCHARGE HOSE	NOT NECESSARY	129.00	-
1	AUTO TRANSMISSION OIL COOLER SUCTION HOSE	NOT NECESSARY	129.00	-
1	FRONT AIR CLEANER BOX (BASE)	NOT NECESSARY	145.00	-
1	FRONT AIR CLEANER BOX (COVER)	NOT NECESSARY	120.00	-
1	FRONT AIR CLEANER BOX AIR DUCT	NOT NECESSARY	105.00	-
1	FRONT BATTERY (BASE)	NOT NECESSARY	95.00	-
1	FRONT BATTERY (COVER)	NOT NECESSARY	27.50	-
1	FRONT BATTERY TOP BRACKET	NOT NECESSARY	18.50	-
1	FRONT BONNET	DISTORTED	721.50	721.50
2	FRONT BONNET HINGES L/R @\$43.80	NOT NECESSARY	87.60	-
1	FRONT BONNET INNER CENTER RUBBER MOULDING	NOT NECESSARY	65.00	-
1	FRONT BONNET INNER TOP RUBBER MOULDING	NOT NECESSARY	70.00	-
1	FRONT BONNET INSULATOR	NOT NECESSARY	145.00	-
1	FRONT BONNET MECHANISM LOCK	DAMAGED	78.60	78.60
1	FRONT BONNET MECHANISM LOCK GARNISH	CUT	28.00	28.00
1	FRONT BUMPER	DISTORTED	976.00	976.00
2	FRONT BUMPER FOGLAMP BRACKET L/R @\$35.00	NOT NECESSARY	70.00	-
2	FRONT BUMPER FOGLAMP L/R @\$275.50	CRACKED	551.00	551.00
2	FRONT BUMPER FOGLAMP SIDE GARNISH L/R @\$65.00	NOT NECESSARY	130.00	-
1	FRONT BUMPER LOWER GRILLE	DEFORMED	125.30	125.30
1	FRONT BUMPER NUMBER PLATE GARNISH	CRACKED	52.00	52.00
1	FRONT BUMPER REINFORCEMENT	BENT	187.00	187.00

Report Ref No. CC4/FCI20010726/Aes3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 6

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
2	FRONT BUMPER SIDE RETAINER L/R @\$20.00	NECESSARY	40.00	40.00
2	FRONT FENDER INNER SHIELD COVER L/R @\$100.00	NOT NECESSARY	200.00	-
2	FRONT FENDER L/R @\$575.60	TO REPAIR SEE LABOUR	1,151.20	-
2	FRONT FENDER TOP GARNISH L/R @\$55.00	NOT NECESSARY	110.00	-
1	FRONT GRILLE 'EURO R' EMBLEM	NECESSARY	50.00	50.00
1	FRONT GRILLE 'LOGO' EMBLEM	NECESSARY	23.40	23.40
1	FRONT GRILLE (BASE)	CRACKED	280.50	280.50
1	FRONT GRILLE (MOULDING)	NOT NECESSARY	285.00	-
1	FRONT GRILLE INNER TOP GARNISH	DEFORMED	95.60	95.60
2	FRONT HEADLAMP L/R @\$814.70	CRACKED	1,629.40	1,629.40
2	FRONT HEADLAMP LOWER BRACKET L/R @\$40.00	NOT NECESSARY	80.00	-
1	FRONT HORN	NOT NECESSARY	48.60	-
1	FRONT RESONATOR BOX	CRACKED	240.00	240.00
1	FRONT RESONATOR BOX AIR DUCT	NOT NECESSARY	45.00	-
1	FRONT RESONATOR BOX AIR INTAKE TUBE	NOT NECESSARY	55.00	-
1	FRONT SUPPORT PANEL	BUCKLED	680.00	680.00
4	FRONT SUPPORT PANEL INNER RUBBER GUIDE STOPPER @\$12.50	NOT NECESSARY	50.00	-
1	RADIATOR	DENTED	1,382.60	1,382.60
1	RADIATOR FAN BLADE	NOT NECESSARY	58.40	-
1	RADIATOR FAN COWLING	CRACKED	125.00	125.00
1	RADIATOR FAN MOTOR	NOT NECESSARY	350.00	-
1	RADIATOR LOWER HOSE	NOT NECESSARY	45.00	-
1	RADIATOR SPARE TANK	NOT NECESSARY	62.50	-
1	RADIATOR SPARE TANK HOSE	NOT NECESSARY	25.50	-
2	RADIATOR TOP BRACKET L/R @\$19.50	NOT NECESSARY	39.00	-
1	RADIATOR TOP HOSE	NOT NECESSARY	48.00	-
1	RADIATOR WATER TEMPERATURE SENSOR	NOT NECESSARY	46.70	-
1	REAR BOOTLID	TO REPAIR SEE LABOUR	750.00	-
1	REAR BOOTLID 'ACCORD' EMBLEM	NECESSARY	30.00	30.00
1	REAR BOOTLID 'LOGO' EMBLEM	NECESSARY	26.30	26.30
2	REAR BOOTLID HINGES GARNISH L/R @\$26.50	NOT NECESSARY	53.00	-

Report Ref No. CC4/FCI20010726/Aes3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:3 of 6

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
2	REAR BOOTLID HINGES L/R @\$80.00	NOT NECESSARY	160.00	-
2	REAR BOOTLID INNER RUBBER GUIDE STOPPER L/R @ \$12.00	NOT NECESSARY	24.00	-
1	REAR BOOTLID INNER TRIM GARNISH	NOT NECESSARY	205.00	-
1	REAR BOOTLID LOCK STRIKER	NOT NECESSARY	27.50	-
1	REAR BOOTLID MECHANISM LOCK	NOT NECESSARY	269.00	-
1	REAR BOOTLID MECHANISM LOCK GARNISH	NOT NECESSARY	112.60	-
2	REAR BOOTLID REFLECTOR INNER RUBBER GASKET L/R @\$18.00	NOT NECESSARY	36.00	-
2	REAR BOOTLID REFLECTOR L/R @\$215.00	NOT NECESSARY	430.00	-
1	REAR BOOTLID WEATHER STRIP	NOT NECESSARY	115.00	-
1	REAR BUMPER	DISTORTED	950.00	950.00
2	REAR BUMPER REFLECTOR L/R @\$50.00	CRACKED	100.00	100.00
2	REAR BUMPER SIDE RETAINER L/R @\$25.00	NECESSARY	50.00	50.00
1	REAR BUMPER UNDER COVER	TORN	135.00	135.00
1	REAR END PANEL	DISTORTED	550.00	550.00
1	REAR END PANEL INNER TOP GARNISH	DEFORMED	80.00	80.00
1	REAR EXHAUST HEAT SHIELD COVER	NOT NECESSARY	85.00	-
2	REAR EXHAUST RUBBER MOUNTING @\$16.50	NOT NECESSARY	33.00	-
1	REAR EXHAUSTSILENCER BOX	BENT	1,208.80	1,208.80
2	REAR FENDER INNER SHIELD COVER L/R @\$140.00	NOT NECESSARY	280.00	-
2	REAR FENDER INNER TRIM GARNISH L/R @\$235.00	CRUMPLED	470.00	470.00
2	REAR FENDER L/R @\$1030.80	O/S BUCKLED	2,061.60	1,030.80
1	REAR FLOOR JACK PANEL	DISTORTED	420.00	420.00
1	REAR FLOOR PANEL	DISTORTED	1,514.30	1,514.30
1	REAR FLOOR PANEL SPONGE COMPARTMENT TRAY	CRACKED	180.00	180.00
1	REAR FLOOR PANEL TOP BOARD COVER	CRUMPLED	325.30	325.30
1	REAR FUEL TANK TOP COVER	NOT NECESSARY	110.50	-
1	REAR RH EXTENSION MEMBER	TO REPAIR SEE LABOUR	690.50	-
2	REAR TAILLAMP INNER RUBBER GASKET L/R @\$18.00	NECESSARY	36.00	36.00
2	REAR TAILLAMP L/R @\$250.00	N/S CUT / O/S CRACKED	500.00	500.00
2	REAR TAILLAMP LOWER BRACKET L/R @\$15.00	NOT NECESSARY	30.00	-
1	REAR WINDSCREEN MOULDING	NECESSARY	89.00	89.00

Report Ref No. CC4/FCI20010726/Aes3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:4 of 6

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	LESS 20% DISCOUNT		-5,344.82	-3,341.74
			21,379.28	13,366.96
	<u>SPECIAL NETT ITEMS</u>			
1	FRONT BATTERY (SN)	NOT NECESSARY	220.00	-
1	SET FRONT BONNET INNER CENTER RUBBER MOULDING CLIPS (SN)	NOT NECESSARY	20.00	-
1	SET FRONT BONNET INNER RUBBER MOULDING CLIPS (SN)	NOT NECESSARY	20.00	-
1	SET FRONT BONNET INSULATOR CLIPS (SN)	NOT NECESSARY	50.00	-
1	SET FRONT BUMPER CLIPS (SN)	NECESSARY	50.00	30.00
1	SET FRONT BUMPER FOGLAMP LED BULB (SN)	NOT NECESSARY	350.00	-
1	FRONT BUMPER LOWER SPOILER (SN)	DEFORMED	1,250.00	800.00
1	FRONT BUMPER NUMBER PLATE (SN)	CRACKED	25.00	25.00
1	FRONT BUMPER NUMBER PLATE HOLDER (SN)	DEFORMED	50.00	30.00
2	SET FRONT FENDER INNER SHIELD COVER CLIPS L/R @ \$30.00 (SN)	NOT NECESSARY	60.00	-
1	SET FRONT GRILLE INNER TOP GARNISH CLIPS (SN)	NECESSARY	30.00	30.00
1	SET REAR BOOTLID INNER TRIM GARNISH CLIPS (SN)	NOT NECESSARY	50.00	-
1	REAR BOOTLID NUMBER PLATE (SN)	NOT NECESSARY	25.00	-
1	REAR BOOTLID NUMBER PLATE HOLDER (SN)	NOT NECESSARY	50.00	-
1	REAR BOOTLID REVERSE CAMERA (SN)	NOT NECESSARY	800.00	-
1	REAR BOOTLID TOP SPOILER (SN)	NOT NECESSARY	500.00	-
1	SET REAR BUMPER CLIPS (SN)	NECESSARY	50.00	30.00
1	REAR BUMPER LOWER SPOILER (SN)	DEFORMED	1,350.00	750.00
1	SET REAR BUMPER REVERSE SENSOR (SN)	DAMAGED	350.00	200.00
1	SET REAR END PANEL INNER TOP GARNISH CLIPS (SN)	NECESSARY	30.00	10.00
1	REAR EXHAUST MUFFLER (SN)	NOT NECESSARY	180.00	-
2	SET REAR FENDER INNER SHIELD COVER CLIPS L/R @ \$30.00(SN)	NOT NECESSARY	60.00	-
2	SET REAR FENDER INNER TRIM GARNISH CLIPS L/R @ \$50.00 (SN)	NECESSARY	100.00	60.00
1	REAR FLOOR PANEL INSULATOR MAT (SN)	NECESSARY	300.00	200.00
2	SET REAR TAILLAMP CLIPS L/R @\$25.00 (SN)	NECESSARY	50.00	20.00

Report Ref No. CC4/FCI20010726/Aes3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:5 of 6

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	REAR WINDSCREEN SEALANT (SN)	NECESSARY	80.00	60.00
			6,100.00	2,245.00
	LABOUR			
	TO TRANSFER REAR BOOTLID MICHANISM LOCK OUTER HANDLE REFLECTOR .	NOT NECESSARY	80.00	-
	TO REMOVE ,CHARGE AIR CON PARTS ,VACUUM ,REFILL AIR CON GAS.		160.00	120.00
	TO REMOVE ,REINSTALL ELECTRICAL WIRING HARNESS ,CHECK LIGHTING AND RESETTING HEADLAMP FOCUSSING (TO FR).		100.00	30.00
	TO REMOVE ,REINSTALL ELECTRICAL WIRING HARNESS ,CHECK LIGHTING AND REWIRE FOR PARKING SENSOR .		100.00	80.00
	TO REMOVE ,REINSTALL WINDSCREEN (REAR).		150.00	120.00
	TO REMOVE ,REINSTALL WINDSCREEN (TO FR).		80.00	80.00
	TO REMOVE ,REINSTALL ROOF TOP TRIM UPHOLSTERY ,CUSHION SEAT ,TRIM GARNISH ,TRIM LINER CARPET (TO FR).		140.00	100.00
	TO RE-SPRAY PAINTING ON THE REAR BOOTLID ,REAR END PANEL ,REAR FENDER (L/R) ,SPARE TYRE PANEL AND REAR BUMPER .		1,600.00	1,000.00
	TO RE-SPRAY PAINTING ON THE FRONT BONNET ,FRONT SUPPORT PANEL, FRONT FENDER (L/R) AND FRONT BUMPER.		1,400.00	800.00
	TO REMOVE AND CHARGE EXHAUST SILENCER BOX WITH PIPE ,RE-ALIGN WHERE NECESSARY CONSISTENT TO THE ACCIDENT .		100.00	80.00
	TO PROVIDE LABOUR ,WORKMANSHIP TO CHARGE THE ABOVE DAMAGED BODYPARTS ,REPAIR ,RECONSTRUCT AND RE-ALIGN BODY STRUCTURE ,BODY ALIGNMENTS AND DAMAGED CONSISTENT TO THE ACCIDENT .INCLUSIVE OF THE REPAIR OF FRONT FENDER L/R ,REAR BOOTLID AND REAR RH EXTENSION MEMBER .		3,800.00	2,400.00
	TO APPLY ANTI-RUST CHEMICAL ON REPAIRED AND REPLACED PANEL.		120.00	120.00
			7,830.00	4,930.00
GRAND TOTAL			35,309.28	20,541.96



RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)			13,000.00
---	--	--	------------------

Report Ref No. CC4/FCI20010726/Aes3q2

ADRIAN LING WAI PING

B.Eng,AMSOE,AMIRTE,AMSAE-A,M.MATAI

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SJG 5236Z

INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd


51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SJG 5236Z

RE-INSPECTION

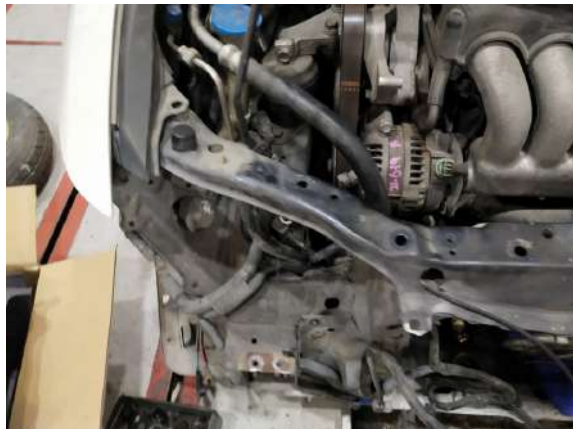



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

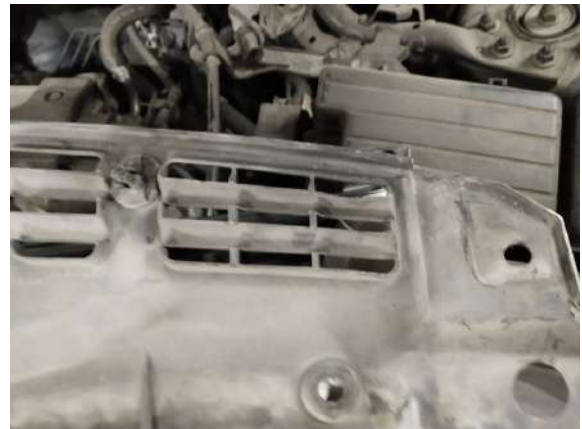



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R







LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

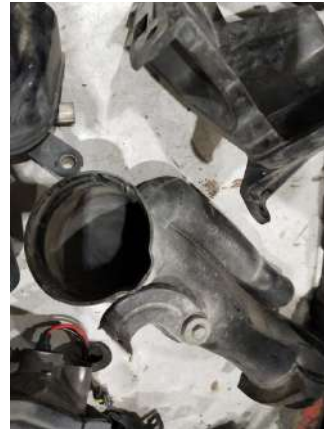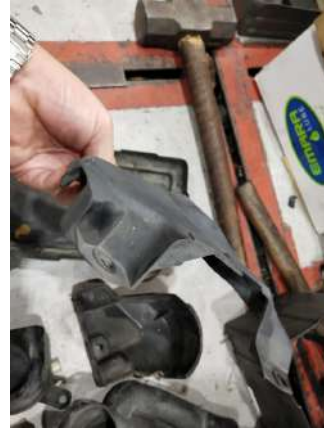



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

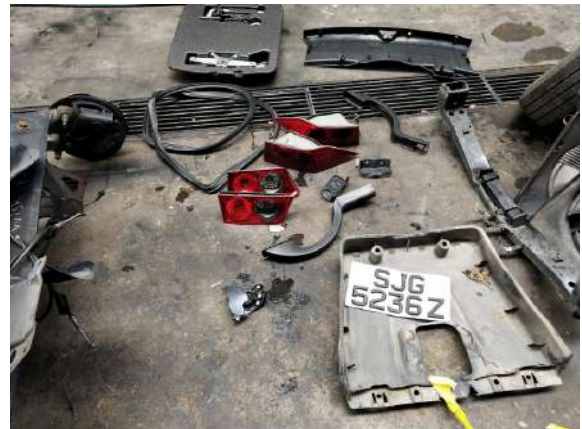



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SJG 5236Z

RE-INSPECTION

