



ABSOLUTE APPRAISAL SERVICES PTE LTD
LOSS ADJUSTERS & MOTOR APPRAISERS
160 Sin Ming Drive #05-16 Sin Ming AutoCity (S) 575722
Mobile: 9688-0413 Fax: 6266-7996
Email: absolute.app.svcs@gmail.com

Vehicle Inspection Report

To: Koh Eng Seng
C/o: 160 Sin Ming Drive #05-20
Sin Ming AutoCity (S) 575722

Date of report: 28.07.2020
Date of request: 14.07.2020
Date of inspection: 14.07.2020
Date of accident: 09.07.2020
Claim type: Third Party Claim

Report No: AAS/2020/163

Particulars of affected vehicle:

Registration no: SLW2714Y
Make/Model: Toyota Corolla Altis (A)
Year of registration: 2017/18
Colour: Metallic Brown

Odometer: 40077 km
Engine Capacity: 1598 cc
Engine no: 1ZR0A47441
Chassis no: MR053REH604576227

Condition of tires:

Front Left: 6mm
Make: Yokohama
Rear Left: 6mm
Make: Yokohama

Front Right: 6mm
Make: Yokohama
Rear Right: 6mm
Make: Yokohama

Type of road wheel: Alloy (The above represent the remaining life of the tire thread)

Pre-accident condition (Static tests only)

General Bodywork : Good
Paintwork : Good
Handbrake : In order
Footbrake : In order
Steering : In order
Apparent engine modification : Nil

The Assignment

The inspection was conducted at M/s. Lim Motor Pte Ltd
160 Sin Ming Drive #05-20
Sin Ming AutoCity (S) 575722

(Subsequent inspection was conducted)

Assessment

Repairer's estimate: \$ 6,398.90

Revised estimate: \$ 4,922.40

Recommended reserve: \$ 3,950.00 (Lump sum)

Estimated normal duration of repairs : 5 Working days



ABSOLUTE APPRAISAL SERVICES PTE LTD
LOSS ADJUSTERS & MOTOR APPRAISERS
160 Sin Ming Drive #05-16 Sin Ming AutoCity (S) 575722
Mobile: 9688-0413 Fax: 6266-7396
Email: absolute.app.svcs@gmail.com

Vehicle No: SLW2714Y

Report No: AAS/2020/163

W/O PREJUDICE

Point of impact

At the front portion.

General description of damages

The bonnet, front grille, headlamps, front bumper, radiator support panel, etc.

Other parts were also found damaged. (See schedule for details)

Recommendation

The estimate cost of repair submitted by M/s Lim Motor Pte Ltd as per schedule attached have been revise and scrutinize. We list the breakdown of our findings and recommendation as per attached.

Our adjusted amount for the cost of repair is SGD \$4,922.40

Conclusion

The repairer has agreed to undertake the repair at a lumpsum of SGD \$3,950.00

Under normal circumstances, the repair of the damaged vehicle should be completed within a reasonable period of 5 working days.

We have **Not Authorised** and/or instruction to the repairer to proceed with the repairs. This inspection was conducted entirely on a '**Without Prejudice**' basis.

We are pleased to advise that the inspection was carried out accordingly and hereby submit our appraisal report which includes 78 photographs.

Your Faithfully
Absolute Appraisal Services Pte Ltd



Nicky Sean
Automobile Appraiser
MSAAA / MSMCTA



ABSOLUTE APPRAISAL SERVICES PTE LTD
LOSS ADJUSTERS & MOTOR APPRAISERS
 160 Sin Ming Drive #05-16 Sin Ming AutoCity (S) 575722
 Mobile: 9688-0413 Fax: 6266-7996
 Email: absolute.app.svcs@gmail.com

Vehicle No: SLW2714Y

Report No: AAS/2020/163

Appraisement Schedule

S/N	Parts Description	Qty	Condition		Repairer's Est	Revised Est
1	Bonnet ✓	1	Dented	1140.4	\$ 1,231.10	\$ 1,231.10 ✓
2	Bonnet seal X SVC	1	Necessary		\$ 59.60	\$ 59.60
3	Bonnet insulator X SVC	1	Serviceable		\$ 155.40	-
4	Bonnet insulator clips ✓	6	Necessary	\$ 3.70	\$ 22.20	\$ 22.20 ✓
5	Bonnet hinge LH/RH X SVC	2	Distorted/Repair	\$ 67.00	\$ 134.00	-
6	Bonnet lock	1	Serviceable		\$ 151.10	-
7	Front grille ✓	1	Grazed/Cracked		\$ 652.00	\$ 652.00 ✓
8	Front grille emblem ✓	1	Necessary		\$ 65.30	\$ 65.30 ✓
9	Front grille seal X SVC	1	Necessary		\$ 61.90	\$ 61.90
10	Headlamp LH/RH ✓	2	Loop Cracked	1855.2 \$ 987.30	\$ 1,974.60	\$ 1,974.60 ✓
11	Front bumper ✓	1	Dented/Cracked		\$ 541.90	\$ 541.90 ✓
12	Front bumper absorber	1	Serviceable		\$ 89.70	-
13	Front bumper reinforcement	1	Serviceable		\$ 386.60	-
14	Front bumper retainer LH/RH	2	Cracked/Necessary X SVC	\$ 83.30	\$ 166.60	\$ 166.60
15	Front bumper clips ✓	10	Necessary	\$ 2.80	\$ 28.00	\$ 28.00 ✓
16	Brace panel	1	Distorted/Repair		\$ 145.20	-
17	Radiator support panel		Distorted/Repair		-	-
				4305	Total: \$ 5,865.20	\$ 4,803.20
					-25%	\$ 1,466.30
				3228.75	List total: \$ 4,398.90	\$ 3,602.40

1	Front number plate ✓	1	Dented		\$ 50.00	\$ 40 50.00
				Special nett total:	\$ 50.00	\$ 50.00

Parts Total: \$ 4,448.90 \$ 3,652.40

S/N	Labour Description		Repairer's Est	Revised Est
1	Check lightings & wirings.		\$ 50.00	\$ 30.00 ✓
2	Anti rust.		\$ 100.00	\$ 40.00 X
3	Spray painting on front affected & replacement panels.		\$ 1,000.00	\$ 700.00 400
4	Conduct panel beating, straightening, cutting & reforming. Renew front damaged parts. Re-align all affected area.		\$ 800.00	\$ 500.00 300
Labour Total:			\$ 1,950.00	\$ 1,270.00
Grand Total:			\$ 6,398.90	\$ 4,922.40

The final adjusted lump sum amount is \$3,950.00

3998.75



Under normal circumstances, the repair should be completed within a reasonable period of 5 working days.

-20%: 3200

4 days

78 Photographs were taken at the time of inspection.

Disclaimer: This report is intended for the exclusive use of the address solely in relation to the loss occurrence in which the assessed vehicle involved. No liability or responsibility whatsoever shall be held by Absolute Appraisal Service Pte Ltd for any reliance on this report by any third party.

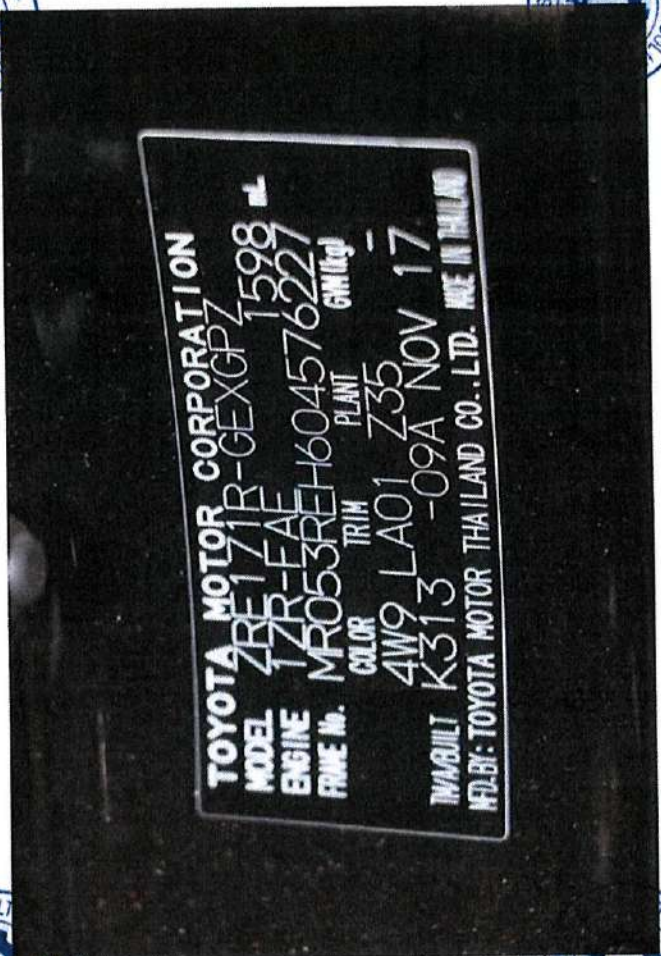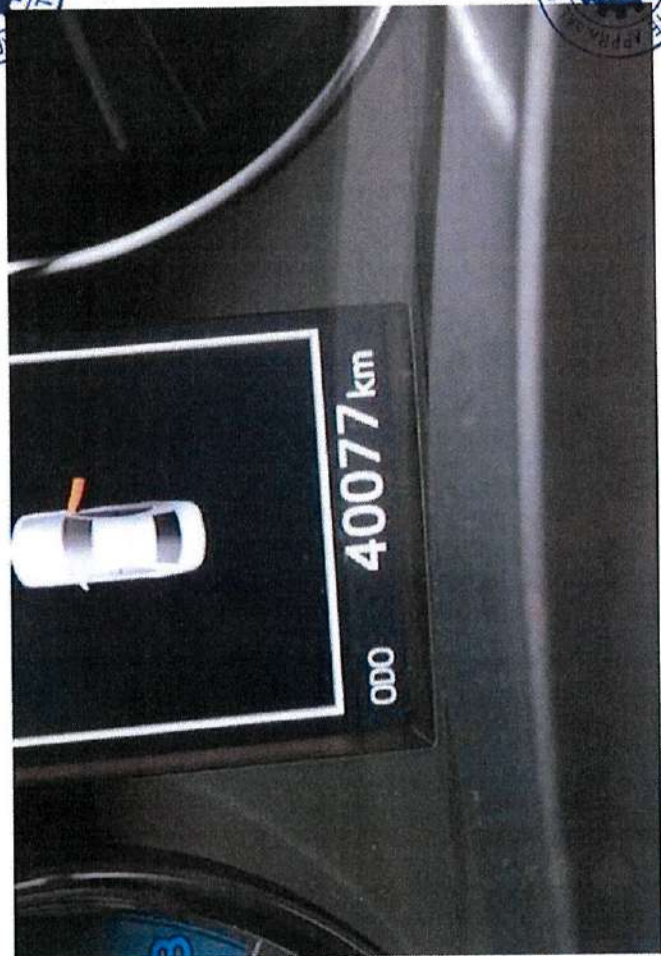

TOYOTA MOTOR CORPORATION
MODEL 4RE171R-GEXGPZ 1598 ml
ENGINE 1ZR-FAE
FRAME No. MR053REH604576227
COLOR 4W9 LA01 Z35
TRIM K313 -09A NOV 17
PLANT CHN (kg)
INVAULT K313
MADE IN THAILAND
FD.BK: TOYOTA MOTOR THAILAND CO., LTD.



