



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

MS FIRST CAPITAL INSURANCE LTD

INV No. AC2101578

36 ROBINSON ROAD
#16-01 CITY HOUSE
SINGAPORE 068877

INV Date 12/03/2021
Reference CC4/FCI20010996/T1gs3q2
Code FCI2

PROFESSIONAL SERVICE FEE

Vehicle No. SGQ 390B
Insured Veh. SHC 7282X
Claim No. D20004102MFSH
Policy No. D-20094921MFSH
Accident Date 07/10/2020
Inspection Date 12/10/2020

Description	Total
Survey Inspection	308.00
Resurvey Inspection	
Digital Photographs	
Transportation	
Subtotal	308.00
GST (7%)	21.56
Grand Total	329.56

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to 'LKK Auto Consultants Pte Ltd'

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
MS FIRST CAPITAL INSURANCE LTD 36 ROBINSON ROAD #16-01 CITY HOUSESINGAPORE 068877			Ref: CC4/FCI20010996/T1gs3q2	
			Date: 12/03/2021	
			Code: FCI2	
1. Policy Particulars :- THIRD PARTY CLAIM				
Insured Veh.	SHC 7282X	Veh. Inspected	SGQ 390B	
Policy No.	D-20094921MFSH	Coverage (\$)	0.00	
Claim No.	D20004102MFSH	Excess (\$)	0.00	
Assign From	MERINA	Assign Date	12/10/2020	
2. Vehicle Particulars & Condition				
Make & Model	NISSAN LATIO	c.c	1498	
Engine No.	HIDDEN	Year of Reg.	2007	
Chassis No.	JN1BAAC11Z0002881	Colour	SILVER	
Odometer	176043 KM	Steering	IN ORDER	
Brakes	IN ORDER	Modification	SPORTS RIM	
General	GOOD			
3. Conditions of Tyres				
	Size	Make	Balance	
R/H Front Tyre	185/65 R15	YOKOHAMA	6 mm	
L/H Front Tyre	185/65 R15	YOKOHAMA	6 mm	
R/H Rear Tyre	185/65 R15	YOKOHAMA	6 mm	
L/H Rear Tyre	185/65 R15	YOKOHAMA	6 mm	
4. Description of Damages				
THE VEHICLE SUSTAINED DAMAGES AT THE REAR PORTION. DAMAGES SEE DETAILS.				
5. General Information				
Accident Date	07/10/2020	Inspection Date	12/10/2020	
Survey held at	MOVA AUTOMOTIVE PTE LTD BLK 1008 BUKIT MERAH LANE 3 #01-04/06/08 . SINGAPORE 159722			
5a. Remarks				
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.				
5b. Estimate Days of Repair				
ESTIMATED NORMAL PERIOD FOR REPAIR:			7 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SGQ 390B

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	REAR BOOT (N)	BENT	876.50	876.50
1	REAR BOOT LOGO (N)	NECESSARY	69.70	69.70
1	REAR BOOT EMBLEM "LATIO" (N)	NECESSARY	89.90	89.90
1	REAR BOOT CHROME TOP (N)	NOT NECESSARY	256.10	-
1	REAR BOOT CHROME LOWER (N)	CUT	190.70	190.70
1	REAR BOOT RUBBER (N)	TWISTED	120.10	120.10
1	REAR BOOT LOCK (N)	BENT	148.30	148.30
1	REAR BOOT CATCH (N)	TO REPAIR SEE LABOUR	107.20	-
2	REAR BOOT HINGES L+R @\$86.40 (N)	TO REPAIR SEE LABOUR	172.80	-
2	REAR LAMP L+R @\$297.60 (N)	CRACKED	595.20	595.20
2	REAR LAMP CLIPS @\$9.40 (N)	O/S CRACKED / N/S NECESSARY	18.80	18.80
2	REAR LAMP PANEL L+R @\$174.00 (N)	TO REPAIR SEE LABOUR	348.00	-
1	REAR END PANEL (N)	BENT	577.80	577.80
1	REAR END PANEL TRIM (N)	DEFORMED	129.00	129.00
6	REAR END PANEL TRIM CLIPS @\$4.40 (N)	NECESSARY	26.40	26.40
1	REAR BUMPER (N)	DEFORMED	582.40	582.40
2	REAR BUMPER RETAINER @\$63.60 (N)	CRACKED	127.20	127.20
2	REAR BUMPER BRACKET @\$79.30 (N)	NOT NECESSARY	158.60	-
1	SET REAR BUMPER LOWER GARNISH (N)	TO REPAIR SEE LABOUR	414.20	-
1	REAR BUMPER SPONGE (N)	NOT NECESSARY	57.00	-
10	REAR BUMPER CLIPS @\$4.40 (N)	NECESSARY	44.00	44.00
1	REAR FLOOR TOP COVER (N)	DEFORMED	452.30	452.30
1	REAR FLOOR PANEL (NPA)	TO REPAIR SEE LABOUR	-	-
2	REAR FENDER L+R (NPA)	TO REPAIR SEE LABOUR	-	-
	LESS 10% DISCOUNT		-556.22	-404.83
			5,005.98	3,643.47

Report Ref No. CC4/FCI20010996/T1gs3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>SPECIAL NETT ITEMS</u>			
1	REAR BUMPER SENSOR (SN)	NOT WORKING	280.00	200.00
			280.00	200.00
	<u>LABOUR</u>			
	TO CUT & WELD REAR END PANEL,TO REPAIR REAR FLOOR PANEL,REAR FENDER L+R,REAR CHASSIS MEMBER.TO REMOVE & REFIX DAMAGED PARTS,STRAIGHTEN & REALIGN AFFECTED AREAS.INCLUSIVE OF THE REPAIR OF REAR BOOT CATCH,REAR BOOT HINGES L+R,REAR LAMP PANEL L +R,SET REAR BUMPER LOWER GARNISH,REAR FLOOR PANEL AND REAR FENDER L+R.		840.00	800.00
	TO SPRAY AFFECTED AREAS.		850.00	800.00
	TO REMOVE & REFIX LUGGAGE COMPARTMENT SIDE GARNISH,SIDE COVER,AND ATTACHMENT PARTS.		100.00	60.00
	TO INSTALL REVERSE SENSOR & CHECK WATER SEEPAGE.		60.00	30.00
	TO RUST PROOF AFFECTED AREAS.		80.00	40.00
			1,930.00	1,730.00
GRAND TOTAL			7,215.98	5,573.47
RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)				4,450.00

Report Ref No. CC4/FCI20010996/T1gs3q2

MOHAMAD TAUFIKH

M.MATAI, AMSAE-A

Automotive Assessor

HO LEONG CHUAN

Automotive Assessor

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SGQ 390B

INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

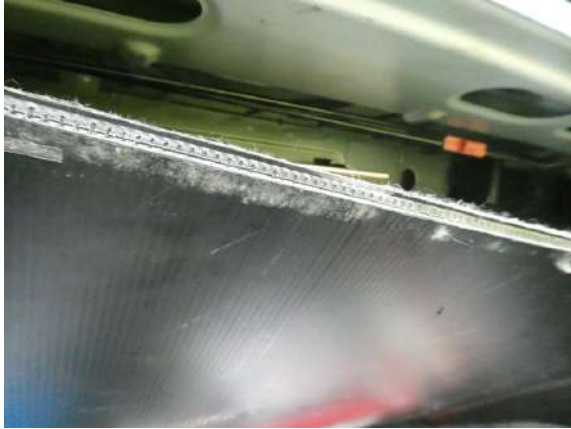



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SGQ 390B

RE-INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

