

S K AUTO CONSULTANTS

AUTOMOBILE ASSESSMENT REPORT

Page No. 1

Our Reference: TP/019/02355X

Your Reference: TBA

Date: 28/7/2019

TO: TAI WENG KIAT
C/o ACE Autolution Pte Ltd
13 Kaki Bukit Road 4 #03-29
Bartley Biz Centre
Singapore 417807

Assessment of Vehicle No : WQU 5449

Date of Accident : 17/06/2019

Date of Inspection : 18/06/2019

We have carried out a physical assessment of WQU 5449 at ACE Autolution Pte Ltd according to your instructions on 18/06/2019 and are pleased to submit our report as follows;

1. VEHICLE PARTICULARS

Registration No.	:	WQU 5449
Make & Model	:	HONDA CIVIC
Year of Registration	:	14/12/2007
Engine Capacity (cc)	:	1998
Chassis No.	:	PMHFD26307D0402559
Engine No.	:	K20Z21922534
Colour	:	WHITE
Mileage (km)	:	160666

2. VEHICLE CONDITION

Body Paint:	:	Good
Steering	:	Serviceable
Foot Brake	:	Serviceable
Parking Brake	:	Serviceable

3. TYRE PARTICULARS & CONDITION

Front

RH Make/Size	:	CONTINENTAL 215/45R17 - 80%
LH Make/Size	:	CONTINENTAL 215/45R17 - 80%

Rear

RH Make/Size	:	CONTINENTAL 215/45R17 - 80%
LH Make/Size	:	CONTINENTAL 215/45R17 - 80%

*Note: % denotes the remaining percentage of the tyre

S K AUTO CONSULTANTS


Page No. 2

Our Reference TP/019/0235SK
Vehicle No. WQU 5449

4. DESCRIPTION OF DAMAGE

At the time of inspection observed that this vehicle had sustained damages to the FRONT AND REAR portion

Please see attached schedule for details.

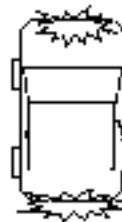

Estimated Amount: : S\$22,621.00
Adjusted Amount : S\$18,000/-
Estimated Repair Days : 18 days

Pursuant to your instruction, we have **NOT AUTHORIZED** repair.

The assessment was conducted on a "**Without Prejudice**" basis.

If we are not notified of anything to the contrary within **14 Days** from the date hereof, this report shall be treated as correct.

Disclaimer

This report is intended for the exclusive use of the addressee solely in relation to the loss occurrence in which the assessed vehicle is involved. No liability or responsibility whatsoever shall be held by **S K AUTO CONSULTANTS** for any reliance on this report by any third party.

S K AUTO CONSULTANTS

Page No. 3

Our Reference: TP/019/0235SK

Vehicle No. WGU 5443

QTY	DESCRIPTION	CONDITION	REPAIRER'S ESTIMATE(\$\$)	OUR ASSESSMENT(\$\$)	
PARTS (LIST ITEMS)					
1	Rear boot lid	Distorted	1182.00	1282.00	855.10
1	Rear bootlid Honda badge	Necessary	42.00	42.00	
1	Rear boot lid CIVIC emblem	Necessary	98.00	98.00	
1	Rear boot lid 1.8 VTEC emblem	Necessary	72.00	72.00	
2	Rear bootlid hinges @78.60	Bent	157.20	157.20	
1	Rear boot lid inner lock	Damaged	325.00	325.00	115.00
1	Rear boot lid lock catch	Bent	125.00	125.00	
2	Rear boot lid reflector lamps @756.00	Cracked	1512.00	1512.00	681
4	Rear boot lid reflector lamp clips @26.50	Necessary	26.00	26.00	
1	Rear bootlid weatherstrip	Deformed	180.00	180.00	
2	Rear bootlid stopper @48.20	Necessary	96.40	96.40	
1	Rear bootlid inner trim	Deformed	278.00	278.00	
1	Rear bumper	Deformed	976.50	976.50	638
2	Rear bumper side retainers	Damaged	128.00	128.00	
2	RHS & LHS Taillamp @ 978.20	Cracked	1956.40	1956.40	678.40
2	RHS & LHS Taillamp panel @440.00	Distorted	880.00	880.00	440 LH bt ✓ RH xR
1	LHS Rear fender	Distorted	860.00	860.00	
1	RHS Rear fender	Distorted	860.00	860.00	X R
1	LHS Rear fender inner side trim	Deformed	242.00	242.00	225
1	RHS Rear fender inner side trim	Deformed	242.00	242.00	X nn
1	Rear end panel	Distorted	732.50	732.50	436
1	Rear end panel top garnish	Deformed	248.00	248.00	186
1	Rear spare tyre panel	Distorted	1120.00	1120.00	958.80
1	Rear spare tyre panel top cover board	Deformed	342.00	342.00	298.80
1	Rear exhaust silencer assembly	Damaged/Bent	1150.00	1150.00	X R
2	Rear exhaust silencer assembly mountings	Damaged	98.00	98.00	Xnn
1	Rear exhaust silencer insulator	Distorted	258.00	258.00	
1	Front bumper	Deformed	1095.00	1095.00	Xnn
2	Front bumper fog lamp @575.50	Damaged	510.00	510.00	Xnn
1	Front bumper lower grille	Bent	255.00	255.00	Xnn
2	Front bumper side retainer	Deformed	128.00	128.00	Xnn
			16175.00	16175.00	7832.70
less 20%			3235.00	3235.00	6266.16
			12940.00	12940.00	

S K AUTO CONSULTANTS

Page No. 5

Our Reference: TP/019/02155K


Vehicle No.: WQU 5449

S/N	DESCRIPTION	REPAIRER'S ESTIMATE (\$\$)	OUR ASSESSMENT (\$\$)
1	LABOUR To remove the affected parts & fittings to commence repairs; panel beat & reshape the affected areas; replace the damaged parts and components (Rear)	2800.00	2400.00 1600
2	To supply paint materials, expandable items & putty, respray paint on parts replaced and repaired areas (Rear)	2000.00	1800.00 1500
3	To check electrical wiring at rear damage areas	120.00	80.00 40
4	To remove and re-fix rear interior fittings, components trimmings so as to facilitate repairs at rear	250.00	200.00 80
5	To remove and replace reverse sensors and check for proper function	120.00	80.00 30
6	To perform anti-rust treatment on affected areas	450.00	450.00 100
7	To remove the affected parts & fittings to commence repairs; replace damaged parts (Front)	600.00	400.00 xnn
8	To supply paint materials, expandable items & putty, respray paint on parts replaced (Front)	800.00	500.00 xnn
9	To remove and re-fix wiring and check all electrical components at damaged areas & focus headlamp beam	150.00	120.00 xnn
Labour Total:		7290.00	5130.00 3350
TOTAL (PARTS & LABOUR):		23896.00	22621.00

Note: (For Lump Sum Repair)

The workshop has agreed to undertake the repair on a Lump Sum Basis, and/or the use of ex-stock/reconditioned parts whichever is possible (Having taken into consideration to repair instead of replacements)

The final adjusted Lump Sum contract amount is \$518,000/-



 S Kumanon
 Motor Surveyor

9616.16

L/S \$7700

10days

