



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

MS FIRST CAPITAL INSURANCE LTD

INV No. AC2106277

36 ROBINSON ROAD
#16-01 CITY HOUSE
SINGAPORE 068877

INV Date 08/09/2021
Reference CC4/FCI20011699/Aes3q2
Code FCI2

PROFESSIONAL SERVICE FEE

Vehicle No. SKN 9183S
Insured Veh. SHA 8352G
Claim No. D20004289MFSH
Policy No. D-18088937MFSH
Accident Date 21/10/2020
Inspection Date 28/10/2020

Description	Total
Third Party Express Settlement	500.00
Subtotal	500.00
GST (7%)	35.00
Grand Total	535.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
MS FIRST CAPITAL INSURANCE LTD 36 ROBINSON ROAD #16-01 CITY HOUSESINGAPORE 068877			Ref: CC4/FCI20011699/Aes3q2	
			Date: 08/09/2021	
			Code: FCI2	
1. Policy Particulars :- THIRD PARTY CLAIM				
	Insured Veh.	SHA 8352G	Veh. Inspected	SKN 9183S
	Policy No.	D-18088937MFSH	Coverage (\$)	0.00
	Claim No.	D20004289MFSH	Excess (\$)	0.00
	Assign From	ERIC	Assign Date	27/10/2020
2. Vehicle Particulars & Condition				
	Make & Model	VOLKSWAGEN GOLF	c.c	1197
	Engine No.	HIDDEN	Year of Reg.	2014
	Chassis No.	WWZZZAUZEW382448	Colour	BLUE
	Odometer	105967 KM	Steering	IN ORDER
	Brakes	IN ORDER	Modification	SPORTS RIM
	General	GOOD		
3. Conditions of Tyres				
		Size	Make	Balance
	R/H Front Tyre	205/55 R16	TOYO	6 mm
	L/H Front Tyre	205/55 R16	TOYO	6 mm
	R/H Rear Tyre	205/55 R16	TOYO	6 mm
	L/H Rear Tyre	205/55 R16	TOYO	6 mm
4. Description of Damages				
	THE VEHICLE SUSTAINED DAMAGES AT THE REAR PORTION. DAMAGES SEE DETAILS.			
5. General Information				
	Accident Date	21/10/2020	Inspection Date	28/10/2020
	Survey held at	ACE AUTOLUTION PTE LTD 13 KAKI BUKIT ROAD 4 #03-29 BARTLEY BIZ CENTRE SINGAPORE 417807		
5a. Remarks				
	A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.			
5b. Estimate Days of Repair				
	ESTIMATED NORMAL PERIOD FOR REPAIR:		5 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SKN 9183S

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
<u>REPLACEMENT OF PARTS</u>				
1	REAR BOOTLID	DENTED	1,905.10	1,450.00
1	REAR BOOTLID LOCK	NOT NECESSARY	197.20	-
1	REAR BOOTLID WEATHERSTRIP	CUT	323.80	268.00
2	REAR BOOTLID RUBBER STOPPER LH & RH @\$30.00	NOT NECESSARY	60.00	-
1	REAR BOOTLID INNER TRIM COVER	NOT NECESSARY	221.00	-
1	REAR BOOTLID 'BLUEMOTION TECHNOLOGY' EMBLEM	NECESSARY	81.00	81.00
1	REAR BOOTLID 'TSI' EMBLEM	NECESSARY	76.00	76.00
1	REAR BOOTLID CENTRE LOGO BADGE	NOT NECESSARY	126.50	-
1	REAR BUMPER	DEFORMED	1,085.00	1,085.00
1	REAR BUMPER REINFORCEMENT	BENT	523.20	523.20
1	REAR BUMPER TOW COVER	DEFORMED	101.00	101.00
2	REAR BUMPER REFLECTOR LH & RH @\$127.60	O/S CUT	255.20	127.60
1	REAR BUMPER FOAM UPPER BEAM GARNISH	CRACKED	211.00	211.00
2	REAR BUMPER SIDE RETAINER LH & RH @\$131.00	NOT NECESSARY	262.00	-
2	REAR BUMPER SIDE HOLDERS LH & RH @\$107.30	NOT NECESSARY	214.60	-
1	REAR BUMPER LOWER GARNISH	CUT	535.50	323.00
1	REAR BOOTLID LAMP RH	NOT NECESSARY	410.00	-
1	REAR TAILLAMP RH	NOT NECESSARY	735.00	-
1	REAR TAILLAMP LOWER BRACKET RH	NOT NECESSARY	141.00	-
1	REAR END PANEL	DENTED	990.00	688.00
1	REAR END PANEL INNER TRIM	CRACKED	137.50	137.50
	LESS 10% DISCOUNT		-859.16	-507.13
			7,732.44	4,564.17
<u>SPECIAL NETT ITEMS</u>				
1	SET REAR BUMPER CLIPS (SN)	NECESSARY	100.00	30.00
1	SET REAR CAR PLATE WITH COVER (SN)	CRACKED	70.00	50.00
1	SET REAR END PANEL LOWER TOP GARNISH CLIPS (SN)	NECESSARY	80.00	20.00
1	REAR END PANEL LOWER SEALANT (SN)	NOT NECESSARY	100.00	-
1	SET REAR BUMPER LOWER GARNISH CLIPS (SN)	NECESSARY	80.00	30.00



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	SET REVERSE SENSOR (SN) <u>LABOUR</u> TO REMOVE THE AFFECTED PARTS & FITTINGS TO COMMENCE REPAIRS AND REPLACE DAMAGED PARTS. TO SUPPLY PAINT MATERIALS ,EXPANDABLE ITEMS & PUTTY ,RESPRAY PAINT ON PARTS REPLACED. TO REMOVE ,REFIX WIRING SYSTEM AT ACCIDENT DAMAGE AREAS AND CHECK FOR PROPER FUNCTION . TO TRANSFER REAR BOOT MECHANISM . TO PERFORM ANTI-RUST TREATMENT ON AFFECTED AREAS . TO CONDUCT WATER SEEPAGE TEST .	DAMAGED	450.00	200.00
			880.00	330.00
			1,600.00	700.00
		1,200.00	600.00	
		150.00	30.00	
		120.00	60.00	
		270.00	60.00	
		120.00	-	
		3,460.00	1,450.00	
GRAND TOTAL			12,072.44	6,344.17
RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)				5,000.00

Report Ref No. CC4/FCI20011699/Aes3q2

ADRIAN LING WAI PING

B.Eng,AMSOE,AMIRTE,AMSAE-A,M.MATAI

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SKN 9183S

INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SKN 9183S

RE-INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

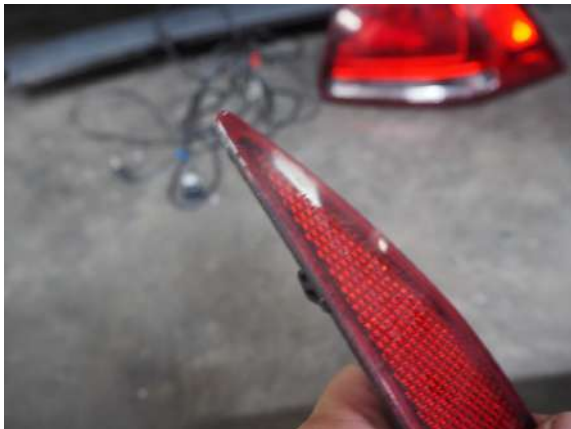



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

