

PRO-OPTION SERVICES

Mailing address: Blk 189B Rivervale Drive, #04-1004, Singapore 542189
Mobile: 9 0610543 Email: mirage1195@gamil.com

Report No. 266M0920.HK
Vehicle No. SFN1811A

ACCIDENT VEHICLE SURVEY REPORT

1 REFERENCE

Date of Inspection 11 September 2020
Requested by Kee Hai Seong
c/o 1 Kaki Bukit Avenue 6
#02-37
Singapore 417883
Type of Survey Independent
Repairer Hua Kian Motor Workshop
1 Kaki Bukit Avenue 6 #02-37 Autobay @ Kaki Bukit S(417883)
Date of Accident 11 September 2020

2 VEHICLE DATA

Make/Model HONDA ACCORD 2.4L
Year of registration 29 Jul 2008
Chassis No. MRHCP26308P020507
Engine No. K24Z21957460
Engine Capacity 2354 cc
Odometer Reading 156236 km
Colour Golden

3 STATIC CHECK

Steering	Serviceable	Paintwork	Good
Foot Brake	Serviceable	General Condition	Good
Hand Brake	Serviceable		

4 TIRE CONDITION

	<u>RH/Make</u>	<u>LH/Make</u>	<u>Size</u>
Front Tread	5 mm/Yokohama	5 mm/Yokohama	185/70R14
Rear Tread	5 mm/Yokohama	5 mm/Yokohama	185/70R14

5 GENERAL DESCRIPTION OF DAMAGE

Rear bumper squashed/torn, rear end panel dented/bent/distorted, spare tyre panel crumpled/distorted, rear RH fender bent, rear boot lid hinges bent, etc. Please see para. 8 of this report for more details.

6 REMARK

This inspection is carried out on a "WITHOUT PREJUDICE" basis and we have not authorized any repairs.

7 RECOMMENDATION

PRO-OPTION SERVICES

Mailing address: Blk 189B Rivervale Drive, #04-1004, Singapore 542189

Mobile: 9 0610543 Email: mirage1195@gmail.com

Report No. : 266M0920.HK

Vehicle no. : SFN1811A

INVOICE

Kee Hai Seong
c/o 1 Kaki Bukit Avenue 6
#02-37
Singapore 417883

Invoice no : POS 266/20
Date: 1 October 2020

Item	Description	Qty	Unit price (\$)	Total Amt (\$)
01	Being charges for the inspection of the accident vehicle, transport and photographs.			696.00
(SGD: Six Hundred and Ninety-six only			GRAND TOTAL:	696.00

*Cheque should be crossed and made payable to "Pro-Option Services"

PRO-OPTION SERVICES



Authorized Signature

B DAMAGE AND REPAIR COSTS ASSESSMENT

Report No. : 266M0620.HK

Vehicle No. : SFN1811A

<u>Description</u>	<u>Qty</u>	<u>Assessed Condition</u>	<u>Repairer's Estimate.(\$)</u>	<u>Revised Amount (\$)</u>
A SPARE PARTS				
Rear bumper ✓	1	squashed/torn	707.70	707.70 ✓
Rear bumper side retainer LH ✓	1	broken	43.00	43.00 ✓
Rear bumper clip ✓	10	necessary	55.00	55.00 30
Rear bumper reinforcement ✓	1	bent/distorted	257.10	257.10 ✓
Rear end panel ✓	1	dented/bent/distorted	422.40	422.40 317.4
Rear end panel garnish ✓	1	squashed/bent	94.00	94.00 ✓
Rear end panel garnish clip ✓	4	necessary	23.20	23.20 ✓
Spare tyre panel ✓	1	crumpled/distorted	1,238.80	1,238.80 837.5
Spare tyre panel board	1	to reuse	232.00	0.00
Rear boot lid <i>x repair</i> ✓	1	bent/distorted	728.20	728.20 X
Rear boot lid lock assy ✓	1	bent/distorted	189.20	189.20 ✓
Rear boot lid lower catch	1	to repair	19.40	0.00
Rear boot weatherstrip	1	to reuse	56.90	0.00
Rear boot lid hinge	2	to repair	102.40	0.00
Rear boot lid "Honda" logo ✓	1	necessary	21.80	21.80 ✓
Rear boot lid "2.4 i-VTEC" emblem ✓	1	necessary	50.20	50.20 33.2
Rear boot lid "ACCORD" emblem ✓	1	necessary	24.00	24.00 ✓
RH taillamp assy ✓	1	side bracket bent	283.50	283.50 ✓
RH taillamp lower bracket ✓	1	bent/distorted	11.60	11.60 ✓
RH rear fender	1	to repair	908.90	0.00
Exhaust silencer ✓	1	bent/torn	998.80	998.80 ✓
Subtotal of the above			6,488.10	5,148.50 3872
Discount 20%			1,293.62	1,029.70 3097.6
Subtotal 1:			5,174.48	4,118.80
Rear parking sensors (set) ✓	1	broken	280.00	280.00 200
Spare tyre panel sound proofing pad ✓	1	necessary	200.00	200.00 150
End panel joint rubberised sealer ✓	1	necessary	150.00	150.00 40
Subtotal 2:			630.00	630.00 280
Total cost of parts			5,804.48	4,748.80

B LABOUR

To check wiring condition and repair where needed.	45.00	30.00 ✓
To install rear parking sensors and check sensing functions.	80.00	60.00 40
To apply anti-rust undercoating.	200.00	120.00 60

Report No : 266M0920 HK

Vehicle No : SFN1811A

To remove and transfer rear boot lid wire harnesses, fittings and attachments to new boot lid

120.00

90.00 60

Labour charges to remove and replace, to cut and weld, to knock and reshape affected parts/areas

2,100.00

1,500.00 800

Spray painting charges to putty and spray all affected parts/areas - rear bumper, rear RH fender, rear end panel, spare tyre panel, rear boot lid, rear boot lid hinges, etc.

1,500.00

1,250.00 1000

Total labour cost

4,165.00

3,140.00

1990

TOTAL COST OF REPAIRS

9,969.48

7,888.80

9 CONCLUSION

The revised or adjusted cost of repairs to restore the vehicle is

\$7,888.80

(a) The recommended cost of repair based on lump sum repair basis would be **\$6,400.00**

(b) The estimated number of days for the repairs would be

(1st Re-inspection conducted on 12 September 2020)

Eight (8)


(Post Repair Inspection conducted on 18 September 2020)

The above recommendations in my view are fair and reasonable for the restoration of the vehicle to its pre-accident condition

Note: Lump Sum Repair Basis

This means the repairer is allowed to replace the damaged parts with used, reconditioned or new parts, or repair it to a roadworthy condition

Prepared by:

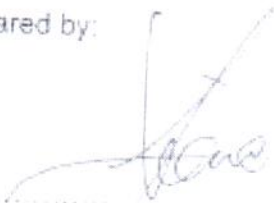

Liaw Leong San

Licensed Automotive Appraiser

5477.6

20%: 4400

7 Days.

Dated: 1 October 2020

HUA KIAN MOTOR WORKSHOP

Blk 1 Kaki Bukit Ave 6

Autobay #02-37

Singapore 417883

Tel: 6842 5949

Kee Hai Seong
C/o Hua Kian Motor Workshop
1 Kaki Bukit Ave 6
#02-37
Singapore 417883

01 October 2020

Dear Sir,

Date of accident : 11/09/2020
Final repair bill to SEN 1811 A

To Supply,

lump sum repairs recommended By the surveyor	\$6,400.00
Total	\$6,400.00

Dollars : SIX THOUSAND AND FOUR HUNDRED ONLY