



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

CHINA TAIPING INSURANCE (S) PTE LTD

INV No. AC2106147

3 ANSON ROAD #16-00
SPRINGLEAF TOWER
SINGAPORE 079909

INV Date 02/09/2021
Reference CC3/CTI20012331/Qra3q2
Code CTI

PROFESSIONAL SERVICE FEE

Vehicle No. SHC 4769D
Insured Veh. PA 6075A
Claim No. SNM20D204270/LKKDS
Policy No. DMB1SNA00010092000
Accident Date 04/11/2020
Inspection Date 09/11/2020

Description	Total
Third Party Express Settlement	400.00
Subtotal	400.00
GST (7%)	28.00
Grand Total	428.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
CHINA TAIPING INSURANCE (S) PTE LTD 3 ANSON ROAD #16-00 SPRINGLEAF TOWERSINGAPORE 079909			Ref: CC3/CTI20012331/Qra3q2 Date: 02/09/2021 Code: CTI	
1. Policy Particulars :- THIRD PARTY CLAIM				
Insured Veh.	PA 6075A	Veh. Inspected	SHC 4769D	
Policy No.	DMB1SNA00010092000	Coverage (\$)	0.00	
Claim No.	SNM20D204270/LKKDS	Excess (\$)	0.00	
Assign From		Assign Date	09/11/2020	
2. Vehicle Particulars & Condition				
Make & Model	TOYOTA PRIUS	c.c	1798	
Engine No.	HIDDEN	Year of Reg.	2016	
Chassis No.	JTDKN36U605767649	Colour	MAROON	
Odometer	483661 KM	Steering	IN ORDER	
Brakes	IN ORDER	Modification	SPORTS RIM	
General	FAIR			
3. Conditions of Tyres				
	Size	Make	Balance	
R/H Front Tyre	195/65 R15	FALKEN	6 mm	
L/H Front Tyre	195/65 R15	FALKEN	6 mm	
R/H Rear Tyre	195/65 R15	FALKEN	6 mm	
L/H Rear Tyre	195/65 R15	FALKEN	6 mm	
4. Description of Damages				
THE VEHICLE SUSTAINED DAMAGES AT THE FRONT AND REAR PORTION. DAMAGES SEE DETAILS.				
5. General Information				
Accident Date	04/11/2020	Inspection Date	09/11/2020	
Survey held at	SMRT AUTOMOTIVE SERVICES PTE LTD 60 WOODLANDS INDUSTRIAL PARK E4 SINGAPORE 757705			
5a. Remarks				
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.				
5b. Estimate Days of Repair				
ESTIMATED NORMAL PERIOD FOR REPAIR:			9 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 5

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SHC 4769D

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	BUMPER FRT (DISC 25%)	CRUMPLED	482.00	361.50
10	BUMPER CLIPS @\$1.61 (DISC 25%)	NECESSARY	16.10	12.08
1	BRACKET ,FR BUMPER (DISC 25%)	CRUMPLED	110.40	82.80
1	COVER ,FR BUMPER HOLE RH (DISC 25%)	MISSING	18.50	13.88
1	BUMPER GRILLE SUB-ASSY ,LOWER (DISC 25%)	CRUMPLED	311.10	233.33
1	EMBLEM FRONT (DISC 25%)	NECESSARY	86.50	64.88
1	BUMPER REAR (DISC 25%)	CRUMPLED	458.60	343.95
10	BUMPER CLIPS @\$2.10 (DISC 25%)	NECESSARY	21.00	15.75
1	BUMPER REINFORCEMENT REAR (DISC 25%)	BENT	205.70	154.28
1	ARM SUB-ASSY ,RR BUMPER RH (DISC 25%)	BENT	139.60	104.70
1	ARM SUB-ASSY ,RR BUMPER LH (DISC 25%)	BENT	139.60	104.70
1	BUMPER SIDE RETAINER RR/LH (DISC 25%)	BROKEN	94.80	71.10
1	BUMPER SIDE RETAINER RR/RH (DISC 25%)	BROKEN	94.80	71.10
1	BUMPER LIP REAR (DISC 25%)	CRUMPLED	228.90	171.68
1	END PANEL (DISC 25%)	DENTED	602.10	451.58
1	END PANEL COVER ,DECK TRIM HOLE (DISC 25%)	CRUMPLED	46.10	34.58
1	END PANEL COVER ,DECK TRIM ,RR (DISC 25%)	CRUMPLED	121.10	90.83
1	BOX ,DECK FLOOR ,RR (DISC 25%)	CRUMPLED	649.70	487.28
1	TAILGATE ASY (DISC 25%)	DENTED	1,007.90	755.93
1	TAILGATE DOOR GLASS MOULDING RH (DISC 25%)	NECESSARY	29.40	22.05
1	TAILGATE DOOR GLASS MOULDING LH (DISC 25%)	NECESSARY	29.40	22.05
1	MOULDING BACK WINDOW LOWER NO.1 (DISC 25%)	NECESSARY	29.40	22.05
1	TAILGATE LOWER WINDOW GLASS (DISC 25%)	NECESSARY	721.30	540.98
1	TAILGATE DOOR LOCK (DISC 25%)	JAMMED	444.10	333.08
1	TAILGATE DOOR WEATHERSTRIP (DISC 25%)	CRUMPLED	353.40	265.05
1	TAILGATE BOARD ASSY (DISC 25%)	CRUMPLED	246.90	185.18
1	TAILGATE OUTSIDE GARNISH (DISC 25%)	CRACKED	504.90	378.68
1	NAME PLATE (HYBRID) (DISC 25%)	NECESSARY	51.90	38.93
1	NAME PLATE (PRIUS) (DISC 25%)	NECESSARY	60.80	45.60
1	NAME PLATE (TOYOTA) (DISC 25%)	NECESSARY	51.90	38.93
1	FENDER RR/RH (DISC 25%)	DENTED	766.80	575.10

Report Ref No. CC3/CTI20012331/Qra3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 5

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	TAIL LAMP BRACKET ,RH (DISC 25%)	BROKEN	30.70	23.03
1	BUMPER ENERGY ABSORBER FRT (DISC 25%)	CRUMPLED	78.80	59.10
1	BUMPER REINFORCEMENT FRT (DISC 25%)	BENT	498.40	373.80
1	ARM SUB-ASSY ,FR BUMPER LH (DISC 25%)	BENT	250.40	187.80
1	BUMPER LIP COVER RR/RH (DISC 25%)	CRUMPLED	118.10	88.58
1	PANEL ASSY ,DECK RH (DISC 25%)	DEFORMED	307.00	230.25
1	BOARD ASSY ,RR RH (DISC 25%)	CRACKED	379.20	284.40
1	PROTECTOR ,SPARE (DISC 25%)	CRUMPLED	143.70	107.78
1	CARRIER ,SPARE (DISC 25%)	BENT	19.70	14.78
1	ANTENNA ,ELECTRICAL LOWER REAR (DISC 10%)	CRUMPLED	157.40	141.66
1	TAIL LAMP RH (DISC 10%)	CRUMPLED	557.80	502.02
1	NUMBER PLATE FRAME (SN)	CRUMPLED	12.00	12.00
1	NUMBER PLATE (SN)	CRUMPLED	15.00	15.00
2	PIXEL STICKER @\$60.00 (SN)	NECESSARY	120.00	120.00
1	SENSOR REVERSE (SN)	SHORTED	180.00	180.00
1	SEALANT SIKAFLEX (SN)	NECESSARY	37.00	37.00
1	SEALANT W/SCREEN (SN)	NECESSARY	37.00	37.00
1	SMRT LOGO (SN)	NECESSARY	7.80	7.80
1	STICKER DECAL 65558888 (SN)	NECESSARY	21.60	21.60
1	SMRT LOGO (SN)	NECESSARY	7.80	7.80
1	STICKER DECAL 65558888 (SN)	NECESSARY	21.60	21.60
1	BATTERY (SN)	CRUMPLED	278.00	278.00
1	NUMBER PLATE FRAME (SN)	CRUMPLED	12.00	12.00
1	NUMBER PLATE (SN)	SCRATCHED	15.00	15.00
2	SPARE TYRE INSULATOR SHEET @\$15.00 (SN)	NECESSARY	45.00	45.00
1	BUMPER SUPPORT F/RH	SERVICEABLE	76.40	-
1	BUMPER SUPPORT F/LH	SERVICEABLE	76.40	-
1	BUMPER ENERGY ABSORBER FRT	SERVICEABLE	78.80	-
1	BUMPER REINFORCEMENT FRT	SERVICEABLE	498.40	-
1	ARM SUB-ASSY ,FR BUMPER LH	SERVICEABLE	250.40	-
1	ARM SUB-ASSY ,FR BUMPER RH	SERVICEABLE	250.40	-
1	LENS & BODY ,FR TURN RH	SERVICEABLE	511.80	-
1	GRILLE ,RADIATOR	SERVICEABLE	310.60	-

Report Ref No. CC3/CTI20012331/Qra3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:3 of 5

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	GRILLE ,RADIATOR LOWER NO.2	SERVICEABLE	94.60	-
1	BUMPER LIP FRT	SERVICEABLE	139.60	-
1	BUMPER FRT ABSORBER LOWER	SERVICEABLE	127.70	-
1	UNDER COVER CENTER	SERVICEABLE	448.30	-
1	BUMPER SEAL ,RR LH	SERVICEABLE	88.90	-
1	BUMPER SEAL ,RR RH	SERVICEABLE	65.70	-
1	BUMPER LIP COVER RR/LH	SERVICEABLE	72.20	-
1	BUMPER LIP COVER RR/RH	SERVICEABLE	118.10	-
1	UNDER COVER SUB-ASSY ,RR FLOOR	SERVICEABLE	514.50	-
1	UNDER COVER RR SHIELD	SERVICEABLE	63.90	-
1	SPARE TYRE PANEL	SERVICEABLE	667.70	-
1	BATTERY	SERVICEABLE	278.00	-
1	EXHAUST TAIL PIPE	SERVICEABLE	656.20	-
1	SUPPORT ,EXHAUST REAR	SERVICEABLE	33.60	-
1	NUMBER PLATE FRAME	SERVICEABLE	12.00	-
1	NUMBER PLATE	SERVICEABLE	15.00	-
1	WIRE BACK DOOR NO.1	SERVICEABLE	582.40	-
2	TAILGATE DOOR HINGE LH/RH	SERVICEABLE	58.30	-
1	TAILGATE DOOR STAY LH	SERVICEABLE	241.50	-
1	TAILGATE DOOR STAY RH	SERVICEABLE	241.50	-
1	TAILGATE LOCK COVER	SERVICEABLE	15.70	-
1	STRIKER BACK DOOR	SERVICEABLE	48.90	-
1	TAILGATE TRIM ,LH	SERVICEABLE	85.90	-
1	TAILGATE TRIM ,RH	SERVICEABLE	88.30	-
1	TAILGATE TRIM ,LOWER	SERVICEABLE	180.70	-
1	TAILGATE TRIM ,UPPER	SERVICEABLE	49.60	-
1	NUMBER PLATE	SERVICEABLE	15.00	-
1	NUMBER PLATE FRAME	SERVICEABLE	12.00	-
1	3RD BRAKE LAMP	SERVICEABLE	231.30	-
1	DOOR LOCK RR/RH	SERVICEABLE	709.30	-
1	DOOR HINGE LOWER RR/RH	SERVICEABLE	72.20	-
1	DOOR HINGE UPPER RR/RH	SERVICEABLE	90.10	-
1	CHECK ASSY ,RR DOOR	SERVICEABLE	150.30	-

Report Ref No. CC3/CTI20012331/Qra3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:4 of 5

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	FENDER LINE RR/RH	SERVICEABLE	141.30	-
1	FENDER RR/LH	SERVICEABLE	766.80	-
1	SMRT LOGO	SERVICEABLE	7.80	-
1	STICKER DECAL 65558888	SERVICEABLE	21.60	-
1	FENDER LINER R/LH	SERVICEABLE	141.30	-
1	TAIL LAMP LH	SERVICEABLE	548.40	-
1	SPOILER REAR	TO REPAIR SEE LABOUR	953.70	-
1	DOOR RR/RH	TO REPAIR SEE LABOUR	954.50	-
			23,333.30	8,916.61
	LABOUR			
	PANEL BEATING & BODY WORK.INCLUSIVE OF THE REPAIR OF SPOILER REAR AND DOOR RR/RH .		1,964.00	1,300.00
	SPRAY PAINT .		3,998.00	1,980.00
	TO TEST AND REFIX REVERSE SENSOR SYSTEM .		120.00	30.00
	TO TRANSFER REAR TAILGATE MECHANISM .		120.00	60.00
	TO REMOVE AND REFIX REAR WINDSCREEN .		120.00	100.00
	TO REMOVE AND REFIX TAILGATE GLASS .		120.00	100.00
	TO REMOVE & REFIT EXHAUST .	NOT NECESSARY	120.00	-
	TO REMOVE AND INSTALL LUGGAGE COMPARTMENT TRIM TO FACILITATE REPAIR .		120.00	40.00
	TO TRANSFER DOOR MECHANISM .	NOT NECESSARY	120.00	-
	TO REPLACE SUNDRY PARTS.	NOT NECESSARY	100.00	-
	TO CHECK WIRING AND SYSTEM FUNCTION .		80.00	20.00
	TO WASH AND VACUUM .	NOT NECESSARY	60.00	-
	TO ALIGN CHASSIS .		350.00	150.00
			7,392.00	3,780.00
GRAND TOTAL			30,725.30	12,696.61

Report Ref No. CC3/CTI20012331/Qra3q2



RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)			10,900.00
---	--	--	------------------

Report Ref No. CC3/CTI20012331/Qra3q2

OI SUN PIN

Asst. Automotive Assessor

HO LEONG CHUAN

Automotive Assessor

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SHC 4769D

INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R







LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

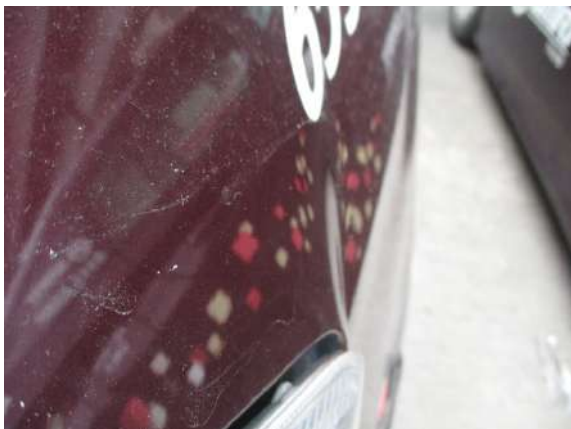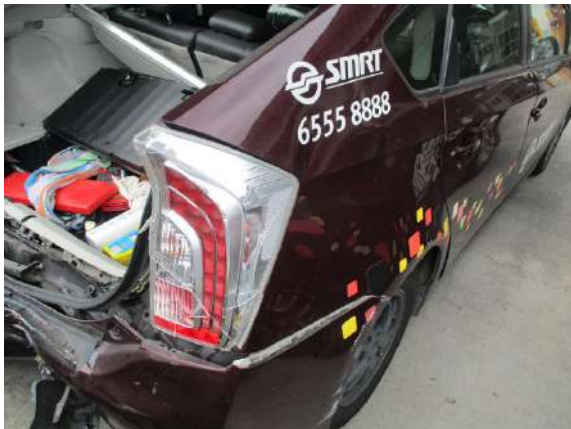



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

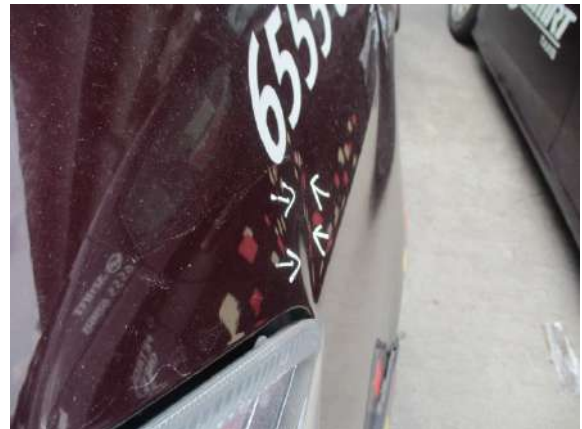



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

