

ASS. REC. BY:

CC4/AIG 20012426/Dga<sup>3</sup>

## ASSIGNMENT

COE March 2024

From: \_\_\_\_\_ Date: \_\_\_\_\_

Estimated Cost: \_\_\_\_\_

OD / TP / WS / TP RES / OD RES / EVA / INV / MV

To Inspect Vehicle No: \_\_\_\_\_

at Workshop m/s \_\_\_\_\_

of \_\_\_\_\_

Insured: \_\_\_\_\_

Policy No. \_\_\_\_\_

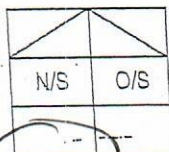
Claims No. \_\_\_\_\_

Sum Insured: \_\_\_\_\_ Excess: \_\_\_\_\_

(Client's Record)

Make of Veh: \_\_\_\_\_

(Policy Condition)

Remark: The veh had commenced its  
repair at the time of inspection.

Bal. or Market Value: \_\_\_\_\_

IDAC Accident Rpt \_\_\_\_\_ Consistent? : Yes or No

GIA / PR Seen: \_\_\_\_\_ Consistent? : Yes or No

Est. Repairs: 6 days Res.: Yes or NoLum Sum: 20 % 3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Date: \_\_\_\_\_ Person Contacted: \_\_\_\_\_

Vehicle: IN / OUT

Veh No: SHC 8832C Yr Regn: 2016 MarchType: M. Car / M. Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or \_\_\_\_\_

Make: Hyundai I40 c.c. 1685Colour: Blue A/C: Insured / Std / NI / NASp. Reading: 572480 T/Radio: Insured / Std / NI / NAEng/No: D4FDGU670627C/No: KMH1LB41UMGU086759Gen. Cond: Good / Fair / Poor / BurntSteering: In order / Jammed / Leaked / Burnt or \_\_\_\_\_Brake: In order / Jammed / Leaked / Burnt or \_\_\_\_\_Modi: Nil / S/Rim / STD A/Rim or \_\_\_\_\_Tyre Size: F: 205/60 R16R: 11

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or Hankook

Front \_\_\_\_\_ Rear \_\_\_\_\_

R/Bal. S mm R/Bal. S mmL/Bal. S mm L/Bal. S mmD.O.A. 10/11/2020 D.O.A. 13/11/2020Survey held at Swift Sin Ming

Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or

Rear N/S

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time Action / Instruction

AIG YP 530511

Date/Time, File Pass to?



Prel. Report

1)



Final Report

Date/Time, File Return to?

2)

Report Format: \_\_\_\_\_

Lump Sum / I.B.H. (\$) \_\_\_\_\_

Days Of Repair: \_\_\_\_\_

Resurvey No. of Trip: \_\_\_\_\_

Add Fee:



Site Insp (\$ \_\_\_\_\_)



Interview (\$ \_\_\_\_\_)



Tech. Invs (\$ \_\_\_\_\_)



Weekend (\$ \_\_\_\_\_)

Survey Fee:

Transportation:

S+RS, SI

Photos

Others

TOTAL



**BIFROST AUTO PTE LTD**

## REPAIR ESTIMATE

DATE: 12-Nov-20

INSURANCE: ALG.

MODEL: HYUNDAI I40

VEHICLE NO.: SHC 8832 C

DESCRIPTION	QTY	LIST PRICE	AMOUNT
BOOTLID <i>Dented</i>	1	\$2,174.90	\$2,174.90
BOOTLID RUBBER <i>deformed</i>	1	\$96.50	\$96.50
BOOTLID HINGE (LH/RH) <i>o/s st h/s H</i>	2	\$284.60	\$569.20
BOOTLID LOCK UPPER <i>Dam</i>	1	\$114.90	\$114.90
BOOTLID LOCK LOWER <i>leg</i>	1	\$23.20	\$23.20
BOOTLID KEY LOCK <i>H</i>	1	\$68.00	\$68.00
BOOTLID I40 EMBLEM (I40) <i>Hec</i>	1	\$67.90	\$67.90
BOOTLID 'H' EMBLEM <i>Hec</i>	1	\$63.10	\$63.10
BOOTLID CRDI PLATE <i>Hec</i>	1	\$52.40	\$52.40
BOOTLID LAMP (LH/RH) <i>broken / crack</i>	2	\$1,131.20	\$2,262.40
LICENSE LAMP (LH/RH) <i>H</i>	2	\$56.10	\$112.20
BOOTLID TRIMBOARD <i>H torn</i>	1	\$343.90	\$343.90
BOOTLID TRIMBOARD CLIPS (11 PCS) <i>Hec Hec</i>	1	\$11.00	\$11.00
BOOTLID MOULDING (I40) <i>mostly crack</i>	1	\$385.30	\$385.30
BOOTLID LOWER GARNISH CHROME(I40) <i>Hec</i>	1	\$227.90	\$227.90
REAR BUMPER <i>Dented</i>	1	\$1,106.00	\$1,106.00
REAR BUMPER REINFORCEMENT BRACKET <i>o/s st</i>	1	\$160.60	\$160.60
REAR BUMPER REINFORCEMENT <i>broken</i>	1	\$428.40	\$428.40
REAR BUMPER CLIP <i>Hec</i>	1	\$19.00	\$19.00
REAR BUMPER SPONGE <i>torn</i>	1	\$119.50	\$119.50
REAR BUMPER UNDER COVER <i>distrub</i>	1	\$228.00	\$228.00
REAR BUMPER REFLECTOR LAMP (I40) <i>o/s broken</i>	1	\$32.00	\$32.00
TAIL LAMP (LH/RH) <i>broken / crack</i>	2	\$697.80	\$1,395.60
TAIL LAMP QUARTER PANEL (LH) <i>Dented</i>	1	\$453.00	\$453.00
REAR PANEL <i>Dented</i>	1	\$526.70	\$526.70
REAR PANEL LOWER <i>Dented</i>	1	\$367.20	\$367.20
REAR PANEL GARNISH <i>mostly broken</i>	1	\$57.70	\$57.70
PANEL ASSY-REAR FLOOR SIDE (LH) <i>H</i>	1	\$177.00	\$177.00
SPARE TYRE HOLDER <i>H</i>	1	\$223.10	\$223.10
SPARE WHEEL LOCK NUT <i>H</i>	1	\$41.80	\$41.80
SPARE TYRE PANEL <i>H</i>	1	\$852.80	\$852.80
SPARE TYRE PANEL CUSHION <i>H</i>	1	\$223.10	\$223.10
MEMBER-ASSY-REAR FLOOR CENTRE <i>H</i>	1	\$570.40	\$570.40
REAR TOWING HOOK <i>H</i>	1	\$194.60	\$194.60
EXHAUST PIPE INSULATOR (LH) <i>H</i>	1	\$117.10	\$117.10
EXHAUST SILENCER (LH) <i>st</i>	1	\$1,935.40	\$1,935.40
EXHAUST PIPE HANGER <i>H</i>	1	\$117.10	\$117.10
REAR FENDER <i>Dented</i>	1	\$2,171.40	\$2,171.40
REAR FENDER UNDER SHIELD(LH) <i>H</i>	1	\$338.60	\$338.60
REAR TRAY LUGGS SIDE (LH) <i>H</i>	1	\$232.60	\$232.60
REAR FENDER AIR-DUCT (LH) <i>deformed</i>	1	\$51.60	\$51.60
REAR FENDER TRIM BOARD (LH) <i>st / torn</i>	1	\$688.75	\$688.75
REAR WINDSCREEN MOULDING <i>Hec</i>	1	\$51.80	\$51.80



<b>SUB TOTAL</b>			<b>\$19,453.65</b>
<b>LESS 20%</b>			<b>\$3,890.73</b>
<b>DISCOUNTED TOTAL</b>			<b>\$15,562.92</b>
BOOTLID COMFORT LOGO & TEL NO. STICKER <i>Nec</i> SN	1	\$17.00	\$17.00
BOOTLID ADVERTISEMENT LOGO <i>Nec</i> SN	1	\$100.00	\$100.00
REAR BUMPER RESERVE SENSOR <i>Dew</i> SN	1	\$118.00	\$118.00
REAR BUMPER ADVERTISEMENT LOGO <i>Nec</i> SN	1	\$50.00	\$50.00
REAR BUMPER RUBBER MAT / I40 PLATE <i>defond</i> SN	1	\$50.00	\$50.00
REAR FENDER ADVERTISEMENT LOGO (LH) <i>Nec</i> SN	1	\$100.00	\$100.00
REAR WINDSCREEN SEALANT <i>Nec</i> SN	1	\$46.00	\$46.00
<b>SUB TOTAL</b>			<b>\$481.00</b>
<b>Labour Charge</b>			
Panel Beating	1	\$1,600.00	<del>\$1,600.00</del>
Spray Painting Charge	1	\$1,400.00	<del>\$1,400.00</del>
Wiring Charge	1	\$160.00	<del>\$160.00</del>
Tuff Kote	1	\$180.00	<del>\$180.00</del>
Towing Charge	1	\$80.00	<del>\$80.00</del>
Remove/Refix Cushion & Upholstery Rear	1	\$150.00	<del>\$150.00</del>
Remove/Refix Rear Windscreen Glass	1	\$120.00	<del>\$120.00</del>
Remove/Refix Reverse Sensor	1	\$120.00	<del>\$120.00</del>
Remove/Refix Exhaust Pipe	1	\$80.00	<del>\$80.00</del>
Diagnostic & Resetting To Erase Fault Code	1	\$550.00	<del>\$550.00</del>
<b>TOTAL LABOUR</b>			<b>\$4,440.00</b>
<b>ESTIMATE TOTAL</b>			<b>\$ 20,483.92</b>
This is an initial estimate based on a visual inspection of the above vehicle. The final repair quantum will be prepared after the vehicle is surveyed by a motor Surveyor appointed by the insurance company.			

13/11/2020 @ 0915h

Not Author

2/11/20

6 days

*[Signature]*

2kk Auto

*[Signature]*

Check 7AT prices.

- LKK Auto Consultants hence notify the Repairer of the following:
- To resurvey before/after spray painting
  - To display damaged part(s) during resurvey
  - Parts prices are subject to confirmation
  - Third party survey is on a "Without Prejudice" basis
  - No illegal modification(s) is allowed
  - Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date: