



## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

### TAX INVOICE

LONPAC INSURANCE BHD  
300 BEACH ROAD  
#17-04/07 THE CONCOURSE  
SINGAPORE 199555

INV No. AC2102555  
INV Date 14/04/2021  
Reference CC4/LPC20012720/R1bs3q2  
Code LPC2

#### PROFESSIONAL SERVICE FEE

Vehicle No. SGT 6667Z  
Insured Veh. YN 3179D  
Claim No. 20/20/20/VC00/023918  
Policy No.  
Accident Date 17/11/2020  
Inspection Date 25/11/2020

Description	Total
Third Party Express Settlement	400.00
<b>Subtotal</b>	<b>400.00</b>
<b>GST (7%)</b>	<b>28.00</b>
<b>Grand Total</b>	<b>428.00</b>

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

**LKM**



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile			
LONPAC INSURANCE BHD 300 BEACH ROAD #17-04/07 THE CONCOURSESINGAPORE 199555		Ref: CC4/LPC20012720/R1bs3q2 Date: 14/04/2021 Code: LPC2	
<b>1. Policy Particulars :- THIRD PARTY CLAIM</b>			
<b>Insured Veh.</b>	YN 3179D	<b>Veh. Inspected</b>	SGT 6667Z
<b>Policy No.</b>		<b>Coverage (\$)</b>	0.00
<b>Claim No.</b>	20/20/20/VC00/023918	<b>Excess (\$)</b>	0.00
<b>Assign From</b>	ONG LI LI	<b>Assign Date</b>	18/11/2020
<b>2. Vehicle Particulars &amp; Condition</b>			
<b>Make &amp; Model</b>	B.M.W. 540I SR LED NAV	<b>c.c</b>	2998
<b>Engine No.</b>	HIDDEN	<b>Year of Reg.</b>	2017
<b>Chassis No.</b>	WBAJB32000G459840	<b>Colour</b>	GREY
<b>Odometer</b>	68703 KM	<b>Steering</b>	IN ORDER
<b>Brakes</b>	IN ORDER	<b>Modification</b>	SPORTS RIM
<b>General</b>	FAIR		
<b>3. Conditions of Tyres</b>			
	<b>Size</b>	<b>Make</b>	<b>Balance</b>
<b>R/H Front Tyre</b>	245/35 R20	GOODYEAR	6 mm
<b>L/H Front Tyre</b>	245/35 R20	GOODYEAR	6 mm
<b>R/H Rear Tyre</b>	245/35 R20	GOODYEAR	6 mm
<b>L/H Rear Tyre</b>	245/35 R20	GOODYEAR	6 mm
<b>4. Description of Damages</b>			
	THE VEHICLE SUSTAINED DAMAGES AT THE N/S FRONT PORTION. DAMAGES SEE DETAILS.		
<b>5. General Information</b>			
<b>Accident Date</b>	17/11/2020	<b>Inspection Date</b>	25/11/2020
<b>Survey held at</b>	PERFORMANCE MOTORS LTD 303 ALEXANDRA ROAD SINGAPORE 159941		
<b>5a. Remarks</b>			
	A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.		
<b>5b. Estimate Days of Repair</b>			
	ESTIMATED NORMAL PERIOD FOR REPAIR:		<b>5 Working Days</b>



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

## ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SGT 6667Z

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
<b><u>REPLACEMENT OF PARTS</u></b>				
1	SUNDRIES (SN)	NECESSARY	150.00	150.00
1	FRT LH SIDE PANEL ALUMINIUM (SN)	TO REPAIR SEE LABOUR	933.30	-
1	LH FOG LAMP SUPPORT (M) (SN)	CRACKED	65.00	65.00
1	FRT BUMPER PANEL PRIMED (M) (SN)	CRACKED	1,653.55	1,653.55
1	SET MOUNTING PDC/PMA SENSOR FRT (SN)	NOT NECESSARY	69.35	-
1	TRIM GRILLE FRT (I CAM) (SN)	SERVICEABLE	25.45	-
1	FRT LH WHEEL ARCH FRT SECTION COVER (SN)	SERVICEABLE	132.70	-
1	LH BOTTOM COVER (SN)	SERVICEABLE	75.60	-
1	LH HEADLIGHT LED AHL HIGH (ICON LIG) (SN)	CRACKED	4,879.55	4,879.55
4	HEX BOLT (SN) (ADDITIONAL)	NECESSARY	6.00	6.00
1	LH BUMPER GUIDE (SN) (ADDITIONAL)	CRACKED	16.95	16.95
4	EXPANDING RIVET D=8MM (SN) (ADDITIONAL)	NECESSARY	4.40	4.40
			<b>8,011.85</b>	<b>6,775.45</b>
<b><u>LABOUR</u></b>				
TO REPLACE BUMPER FRONT COVER ,FRONT LEFT SIDE PANEL AND FRONT LOWER SPOILER .			2,975.00	1,700.00
TO SPRAY PAINT BUMPER FRONT COVER AND FRONT LEFT SIDE PANEL .			1,923.00	1,730.00
TO REPLACE LEFT HEADLIGHT AND REPROGRAMING /			481.00	408.00
TO REMOVE OLD PDC ASSEMBLY ,REPLACE DAMAGED PARTS AND RECONNECT TO NEW BUMPER INCLUDING RECONNECT TO NEW BUMPER AND CONDUCT CHECK FOR PROPER FUNCTION .			177.00	150.00
TO CHECK ELECTRICAL WIRING SYSTEM AT THE FRONT SECTION FOR PROPER FUNCTION INCLUDING ADJUSTMENT OF HEADLIGHTS.			177.00	150.00
TO SUPPLY AND INSTALL PROTECTION FILM ON LEFT HEADLIGHT.(ADDITIONAL)			150.00	150.00
TO INSTALL FRONT LIP LABOUR .(ADDITIONAL)			100.00	100.00
TO SUPPLY COATING ON FRONT BUMPER AND FRONT LEFT SIDE FENDER .(ADDITIONAL)			300.00	300.00
			<b>6,283.00</b>	<b>4,688.00</b>
<b>GRAND TOTAL</b>			<b>14,294.85</b>	<b>11,463.45</b>

Report Ref No. CC4/LPC20012720/R1bs3q2



<b>RECOMMENDED COST OF REPAIRS</b>			<b>11,463.45</b>
------------------------------------	--	--	------------------

Report Ref No. CC4/LPC20012720/R1bs3q2

**MOHAMMED RASUL BIN MOHD YUNUS**

**Automotive Assessor**

**HO LEONG CHUAN**

**Automotive Assessor**

**DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.**

**No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.**



# LKK Auto Consultants Pte Ltd



51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

## PHOTOGRAPHS FOR VEHICLE NO. SGT 6667Z

## INSPECTION

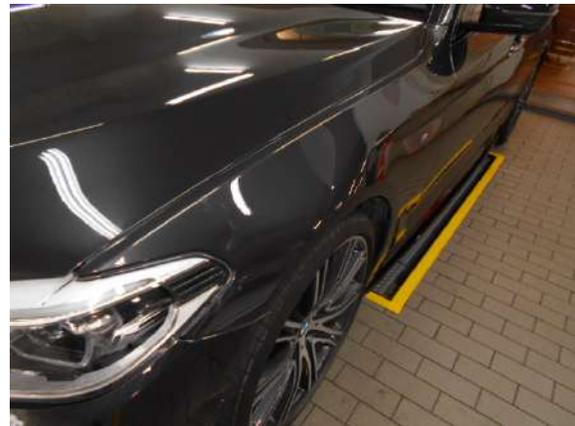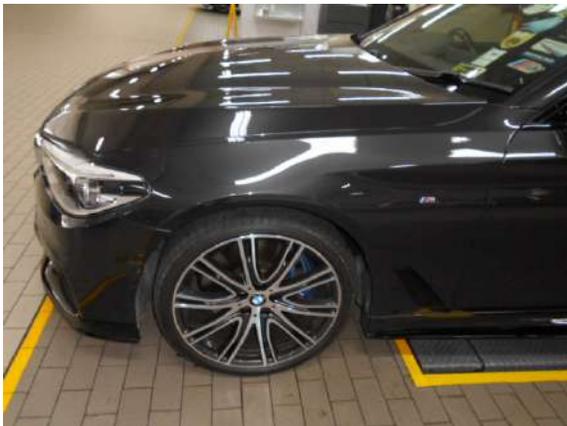



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R







# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

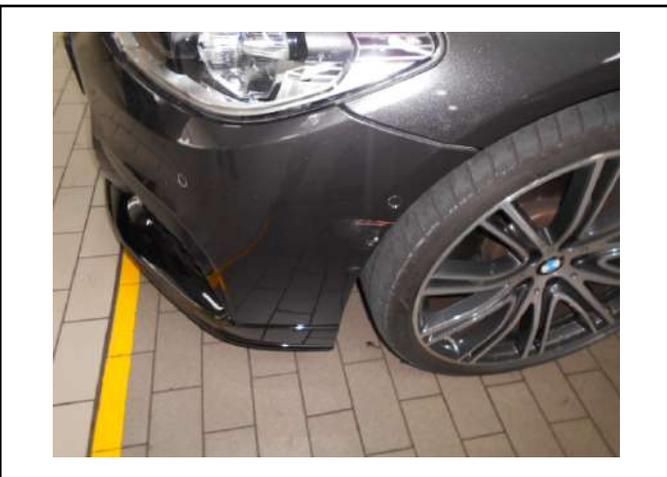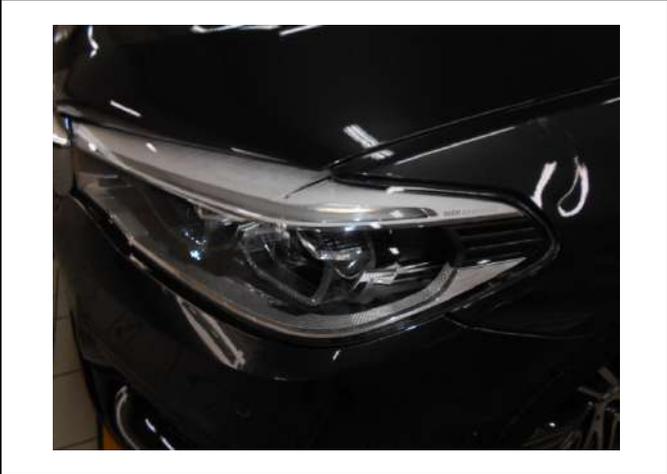




# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

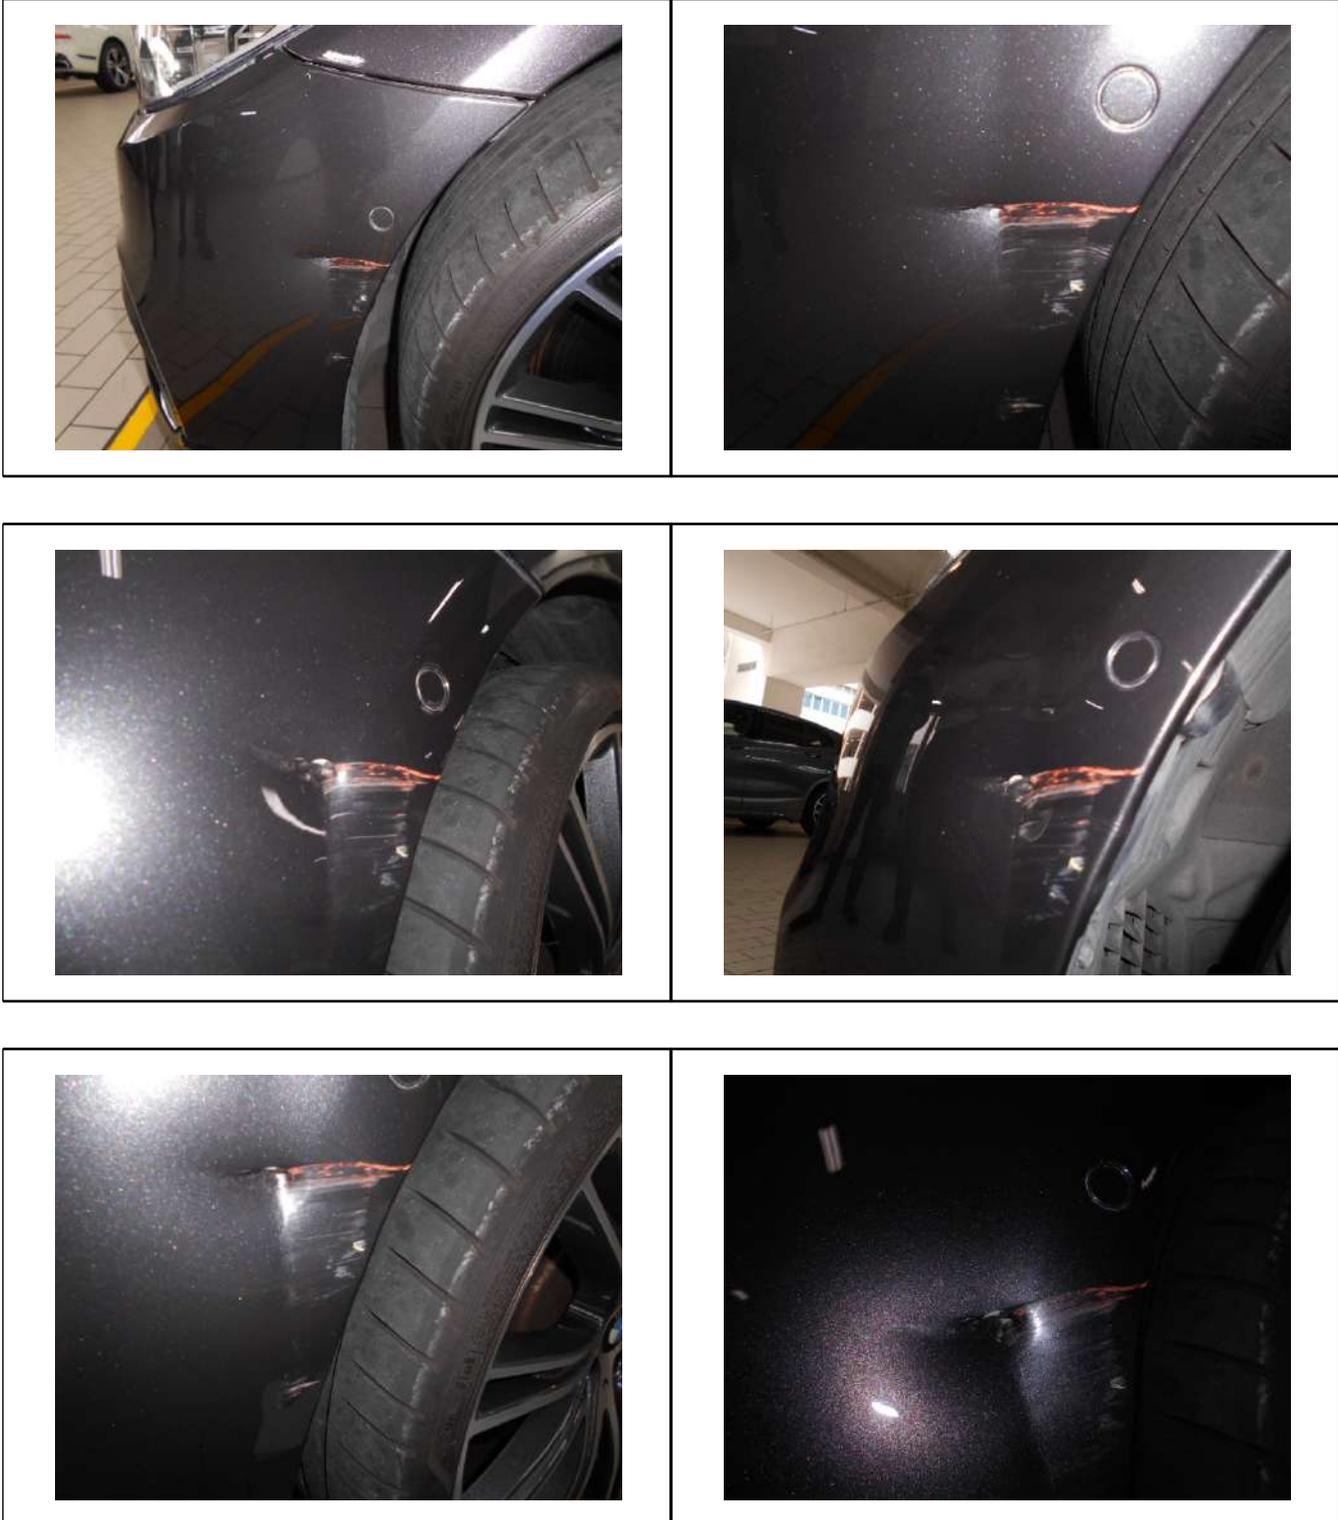



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

## PHOTOGRAPHS FOR VEHICLE NO. SGT 6667Z

## RE-INSPECTION






# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

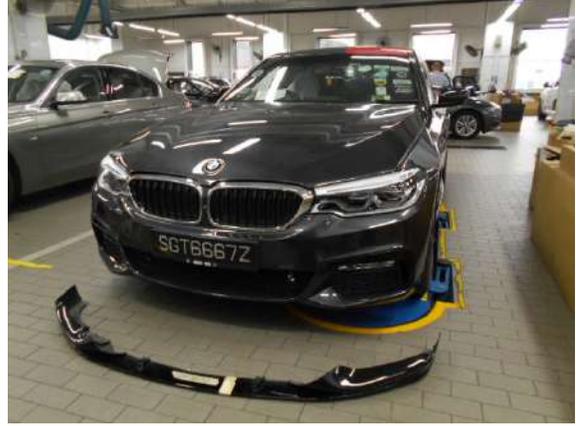



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

