

## PREMIER APPRAISER SERVICES

Insurance Loss Adjusters and Qualified Appraisers  
16 Sin Ming Walk, #03-02 Singapore 571568  
Tel: 6654-2269 Fax: 6685-1399  
Reg. No: 52864369W

Our Ref : PT2008003-L  
Date : 03rd Sep 2020

Mr. Ho Teow Bok Simon  
c/o Bk 9002 Tampines Street 93  
#01-74 Tampines Ind Park A  
Singapore 528836

**WITHOUT PREJUDICE**

Dear Sir,

**Re: Third Party Claim / Workshop :- Chip Soon Auto Supply Pte Ltd**  
**Vehicle Regn. No. : SLJ 1417 E**

We refer to your instruction to appraise the above-mentioned vehicle on 25th Aug 2020 .

A static inspection was carried out and our report is enclosed for your perusal. The estimated repair costs submitted by the repairer for **SS 22,618.10** as per our attached schedule have been scrutinized and revised by us against the actual damages found on the vehicle and we recommend the replacements and rectification accordingly.

The repairer has agreed to undertake the repairs at our adjusted amount of **SS11,800.00 lump sum** corresponding to supply of parts, labour charges and spraypainting. However, we have not given instruction to authorize.

Under normal circumstances the estimated period of repairs is **NINE ( 9 ) days**.  
The estimated period of repairs given above is based on **Working Day (s)** only.

Photographs of the damaged vehicle taken by us during our inspection are enclosed.

We are leaving the matter to you for a decision.

Please do not hesitate to contact us if you need any clarification.

Assuring you of our best services always.

Very truly yours  
**PREMIER APPRAISER SERVICES**

  
**LESLIE K O LIM CAE (UK), MIMI (UK)**  
MSAAA Automotive Appraiser  
Dip.MTM Automotive Engineer

# PREMIER APPRAISER SERVICES

## VEHICLE INSPECTION REPORT

To: Mr. Ho Teow Bok Simon  
c/o Blk 9002 Tampines Street 93  
#01-74 Tampines Ind Park A  
Singapore 528936

Our Ref. : PT2008003-L  
Policy No. : -  
Claim No. : -  
Sum Insured : -  
Type of Claim : T/P Claim  
Date : 03rd Sep 2020

Assigned By : Mr. Ho Teow Bok Simon  
Date of Assignment : 25th Aug 2020  
Date of Accident : 24th Aug 2020  
Date of Inspection : 26th Aug 2020 Follow up inspections were also conducted.  
Name of Workshop : Chip Soon Auto Supply Pte Ltd  
Place of Inspection : Blk 9002 Tampines Street 93 #01-74  
Singapore 528936

### PARTICULARS OF VEHICLE

|                      |                        |               |                |
|----------------------|------------------------|---------------|----------------|
| Registration No.     | : SLJ 1417 E           | Odometer/km   | : 090501       |
| Make/Model           | : Honda Shuttle 1 SG A | Chassis No.   | : GK81007587   |
| Type Of Body         | : Station Wagon        | Engine No.    | : L15B3538884  |
| Year of Manuf./Regr. | : 2016                 | Engine Cyl    | : 1496 cc      |
| Colour               | : Deep Blue            | Carrying Cap. | : 4 Passengers |

### PRE-ACCIDENT CONDITION (Static tests only)

|           |               |               |        |               |     |
|-----------|---------------|---------------|--------|---------------|-----|
| Handbrake | : Serviceable | Body Work     | : Good | Market Value  | : - |
| Footbrake | : Serviceable | Paint Work    | : Good | Salvage Value | : - |
| Steering  | : Serviceable | Modifications | : None | CTL (Loss)    | : - |

### CONDITION OF TYRES

|                    | Size         | N/s - Tread Depth/Make | O/s - Tread Depth/Make |
|--------------------|--------------|------------------------|------------------------|
| Front Tread        | 195/60 - R15 | 6mm - Firestone        | 6mm - Firestone        |
| Rear Tread (inner) |              |                        |                        |
| Rear Tread (outer) | 195/60 - R15 | 6mm - Firestone        | 6mm - Firestone        |

The above represent an estimated remaining life of two tyre treads in mm.

### POINT OF IMPACT/GENERAL DESCRIPTION OF DAMAGES

The vehicle sustained impacts on the front and rear portions.

**FRONT :-** The bonnet, radiator support panel, bumper, bumper reinforcement were dented/ chafed/ distorted.  
The front grille, o/s headlamp, bumper lower grille were chafed/ grazed/ cracked.

**REAR :-** The tail gate, boot floor, rear end panel, tail lamp trough panels, o/s rear fender, rear bumper, were badly dented/ chafed/ distorted.

For details of damages please refer to our schedule attached.

### REMARKS :

This survey was conducted strictly without prejudice.

This report is confidential and is given for the use of clients and their agents and any disclosure or publication of it or parts thereof shall be the responsibility of such person and no liability shall be attached to us therefore.

# PREMIER APPRAISER SERVICES

Our Ref : PT2008003-L

Vehicle No : SUJ 1417 E

| Qty          | Parts Descriptions                    | Conditions       | Repairer's Est. | Our Revised   |
|--------------|---------------------------------------|------------------|-----------------|---------------|
| LIST ITEMS:  |                                       |                  |                 |               |
| 1            | bonnet                                | dented - repair  | S\$ 1,029.30    | S\$ -         |
| 1            | bonnet insulator                      | serviceable      | 196.70          | -             |
| 1            | bonnet lock                           | stiffened        | 298.30          | 298.30        |
| 1            | radiator grille                       | chafed/cracked   | 658.00          | 658.00        |
| 1            | radiator grille chromed mldg          | chafed/cracked   | 321.80          | 321.80        |
| 1            | radiator grille "H" emblem            | damaged          | 155.20          | 155.20        |
| 1            | o/s headlamp                          | chafed/cracked   | 2,243.80        | 2,245.80      |
| 1            | front bumper                          | dented/distorted | 1,227.70        | 1,227.70      |
| 1            | front bumper o/s bracket              | damaged          | 64.30           | 64.30         |
| 1            | front bumper o/s bracket              | damaged          | 64.30           | 64.30         |
| 1            | front bumper o/s retainer             | damaged          | 52.60           | 52.60         |
| 1            | front bumper o/s retainer             | damaged          | 52.60           | 52.60         |
| 1            | front bumper reinforcement            | dented/distorted | 521.40          | 521.40        |
| 1            | front bumper lower grille             | damaged          | 681.40          | 681.40        |
| 1            | tail gate                             | badly dented     | 1,193.20        | 1,193.20      |
| 2            | tail gate hinges                      | bent - repair    | 81.00           | -             |
| 1            | tail gate lock                        | stiffened        | 157.10          | 157.10        |
| 1            | tail gate lock striker                | bent             | 54.70           | 54.70         |
| 1            | tail gate lock buzzer                 | damaged          | 80.10           | 80.10         |
| 1            | tail gate weatherstrip                | warped           | 168.60          | 168.60        |
| 1            | tail gate inner trimboard             | serviceable      | 320.40          | -             |
| 1            | tail gate outer keyless sensor        | serviceable      | 85.40           | -             |
| 1            | tail gate chromed moulding            | damaged          | 363.80          | 363.80        |
| 1            | tail gate "H" emblem                  | necessary        | 51.90           | 51.90         |
| 1            | tail gate "SHUTTLE" emblem            | damaged          | 55.40           | 55.40         |
| 1            | tail gate glass mldg                  | necessary        | 149.20          | 149.20        |
| 1            | tail gate o/s reflector               | cracked          | 395.40          | 395.40        |
| 1            | o/s tail lamp assy                    | chafed/damaged   | 520.40          | 520.40        |
| 1            | rear end panel                        | badly dented     | 560.20          | 560.20        |
| 1            | rear end panel top trim               | warped           | 185.40          | 185.40        |
| 1            | rear bumper fascia                    | badly dented     | 1,150.40        | 1,150.40      |
| 2            | rear bumper side retainer             | damaged          | 52.00           | 52.00         |
| 1            | rear bumper sponge                    | damaged          | 112.00          | 112.00        |
| 1            | rear bumper o/s reflector             | damaged          | 159.00          | 159.00        |
| 1            | rear bumper o/s reflector garnish     | damaged          | 120.00          | 120.00        |
| 1            | rear bumper tow cover                 | damaged          | 26.00           | 26.00         |
| 1            | boot floor panel                      | buckled - repair | 1,343.00        | -             |
| 1            | rear floor panel board                | damaged          | 655.20          | 655.20        |
| 1            | rear floor tools tray                 | damaged          | 554.00          | 554.00        |
| 1            | exhaust silencer                      | bent - repair    | 987.00          | -             |
|              |                                       |                  | S\$ 17,152.10   | S\$ 13,107.30 |
|              |                                       |                  | LESS 0%         | 20%           |
|              |                                       |                  | 17,152.10       | 10,485.84     |
| SNETT ITEMS: |                                       |                  |                 |               |
| 1            | radiator grille clips - set           | necessary        | 24.00           | 24.00         |
| 1            | front number plate w casing           | damaged          | 60.00           | 60.00         |
| 1            | front bumper clips - set              | necessary        | 52.00           | 52.00         |
| 1            | front bumper lower grille clips - set | necessary        | 24.00           | 24.00         |
|              |                                       |                  | S\$ 17,312.10   | S\$ 10,645.84 |

# PREMIER APPRAISER SERVICES

Our Ref: PT2008003-L

Vehicle No: SLJ 1417 E

| Qty | Parts Descriptions                                                                                        | Conditions  | Repairer's Est. | Our Revised   |
|-----|-----------------------------------------------------------------------------------------------------------|-------------|-----------------|---------------|
|     |                                                                                                           | Balance b/f | S\$ 17,312.10   | S\$ 10,845.84 |
|     | SMNETT ITEMS: (Cont)                                                                                      |             |                 |               |
| 1   | tail gate inner trimboard clips - set                                                                     | necessary   | 45.00           | 45.00         |
| 1   | tail gate glass midg clips - set                                                                          | necessary   | 44.00           | 44.00         |
| 1   | tail gate glass inner seal                                                                                | necessary   | 60.00           | 36.00         |
| 1   | tail gate glass sealant                                                                                   | necessary   | 80.00           | 60.00         |
| 1   | tail gate o/s reflector clips - set                                                                       | necessary   | 11.00           | 11.00         |
| 1   | tail gate o/s reflector sealant                                                                           | necessary   | 20.00           | 20.00         |
| 1   | o/s tail lamp sealant                                                                                     | necessary   | 20.00           | 20.00         |
| 2   | tail lamp clips - set                                                                                     | necessary   | 12.00           | 12.00         |
| 1   | rear number plate w casing                                                                                | damaged     | 60.00           | 60.00         |
| 1   | rear end panel joint sealant                                                                              | necessary   | 60.00           | 60.00         |
| 1   | rear end panel top trim clips - set                                                                       | necessary   | 22.00           | 22.00         |
| 1   | rear bumper clips - set                                                                                   | necessary   | 52.00           | 52.00         |
| 1   | reverse sensors w control unit                                                                            | damaged     | 380.00          | 220.00        |
|     | TOTAL SPARTS                                                                                              |             | S\$ 18,178.10   | S\$ 11,297.84 |
|     | To remove/refit rear windscreen to facilitate repairs.                                                    |             |                 |               |
|     |                                                                                                           |             | 150.00          | 120.00        |
|     | To remove/refit luggage trims and garnish to facilitate repairs.                                          |             |                 |               |
|     |                                                                                                           |             | 120.00          | 80.00         |
|     | To remove/refit/repair exhaust silencer.                                                                  |             |                 |               |
|     |                                                                                                           |             | 120.00          | 50.00         |
|     | Labour charges to repair, panel beat and straighten damaged parts and replace the above front body parts. |             |                 |               |
|     |                                                                                                           |             | 450.00          | 350.00        |
|     | Labour charges to repair, panel beat and straighten damaged parts and replace the above rear body parts.  |             |                 |               |
|     |                                                                                                           |             | 1,100.00        | 880.00        |
|     | To transfer boot lid fittings.                                                                            |             |                 |               |
|     |                                                                                                           |             | 90.00           | 80.00         |
|     | To transfer reverse camera.                                                                               |             |                 |               |
|     |                                                                                                           |             | 100.00          | 50.00         |
|     | To replace parking sensors.                                                                               |             |                 |               |
|     |                                                                                                           |             | 100.00          | 50.00         |
|     | To check wiring functions.                                                                                |             |                 |               |
|     |                                                                                                           |             | 80.00           | 30.00         |
|     | To carry out on board diagnostic check, clear and reset fault codes                                       |             |                 |               |
|     |                                                                                                           |             | 280.00          | 220.00        |
|     | To putty, apply primer & spray paint front affected areas.                                                |             |                 |               |
|     |                                                                                                           |             | 500.00          | 400.00        |
|     | To putty, apply primer & spray-paint rear affected areas.                                                 |             |                 |               |
|     |                                                                                                           |             | 1,200.00        | 1,050.00      |
|     | To apply rust-proofing on repaired/replaced panels.                                                       |             |                 |               |
|     |                                                                                                           |             | 150.00          | 120.00        |
|     | TOTAL                                                                                                     |             | S\$ 22,618.10   | S\$ 14,807.84 |

## PREMIER APPRAISER SERVICES

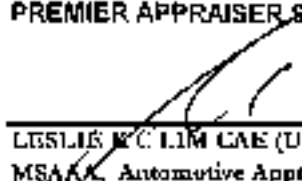
Our Ref: PT2008003-L

Vehicle No : SLJ 1417 E

Note. The repairer has agreed to undertake the repairs at our adjusted amount of **£511,800.00 lump sum** corresponding to supply of parts, labour and spray painting charges.

The estimated period of repairs is **NINE (9) days**. Pursuant to your instruction we have **not** authorised repairs on your behalf

PREMIER APPRAISER SERVICES

  
LESLIE M.C. LIM CAE (UK), MIMT (UK)  
MSAFA, Automotive Appraiser  
Dip.MTM. Automotive Engineer











