



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

QBE INSURANCE (SINGAPORE) PTE LTD

INV No. AC2102190

1 RAFFLES QUAY #29-10 SOUTH TOWER
SINGAPORE 048583

INV Date 05/04/2021
Reference CC6/QBE20013124/Ara3q2
Code QBE

PROFESSIONAL SERVICE FEE

Vehicle No. SMQ 6298A
Insured Veh. GBE 858S
Claim No. VC014132
Policy No. 8-V0014300-MVA-R003
Accident Date 26/11/2020
Inspection Date 26/11/2020

Description	Total
Third Party Express Settlement	400.00
Subtotal	400.00
GST (7%)	28.00
Grand Total	428.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
QBE INSURANCE (SINGAPORE) PTE LTD 1 RAFFLES QUAY #29-10 SOUTH TOWERSINGAPORE 048583			Ref: CC6/QBE20013124/Ara3q2	
			Date: 05/04/2021	
			Code: QBE	
1. Policy Particulars :- THIRD PARTY CLAIM				
Insured Veh.	GBE 858S		Veh. Inspected	SMQ 6298A
Policy No.	8-V0014300-MVA-R003		Coverage (\$)	0.00
Claim No.	VC014132		Excess (\$)	0.00
Assign From			Assign Date	26/11/2020
2. Vehicle Particulars & Condition				
Make & Model	HONDA SHUTTLE		c.c	1496
Engine No.	HIDDEN		Year of Reg.	2019
Chassis No.	GK82101231		Colour	SILVER
Odometer	65261 KM		Steering	IN ORDER
Brakes	IN ORDER		Modification	SPORTS RIM
General	GOOD			
3. Conditions of Tyres				
		Size	Make	Balance
R/H Front Tyre		185/60 R15	DUNLOP	6 mm
L/H Front Tyre		185/60 R15	DUNLOP	6 mm
R/H Rear Tyre		185/60 R15	DUNLOP	6 mm
L/H Rear Tyre		185/60 R15	DUNLOP	6 mm
4. Description of Damages				
THE VEHICLE SUSTAINED DAMAGES AT THE REAR PORTION. DAMAGES SEE DETAILS.				
5. General Information				
Accident Date	26/11/2020		Inspection Date	26/11/2020
Survey held at	MG SOLUTION PTE LTD 23 KAKI BUKIT AVE 4 (SOUTH WING) #02-03B VICOM INSPECTION CENTRE, SINGAPORE 415933			
5a. Remarks				
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.				
5b. Estimate Days of Repair				
ESTIMATED NORMAL PERIOD FOR REPAIR:			6 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 3

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SMQ 6298A

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	TAILGATE	DISTORTED	1,455.30	1,193.00
1	TAILGATE LOGO	NECESSARY	55.60	55.60
1	TAILGATE EMBLEM 'SHUTTLE'	NECESSARY	85.20	85.20
2	TAILGATE HINGE @\$50.00	NOT NECESSARY	100.00	-
2	TAILGATE DAMPER @\$180.00	NOT NECESSARY	360.00	-
2	TAILGATE REFLECTOR @\$480.00	CRACKED	960.00	772.00
1	TAILGATE INNER LOCK	DAMAGED	190.00	190.00
1	TAILGATE INNER HANDLE	NOT NECESSARY	90.00	-
1	TAILGATE WEATHERSTRIP	CUT	235.00	185.00
1	TAILGATE INNER TRIM BOARD	CRACKED	530.20	295.00
1	TAILGATE NUMBER PLATE GARNISH WITH CHROME	CRACKED	405.00	383.00
1	TAILGATE WINDSCREEN	SHATTERED	1,355.20	1,248.00
1	SET TAILGATE WINDSCREEN MOULDING	NECESSARY	180.00	180.00
1	TAILGATE WIPER BLADE	CUT	92.30	92.30
1	TAILGATE WIPER BLADE MOTOR	DAMAGED	522.30	375.00
1	REAR BUMPER	DEFORMED	1,250.00	1,250.00
2	REAR BUMPER SIDE RETAINER @\$64.50	NECESSARY	129.00	129.00
2	REAR BUMPER REFLECTOR @\$113.20	NOT NECESSARY	226.40	-
1	REAR BUMPER TOWING COVER	MISSING	45.20	45.20
1	REAR BUMPER CHROME	DEFORMED	350.00	190.00
2	TAILLAMP @\$580.00	CRACKED	1,160.00	1,041.00
2	TAILLAMP PANEL @\$320.00	TO REPAIR SEE LABOUR	640.00	-
2	REAR FENDER INNER TRIM (LOW) @\$630.00	N/S CRACKED	1,260.00	498.00
1	REAR END PANEL	DENTED	655.00	655.00
1	REAR END PANEL TOP GARNISH	DEFORMED	180.00	180.00
1	REAR FLOOR PANEL	TO REPAIR SEE LABOUR	1,255.40	-
1	REAR FLOOR PANEL TOP BOARD	DEFORMED	420.30	420.30
1	TOOLS TRAY	DEFORMED	320.00	320.00
1	TOOLS TRAY SIDE COVER	DEFORMED	90.00	90.00

Report Ref No. CC6/QBE20013124/Ara3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	LESS 20% DISCOUNT		-2,919.48	-1,974.52
			11,677.92	7,898.08
	<u>SPECIAL NETT ITEMS</u>			
1	REAR NUMBER PLATE (SN)	NOT NECESSARY	50.00	-
1	SET TAILGATE INNER TRIM CLIP (SN)	NECESSARY	20.00	20.00
1	TAILGATE WINDSCREEN SEALANT (SN)	NECESSARY	100.00	60.00
1	TAILGATE WINDSCREEN SOLAR FILM (SN)	NECESSARY	320.00	200.00
1	REAR BUMPER CLIPS (SN)	NECESSARY	20.00	20.00
1	SET REAR FENDER INNER TRIM CLIPS (SN)	NECESSARY	20.00	20.00
1	SET REAR END PANEL TOP GARNISH CLIPS (SN)	NECESSARY	20.00	20.00
1	REAR END PANEL INSULATOR SEAL (SN)	NECESSARY	100.00	60.00
1	REVERSE CAMERA (SN)	DAMAGED	450.00	380.00
1	REVERSE SENSOR (SN)	DAMAGED	220.00	200.00
			1,320.00	980.00
	<u>LABOUR</u>			
	TO PANEL BEAT ,REMOVE AND REPLACE PARTS.INCLUSIVE OF THE REPAIR OF TAILLAMP PANEL AND REAR FLOOR PANEL .		1,800.00	1,000.00
	TO SPRAY PAINT AFFECTED AREA.		1,800.00	900.00
	WIRING CHECK .		150.00	30.00
	TUFF COAT.		250.00	60.00
	REMOVE AND REFIX REVERSE SENSOR AND DISTANCE SETTING.		150.00	50.00
	REMOVE AND REFIX REVERSE CAMERA.		220.00	50.00
	TRANSFER TAILGATE MECHANISM .		120.00	80.00
	REMOVE AND REFIX TAILGATE WINDSCREEN .		150.00	120.00
	PHV .		50.00	25.00
	TO CHECK DIAGNOSTICS OF VEHICLE MANAGEMENT /CONTROL UNITS ,RESET MEMORIES TO.	NOT NECESSARY	180.00	-
			4,870.00	2,315.00
GRAND TOTAL			17,867.92	11,193.08

Report Ref No. CC6/QBE20013124/Ara3q2



RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)			8,900.00
---	--	--	-----------------

Report Ref No. CC6/QBE20013124/Ara3q2

ADRIAN LING WAI PING

B.Eng,AMSOE,AMIRTE,AMSAE-A,M.MATAI

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd


51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SMQ 6298A

INSPECTION

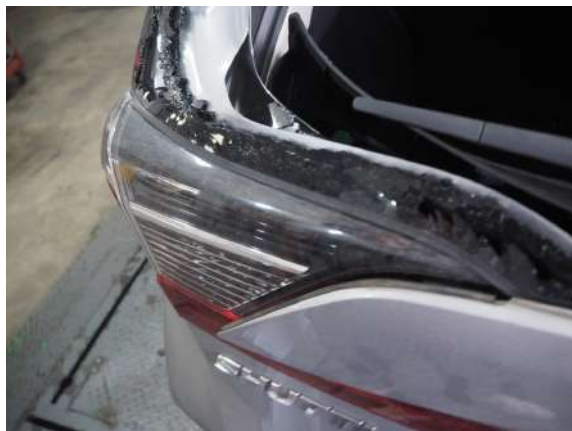



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd


51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SMQ 6298A

RE-INSPECTION

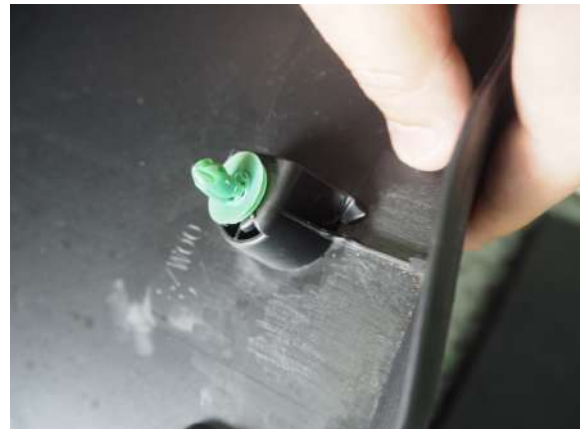



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

