



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

CHINA TAIPING INSURANCE (S) PTE LTD

INV No. AC2101886

3 ANSON ROAD #16-00
SPRINGLEAF TOWER
SINGAPORE 079909

INV Date 23/03/2021
Reference CC3/CTI20013337/Qra3q2
Code CTI

PROFESSIONAL SERVICE FEE

Vehicle No. SHB 1699Y
Insured Veh. GBB 3795K
Claim No. SNM20D204616/LKKDS
Policy No. DMCVSNA00079702000
Accident Date 26/11/2020
Inspection Date 26/11/2020

Description	Total
Third Party Express Settlement	400.00
Subtotal	400.00
GST (7%)	28.00
Grand Total	428.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
CHINA TAIPING INSURANCE (S) PTE LTD 3 ANSON ROAD #16-00 SPRINGLEAF TOWERSINGAPORE 079909			Ref: CC3/CTI20013337/Qra3q2	
			Date: 23/03/2021	
			Code: CTI	
1. Policy Particulars :- THIRD PARTY CLAIM				
	Insured Veh.	GBB 3795K	Veh. Inspected	SHB 1699Y
	Policy No.	DMCVSNA00079702000	Coverage (\$)	0.00
	Claim No.	SNM20D204616/LKKDS	Excess (\$)	0.00
	Assign From		Assign Date	26/11/2020
2. Vehicle Particulars & Condition				
	Make & Model	TOYOTA PRIUS	c.c	1798
	Engine No.	HIDDEN	Year of Reg.	2017
	Chassis No.	JTDKN36U005768781	Colour	MAROON
	Odometer	325759 KM	Steering	IN ORDER
	Brakes	IN ORDER	Modification	SPORTS RIM
	General	FAIR		
3. Conditions of Tyres				
		Size	Make	Balance
	R/H Front Tyre	195/65 R15	TOURING	6 mm
	L/H Front Tyre	195/65 R15	TOURING	6 mm
	R/H Rear Tyre	195/65 R15	TOURING	6 mm
	L/H Rear Tyre	195/65 R15	TOURING	6 mm
4. Description of Damages				
	THE VEHICLE SUSTAINED DAMAGES AT THE FRONT PORTION. DAMAGES SEE DETAILS.			
5. General Information				
	Accident Date	26/11/2020	Inspection Date	26/11/2020
	Survey held at	SMRT AUTOMOTIVE SERVICES PTE LTD 60 WOODLANDS INDUSTRIAL PARK E4 SINGAPORE 757705		
5a. Remarks				
	A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.			
5b. Estimate Days of Repair				
	ESTIMATED NORMAL PERIOD FOR REPAIR:		3 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SHB 1699Y

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	BUMPER FRT (DISC 25%)	CRUMPLED	482.00	361.50
10	BUMPER CLIPS @\$1.61 (DISC 25%)	NECESSARY	16.10	12.08
1	BUMPER SUPPORT F/LH (DISC 25%)	BROKEN	76.40	57.30
1	BUMPER ENERGY ABSORBER FRT (DISC 25%)	CRUMPLED	78.80	59.10
1	FENDER FRT/LH (DISC 25%)	DENTED	723.40	542.55
1	NAME PLATE (HYBRID) (DISC 25%)	NECESSARY	51.90	38.93
1	FENDER LINER PAD ,FR WHEEL LH (DISC 25%)	DENTED	49.30	36.98
1	FENDER LINER FRT/LH (DISC 25%)	MISSING	171.70	128.78
1	LENS & BODY ,FR TURN LH (DISC 10%)	CRUMPLED	511.80	460.62
1	HEAD LAMP LH (DISC 10%)	CRUMPLED	945.20	850.68
1	BUMPER SUPPORT F/RH	SERVICEABLE	76.40	-
1	BUMPER REINFORCEMENT FRT	SERVICEABLE	498.40	-
1	ARM SUB-ASSY ,FR BUMPER LH	SERVICEABLE	250.40	-
1	COVER ,FR BUMPER HOLE LH	SERVICEABLE	18.50	-
1	BUMPER GRILLE SUB-ASSY ,LOWER	SERVICEABLE	311.10	-
1	WIRE ENGINE ROOM NO.3	SERVICEABLE	242.00	-
1	COVER ,RADIATOR	SERVICEABLE	122.80	-
1	GRILLE ,RADIATOR	SERVICEABLE	310.60	-
1	GRILLE ,RADIATOR LOWER NO.2	SERVICEABLE	94.60	-
1	BUMPER LIP FRT	SERVICEABLE	139.60	-
1	BUMPER FRT ABSORBER LOWER	SERVICEABLE	127.70	-
1	UNDER COVER CENTER	SERVICEABLE	448.30	-
1	HOOD HINGE LH	SERVICEABLE	55.90	-
1	HOOD HINGE RH	SERVICEABLE	55.90	-
1	SUPPORT SUB-ASSY	SERVICEABLE	1,460.40	-
1	SUPPORT RADIATOR ,LH	SERVICEABLE	17.70	-
1	FENDER PROTECTOR FRT/LH UPPER	SERVICEABLE	46.10	-
1	PROTECTOR ,FRONT FENDER SIDE PANEL LH	SERVICEABLE	114.50	-
1	FENDER LINER FRT/LH	SERVICEABLE	171.70	-
1	FENDER LINER PAD ,FR WHEEL ,LH	SERVICEABLE	49.30	-
1	FENDER APRON SUB FRT/LH	SERVICEABLE	637.80	-

Report Ref No. CC3/CTI20013337/Qra3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	TYRE	SERVICEABLE	126.74	-
1	WHEEL HUB FRT	SERVICEABLE	549.70	-
1	MIRROR ASSY ,LH	SERVICEABLE	1,224.90	-
1	COVER OUTER MIRROR LH	SERVICEABLE	107.40	-
1	WHEEL DISC FRONT	TO REPAIR SEE LABOUR	1,484.20	-
1	ADVERTISEMENT STICKER (SN)	NECESSARY	148.44	148.44
			11,997.68	2,696.96
	LABOUR			
	PANEL BEATING & BODY WORK.INCLUSIVE OF THE REPAIR OF WHEEL DISC FRONT .		676.00	400.00
	SPRAY PAINT .		2,034.00	450.00
	TO DO WHEEL ALIGNMENT /TYRE BALANCING .		120.00	60.00
	TO REMOVE AND REFIT TYRE RIM (SPRAYING PURPOSE).		120.00	30.00
	TO REMOVE AND REFIX WING MIRROR .	NOT NECESSARY	120.00	-
	TO REPLACE SUNDRY PARTS.	NOT NECESSARY	100.00	-
	TO CHECK WIRING AND SYSTEM FUNCTION .		80.00	20.00
	TO WASH AND VACUUM .	NOT NECESSARY	60.00	-
			3,310.00	960.00
GRAND TOTAL			15,307.68	3,656.96
RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)				3,150.00

Report Ref No. CC3/CTI20013337/Qra3q2

OI SUN PIN

Asst. Automotive Assessor

HO LEONG CHUAN

Automotive Assessor

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd


51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SHB 1699Y

INSPECTION

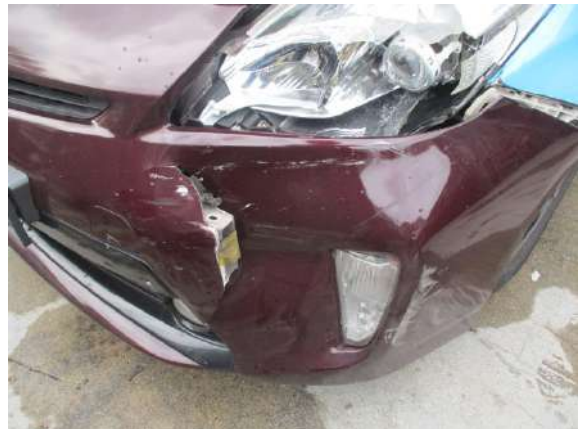



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R







LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

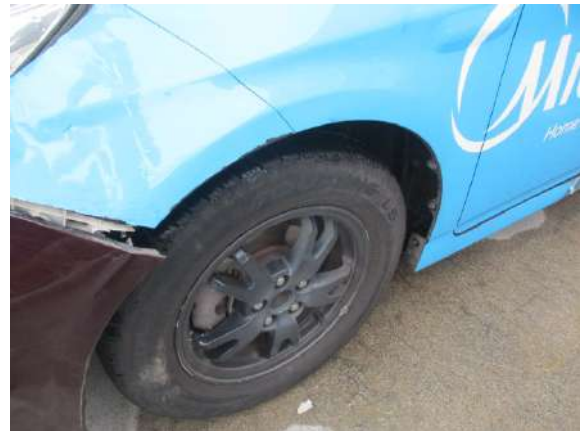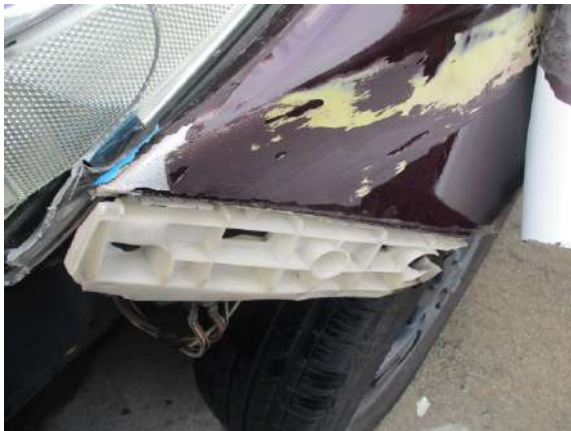



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SHB 1699Y

RE-INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

