



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

CHINA TAIPING INSURANCE (S) PTE LTD

INV No. AC2102942

3 ANSON ROAD #16-00
SPRINGLEAF TOWER
SINGAPORE 079909

INV Date 27/04/2021
Reference CC6/CTI20013345/Uea3q2
Code CTI

PROFESSIONAL SERVICE FEE

Vehicle No. SLR 7545L
Insured Veh. YQ 2484M
Claim No. SNM20D204774/C02
Policy No. DMCVSNW00087512000
Accident Date 03/12/2020
Inspection Date 04/12/2020

Description	Total
Third Party Express Settlement	400.00
Subtotal	400.00
GST (7%)	28.00
Grand Total	428.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
CHINA TAIPING INSURANCE (S) PTE LTD 3 ANSON ROAD #16-00 SPRINGLEAF TOWERS SINGAPORE 079909			Ref: CC6/CTI20013345/Uea3q2	
			Date: 27/04/2021	
			Code: CTI	
1. Policy Particulars :- THIRD PARTY CLAIM				
Insured Veh.	YQ 2484M	Veh. Inspected	SLR 7545L	
Policy No.	DMCVSNW00087512000	Coverage (\$)	0.00	
Claim No.	SNM20D204774/C02	Excess (\$)	0.00	
Assign From		Assign Date	04/12/2020	
2. Vehicle Particulars & Condition				
Make & Model	TOYOTA HARRIER (A)	c.c	1998	
Engine No.	HIDDEN	Year of Reg.	2017	
Chassis No.	JTEKB3GH30J000273	Colour	SILVER	
Odometer	96898 KM	Steering	IN ORDER	
Brakes	IN ORDER	Modification	SPORTS RIM	
General	GOOD			
3. Conditions of Tyres				
	Size	Make	Balance	
R/H Front Tyre	235/55 R18	MICHELIN	6 mm	
L/H Front Tyre	235/55 R18	MICHELIN	6 mm	
R/H Rear Tyre	235/55 R18	MICHELIN	6 mm	
L/H Rear Tyre	235/55 R18	MICHELIN	6 mm	
4. Description of Damages				
THE VEHICLE SUSTAINED DAMAGES AT THE REAR PORTION. DAMAGES SEE DETAILS.				
5. General Information				
Accident Date	03/12/2020	Inspection Date	04/12/2020	
Survey held at	FASTECH AUTO PTE LTD 1 KAKI BUKIT AVENUE 6 #01-46/48/50 AUTOBAY SINGAPORE 417883			
5a. Remarks				
A) THE INSPECTION WAS CONDUCTED ON A "WITHOUT PREJUDICE" BASIS. B) IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.				
5b. Estimate Days of Repair				
ESTIMATED NORMAL PERIOD FOR REPAIR:			5 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SLR 7545L

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	REAR WINDSCREEN	NOT NECESSARY	1,488.10	-
1	REAR WINDSCREEN MOULDING	NECESSARY	188.20	128.10
1	TAILGATE	BADLY DENTED	1,866.10	1,688.10
1	TAILGATE OUTER GARNISH	CRACKED	981.00	688.10
1	TAILGATE REAR LOGO	NECESSARY	85.00	68.10
2	TAILGATE REFLECTORS @\$785.10	N/S CRACKED	1,570.20	425.30
1	TAILGATE "HARRIER" EMBLEM	NECESSARY	105.00	69.50
1	TAILGATE INNER LOCK	SERVICEABLE	499.20	-
1	TAILGATE INNER TRIM	DEFORMED / CRACKED	699.10	533.10
1	SET TAILGATE INNER TRIM CLIPS	NECESSARY	50.00	50.00
2	TAILGATE DAMPERS @\$455.00	NOT NECESSARY	910.00	-
1	REAR BUMPER	DENTED / DEFORMED	1,245.10	955.10
2	REAR BUMPER SIDE RETAINERS @\$125.00	NOT NECESSARY	250.00	-
1	SET REAR BUMPER CLIPS	NECESSARY	50.00	50.00
2	REAR BUMPER REFLECTORS @\$145.00	NOT NECESSARY	290.00	-
1	REAR BUMPER SKIRTING	GRAZED	1,050.00	455.00
2	REAR BUMPER PDC SENSORS @\$313.00	SHORTED (1 PC ONLY)	626.00	245.00
1	REAR BUMPER PDC SENSOR WIRE	NOT NECESSARY	488.10	-
1	REAR END PANEL	DENTED	831.00	789.10
1	REAR END PANEL TOP GARNISH	SERVICEABLE	540.50	-
1	REAR FLOOR PANEL	NOT NECESSARY	1,166.00	-
1	REAR FLOOR PANEL TOP BOARD	NOT NECESSARY	988.10	-
2	REAR FENDERS @\$1245.00	NOT NECESSARY	2,490.00	-
1	REAR AIR VENT N/S	NOT NECESSARY	88.90	-
2	TAILLAMPS @\$1045.00	N/S CRACKED	2,090.00	699.50
1	REAR BUMPER SPONGE	TORN	188.50	145.00
1	TAILGATE WEATHERSTRIP	TWISTED	412.10	381.10
	LESS 25% DISCOUNT		-	-1,842.53
			21,236.20	5,527.57

Report Ref No. CC6/CTI20013345/Uea3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>SPECIAL NETT ITEMS</u>			
1	REAR WINDSCREEN SEALANT (SN)	NECESSARY	50.00	40.00
1	REAR END PANEL SEALANT (SN)	NECESSARY	50.00	50.00
1	SET REAR REVERSE CAMERA (SN)	SERVICEABLE	450.00	-
1	SET REAR FLOOR PANEL INSULATOR (SN)	NOT NECESSARY	200.00	-
			750.00	90.00
	<u>LABOUR</u>			
	TO CHECK WIRING.		50.00	30.00
	TO DISMANTLE & REPLACING REAR PDC SENSOR.		80.00	50.00
	TO DISMANTLE & REFIX REAR WINDSCREEN.		150.00	120.00
	TO DISMANTLE & REFIX CUSHION UPHOLSTERY.		120.00	80.00
	TO DISMANTLE & REFIX REAR EXHAUST.	NOT NECESSARY	100.00	-
	TO TRANSFER TAILGATE COMPONENTS.		120.00	60.00
	TO SPRAY RUST PROOFING.		150.00	60.00
	TO MOUNT VEHICLE ON CAR O-LINER.	NOT NECESSARY	380.00	-
	LABOUR FOR PANEL BEATING & REPLACING PARTS.		1,800.00	600.00
	TO PUTTY & SPRAY PAINTING.		1,500.00	900.00
			4,450.00	1,900.00
GRAND TOTAL			26,436.20	7,517.57
RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)				6,000.00

Report Ref No. CC6/CTI20013345/Uea3q2

CHUA KANG SENG

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SLR 7545L

INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SLR 7545L

RE-INSPECTION






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

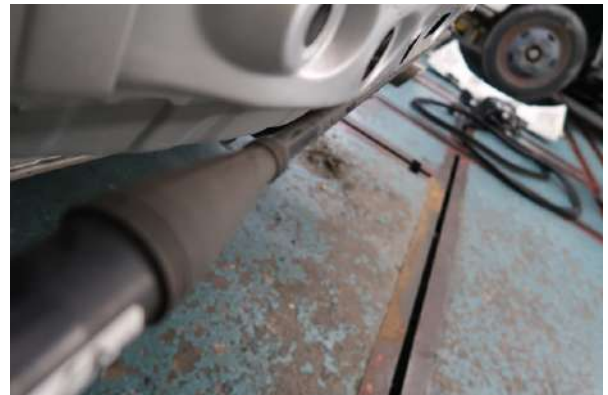



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

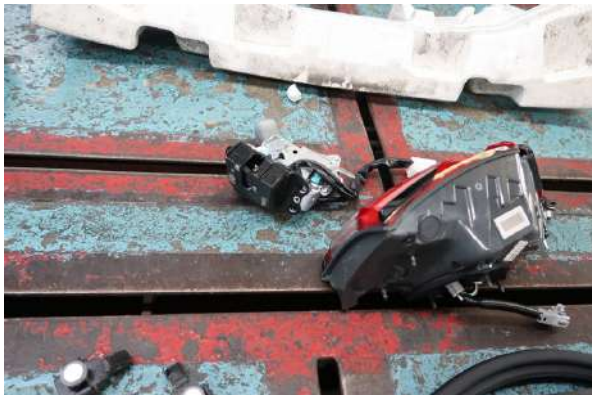




LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

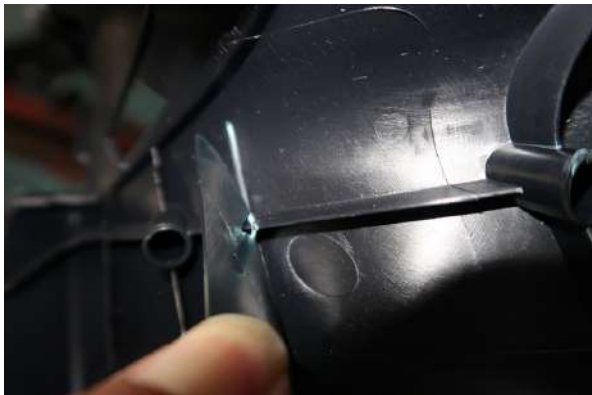



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SLR 7545L

RE-INSPECTION

