



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

CHINA TAIPING INSURANCE (S) PTE LTD

INV No. AC2106742

3 ANSON ROAD #16-00
SPRINGLEAF TOWER
SINGAPORE 079909

INV Date 29/09/2021
Reference CC3/CTI20013565/Gra3q2
Code CTI

PROFESSIONAL SERVICE FEE

Vehicle No. SHB 5218B
Insured Veh. YN 7681T
Claim No. SNM20D204725/LKKDS
Policy No. DMCVSNW00023732003
Accident Date 04/12/2020
Inspection Date 07/12/2020

Description	Total
Third Party Express Settlement	400.00
Subtotal	400.00
GST (7%)	28.00
Grand Total	428.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
CHINA TAIPING INSURANCE (S) PTE LTD 3 ANSON ROAD #16-00 SPRINGLEAF TOWERSINGAPORE 079909			Ref: CC3/CTI20013565/Gra3q2 Date: 29/09/2021 Code: CTI	
1. Policy Particulars :- THIRD PARTY CLAIM				
	Insured Veh.	YN 7681T	Veh. Inspected	SHB 5218B
	Policy No.	DMCVSNW00023732003	Coverage (\$)	0.00
	Claim No.	SNM20D204725/LKKDS	Excess (\$)	0.00
	Assign From		Assign Date	07/12/2020
2. Vehicle Particulars & Condition				
	Make & Model	TOYOTA PRIUS	c.c	1798
	Engine No.	HIDDEN	Year of Reg.	2019
	Chassis No.	JTDKB3FU803090754	Colour	MAROON
	Odometer	71082 KM	Steering	IN ORDER
	Brakes	IN ORDER	Modification	STANDARD ALLOY RIM
	General	GOOD		
3. Conditions of Tyres				
		Size	Make	Balance
	R/H Front Tyre	195/65 R15	SAILUN	6 mm
	L/H Front Tyre	195/65 R15	SAILUN	6 mm
	R/H Rear Tyre	195/65 R15	SAILUN	6 mm
	L/H Rear Tyre	195/65 R15	SAILUN	6 mm
4. Description of Damages				
	THE VEHICLE SUSTAINED DAMAGES AT THE REAR PORTION. DAMAGES SEE DETAILS.			
5. General Information				
	Accident Date	04/12/2020	Inspection Date	07/12/2020
	Survey held at	SMRT AUTOMOTIVE SERVICES PTE LTD		
	Repairer	STRIDES AUTOMOTIVE SERVICES PL.		
5a. Remarks				
	A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.			
5b. Estimate Days of Repair				
	ESTIMATED NORMAL PERIOD FOR REPAIR:		3 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SHB 5218B

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	COVER ,RR BUMPER ASSY (DISC 25%)	DEFORMED	485.60	364.20
2	PAD ,RR BUMPER ,RH & LH,1 @\$4.00 (DISC 25%)	NECESSARY	8.00	6.00
2	PAD ,RR BUMPER ,RH & LH,2 @\$4.00 (DISC 25%)	NECESSARY	8.00	6.00
2	PAD ,RR BUMPER ,RH & LH,3 @\$11.00 (DISC 25%)	NECESSARY	22.00	16.50
2	PAD ,RR BUMPER ARM,RH & LH @\$11.30 (DISC 25%)	NECESSARY	22.60	16.95
10	CLIPS PIECE,FRT & RR BUMPER @\$4.50 (DISC 25%)	NECESSARY	45.00	33.75
1	GUARD ,RR BUMPER ,LOWER (DISC 25%)	CUT	374.50	280.88
3	PAD ,RR BUMPER ,CTR @\$11.00 (DISC 25%)	NECESSARY	33.00	24.75
1	EMBLEM SUB-ASSY REAR (DISC 25%)	NECESSARY	47.90	35.92
1	NAME PLATE (HYBRID) LUGGAGE COMPARTMENT (DISC 25%)	NECESSARY	54.60	40.95
1	NAME PLATE (PRIUS) LUGGAGE COMPARTMENT (DISC 25%)	NECESSARY	54.60	40.95
1	TAIL GATE BACK DOOR OUTSIDE GARNISH SUB (DISC 25%)	NECESSARY	913.60	685.20
2	PIXEL STICKER @\$60.00 (SN)	NECESSARY	120.00	120.00
1	SMRT LOGO (SN)	NECESSARY	7.80	7.80
1	STICKER DECAL 6555 8888 (SN)	NECESSARY	21.60	21.60
1	REVERSE SENSOR ,REAR BUMPER (SN)	NECESSARY	180.00	180.00
2	STOPPER ,RR BUMPER ,RH & LH	NOT NECESSARY	4.50	-
1	RETAINER ,RR BUMPER ,LH	NOT NECESSARY	132.60	-
1	SEAL ,RR BUMPER ,LH	NOT NECESSARY	118.30	-
1	REAR BUMPER REINFORCEMENT	NOT NECESSARY	332.70	-
1	TAIL GATE PANEL SUB-ASSY ,BACK DOOR	NOT NECESSARY	1,147.80	-
1	AUTO TAILGATE SYSTEM	NOT NECESSARY	2,520.00	-
1	TAIL GATE BACK DOOR HINGE ASSY ,LH	NOT NECESSARY	61.00	-
1	TAIL GATE BACK DOOR HINGE ASSY ,RH	NOT NECESSARY	61.00	-
1	TAIL GATE LOCK ASSY ,BACK DOOR	NOT NECESSARY	467.00	-
1	TAIL GATE LOCK COVER BACK DOOR	NOT NECESSARY	30.20	-
1	TAIL GATE STRIKER ASSY ,BACK DOOR	NOT NECESSARY	25.80	-
1	REAR BUMPER REFLECTOR ASSY ,REFLEX ,LH	NOT NECESSARY	39.00	-
1	REVERSE SENSOR ,REAR BUMPER	NOT NECESSARY	180.00	-

Report Ref No. CC3/CTI20013565/Gra3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	LENS & BODY ,REAR COMBINATION LAMP LH	NOT NECESSARY	339.60	-
1	COVER ,REAR COMBINATION LAMP ,LH	NOT NECESSARY	69.90	-
1	LENS & BODY ,REAR COMBINATION LAMP ,NO.2	NOT NECESSARY	261.00	-
1	LAMP ASSY ,REAR LH	NOT NECESSARY	293.60	-
1	PANEL SUB-ASSY ,FENDER REAR LH	NOT NECESSARY	871.50	-
1	TROUGH BACK DOOR ,LH	NOT NECESSARY	103.40	-
1	TAIL GATE BACK DOOR OUTSIDE GARNISH SUB	TO REPAIR SEE LABOUR	913.60	-
1	SPOILER SUB-ASSY ,REAR	TO REPAIR SEE LABOUR	1,575.40	-
			11,946.70	1,881.45
	LABOUR			
	PANEL BEATING & BODY WORK .INCLUSIVE OF THE REPAIR OF TAIL GATE BACK DOOR OUTSIDE GARNISH SUB AND SPOILER SUB-ASSY ,REAR .		854.00	300.00
	SPRAY PAINT.		1,854.00	380.00
	TO CHECK WIRING AND SYSTEM FUNCTION .		80.00	30.00
	TO INSPECT RR LIGHTING ,MECHANISMS & WATER TEST RR LIGHTING FOR LEAKAGE.	NOT NECESSARY	120.00	-
	TO REMOVE AND INSTALL LUGGAGE COMPARTMENT TRIM TO FACILITATE REPAIR .	NOT NECESSARY	120.00	-
	TO APPLY RUST-PROOFING ON AFFECTED AREA.	NOT NECESSARY	100.00	-
	TO WASH AND VACUUM .	NOT NECESSARY	80.00	-
	TO REPLACE SUNDRY PARTS.	NOT NECESSARY	100.00	-
			3,308.00	710.00
GRAND TOTAL			15,254.70	2,591.45
RECOMMENDED COST OF REPAIRS				2,591.45

Report Ref No. CC3/CTI20013565/Gra3q2

XING GUO QIANG

M.MATAI, AMSAE-A

Automotive Assessor

HO LEONG CHUAN

Automotive Assessor

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or replying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd


51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SHB 5218B

INSPECTION

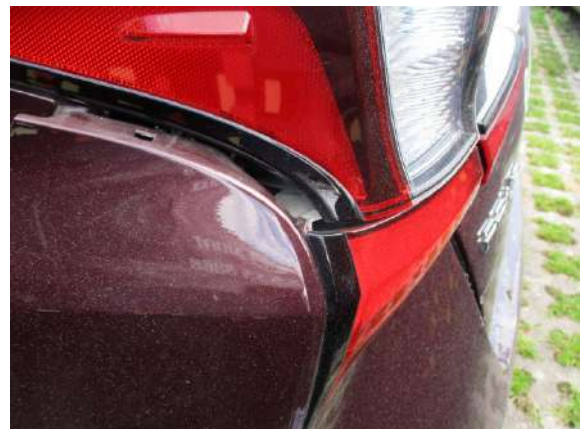



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SHB 5218B

RE-INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SHB 5218B

RE-INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SHB 5218B

RE-INSPECTION

