



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

MS FIRST CAPITAL INSURANCE LTD

INV No. AC2107867

36 ROBINSON ROAD
#16-01 CITY HOUSE
SINGAPORE 068877

INV Date 16/11/2021
Reference CC4/FCI20013851/Aes3q2
Code FCI2

PROFESSIONAL SERVICE FEE

Vehicle No. SLU 5066A
Insured Veh. SHA 7798K
Claim No. D20005095MFSH
Policy No. D-20094922MFSH
Accident Date 11/12/2020
Inspection Date 15/12/2020

Description	Total
Third Party Express Settlement	600.00
Subtotal	600.00
GST (7%)	42.00
Grand Total	642.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
MS FIRST CAPITAL INSURANCE LTD 36 ROBINSON ROAD #16-01 CITY HOUSESINGAPORE 068877			Ref: CC4/FCI20013851/Aes3q2	
			Date: 16/11/2021	
			Code: FCI2	
1. Policy Particulars :- THIRD PARTY CLAIM				
Insured Veh.	SHA 7798K	Veh. Inspected	SLU 5066A	
Policy No.	D-20094922MFSH	Coverage (\$)	0.00	
Claim No.	D20005095MFSH	Excess (\$)	0.00	
Assign From	VIC	Assign Date	15/12/2020	
2. Vehicle Particulars & Condition				
Make & Model	TOYOTA PRIUS ALPHA HYBRID	c.c	1797	
Engine No.	HIDDEN	Year of Reg.	2017	
Chassis No.	ZVW400027234	Colour	SILVER	
Odometer	211022 KM	Steering	IN ORDER	
Brakes	IN ORDER	Modification	STANDARD ALLOY RIM	
General	GOOD			
3. Conditions of Tyres				
	Size	Make	Balance	
R/H Front Tyre	205/60 R16	HABILEAD	6 mm	
L/H Front Tyre	205/60 R16	HABILEAD	6 mm	
R/H Rear Tyre	205/60 R16	HABILEAD	6 mm	
L/H Rear Tyre	205/60 R16	HABILEAD	6 mm	
4. Description of Damages				
THE VEHICLE SUSTAINED DAMAGES AT THE FRONT N/S PORTION. DAMAGES SEE DETAILS.				
5. General Information				
Accident Date	11/12/2020	Inspection Date	15/12/2020	
Survey held at	N-51 AUTOMOTIVE PL 2 KAKI BUKIT AVE 2 #01-17 KAKI BUKIT AUTOHUB SINGAPORE 417921			
5a. Remarks				
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.				
5b. Estimate Days of Repair				
ESTIMATED NORMAL PERIOD FOR REPAIR:			5 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 3

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SLU 5066A

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	FRONT BUMPER	DISTORTED	781.10	781.10
1	FRONT BUMPER AIR GARNISH LH	CRACKED	98.70	98.70
1	FRONT BUMPER DAY LAMP LH	CRACKED	972.85	766.00
1	FRONT BUMPER LH FOGLAMP	CRACKED	591.60	296.00
1	FRONT BUMPER LOWER GRILLE	DISTORTED	563.30	563.30
1	FRONT BUMPER REINFORCEMENT	BENT	681.90	681.90
1	FRONT BUMPER SIDE BRACKET LH	CRACKED	171.10	171.10
2	FRONT BUMPER SIDE RETAINER L/R @\$132.25	N/S CRACKED	264.50	132.25
1	FRONT BUMPER SPONGE	CRACKED	174.45	174.45
1	FRONT BUMPER TOP RUBBER SEAL	NOT NECESSARY	174.45	-
2	FRONT BUMPER TOW HOOK COVER L/R @\$121.45	N/S DEFORMED	242.90	121.45
1	FRONT BUMPER UNDER COVER	TORN	139.50	139.50
1	FRONT GRILLE	CRACKED	395.00	395.00
1	FRONT GRILLE 'LOGO' EMBLEM	NECESSARY	108.00	108.00
1	FRONT GRILLE TOP GARNISH	NOT NECESSARY	169.00	-
1	FRONT HEADLAMP L/R @\$2721.10	N/S CRACKED	5,442.20	2,721.10
2	FRONT HEADLAMP LOWER BRACKET L/R @\$55.00	NOT NECESSARY	110.00	-
1	FRONT LH FENDER	DISTORTED	731.35	731.35
1	FRONT LH FENDER 'HYBRID' EMBLEM	NECESSARY	123.05	123.05
1	FRONT LH FENDER INNER BRACKET	BENT	26.00	26.00
1	FRONT LH FENDER INNER PANEL	TO REPAIR SEE LABOUR	268.00	-
1	FRONT LH FENDER INNER SHIELD (VERTICAL)	TORN	259.45	259.45
1	FRONT LH KNUCKLE ARM	DAMAGED	485.00	485.00
1	FRONT LH KNUCKLE ARM BEARING	NECESSARY	502.00	502.00
1	FRONT LH LOWER ARM	BENT	435.00	435.00
1	FRONT LH SHOCK ABSORBER	NOT NECESSARY	375.00	-
1	FRONT LH SHOCK ABSORBER TOP MOUNTING	NOT NECESSARY	151.00	-
1	FRONT LH STABILIZER LINK	NOT NECESSARY	117.00	-
1	FRONT LH TIE ROD END	NOT NECESSARY	93.00	-
1	FRONT LH WHEEL HUB CAP	NOT NECESSARY	114.00	-

Report Ref No. CC4/FCI20013851/Aes3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	FRONT SUPPORT PANEL	TO REPAIR SEE LABOUR	972.75	-
	LESS 25% DISCOUNT		-3,933.29	-2,427.93
			11,799.86	7,283.77
1	FRONT LH SPORT RIM (SN)	CUT	1,555.00	750.00
	LESS 25% DISCOUNT		-388.75	-
			1,166.25	750.00
	<u>SPECIAL NETT ITEMS</u>			
1	SET FRONT BUMPER CLIPS (SN)	NECESSARY	50.00	30.00
1	SET FRONT GRILLE CLIPS (SN)	NECESSARY	30.00	30.00
1	SET FRONT LH FENDER INNER SHIELD CLIPS (SN)	NECESSARY	50.00	30.00
1	RADIATOR COOLANT (SN)	NOT NECESSARY	80.00	-
			210.00	90.00
	<u>LABOUR</u>			
	TO REMOVE ,REINSTALL AIR CON PARTS ,VACUUMS ,REFILL AIR CON GAS .(TO FR).	NOT NECESSARY	120.00	-
	TO REMOVE,REINSTALL ELECTRICAL WIRING HARNESS ,CHECK LIGHTING AND RESETTINGS HEADLAMP FOCUSING (TO FR).		80.00	30.00
	TO REMOVE ,CHARGE FRONT SUSPENSION PARTS ,ABSORBER ,LOWER ARM ,KNUCKLE ARM WHEEL BEARING ,BEARING HUB ,DRIVE SHAFT ,ANTI-ROLL BAR ,TOP-ARM AND STEERING RACK AND PINION .		280.00	180.00
	TO ROAD TEST DRIVING ,CHECK AND RESETTNG WHEEL ALIGNMENT SYSTEM.		100.00	80.00
	TO RE-SPRAY PAINTING ON THE CHARGE BODYPARTS ,REPAIR PORTION ,AND WHERE CONSISTENT TO THE ACCIDENT .		1,400.00	800.00
	TO PROVIDE LABOUR ,WORKMANSHIP TO CHARGE THE ABOVE DAMAGED BODYPARTS,REPAIR ,RECONSTRUCT AND REALIGN BODY STRUCTURE BODY ALIGNMENTS AND DAMAGED CONSISTENT TO THE ACCIDENT ,INCLUSIVE OF THE REPAIR OF FRONT LH FENDER INNER PANEL AND FRONT SUPPORT PANEL .		1,000.00	600.00



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:3 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	TO APPLY ANTI-RUST CHEMICAL ON REPAIRED AND REPLACED PANEL.		80.00	40.00
			3,060.00	1,730.00
GRAND TOTAL			16,236.11	9,853.77
RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)				7,800.00

Report Ref No. CC4/FCI20013851/Aes3q2

ADRIAN LING WAI PING

B.Eng,AMSOE,AMIRTE,AMSAE-A,M.MATAI

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SLU 5066A

INSPECTION






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

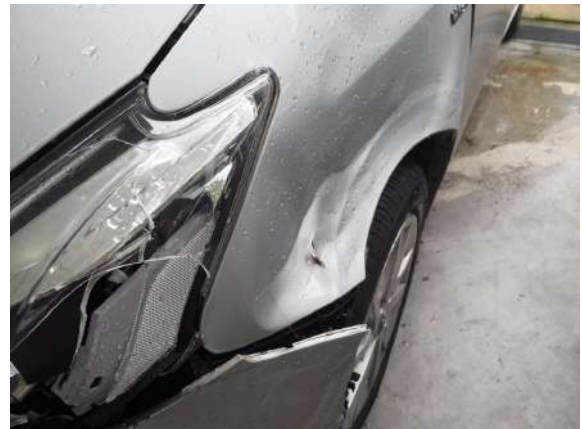




LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

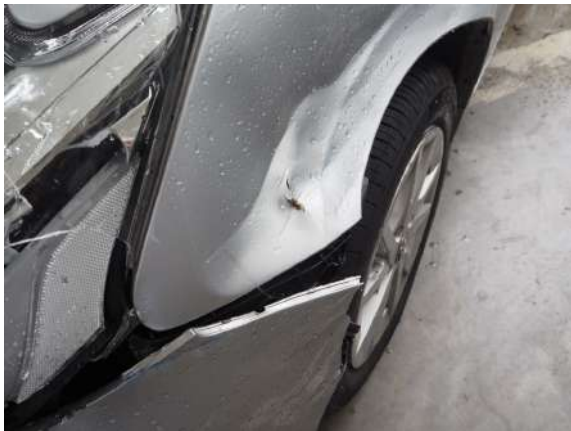



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

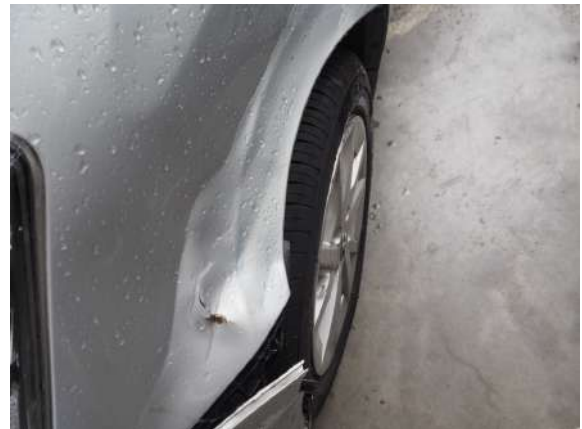



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SLU 5066A

RE-INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SLU 5066A

RE-INSPECTION

