



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

LONPAC INSURANCE BHD

INV No. AC2104949

300 BEACH ROAD
#17-04/07 THE CONCOURSE
SINGAPORE 199555

INV Date 13/07/2021
Reference CC4/LPC20014109/R1pa3q2
Code LPC2

PROFESSIONAL SERVICE FEE

Vehicle No. SJY 5575A
Insured Veh. SLW 2745H
Claim No. 20/20/20/VC05/024015
Policy No. Z20VP05025865
Accident Date 16/12/2020
Inspection Date 21/12/2020

Description	Total
Third Party Express Settlement	400.00
Subtotal	400.00
GST (7%)	28.00
Grand Total	428.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
LONPAC INSURANCE BHD 300 BEACH ROAD #17-04/07 THE CONCOURSESINGAPORE 199555			Ref: CC4/LPC20014109/R1pa3q2	
			Date: 13/07/2021	
			Code: LPC2	
1. Policy Particulars :- THIRD PARTY CLAIM				
Insured Veh.	SLW 2745H	Veh. Inspected	SJY 5575A	
Policy No.	Z20VP05025865	Coverage (\$)	0.00	
Claim No.	20/20/20/VC05/024015	Excess (\$)	0.00	
Assign From	ONG LI LI	Assign Date	18/12/2020	
2. Vehicle Particulars & Condition				
Make & Model	B.M.W. X1 SDRIVE18I LEDN	c.c	1499	
Engine No.	HIDDEN	Year of Reg.	2019	
Chassis No.	WBAJG12040EN49204	Colour	BLACK	
Odometer	67903 KM	Steering	IN ORDER	
Brakes	IN ORDER	Modification	SPORTS RIM	
General	FAIR			
3. Conditions of Tyres				
	Size	Make	Balance	
R/H Front Tyre	235/45 R19	GOODYEAR	6 mm	
L/H Front Tyre	235/45 R19	GOODYEAR	6 mm	
R/H Rear Tyre	235/45 R19	GOODYEAR	6 mm	
L/H Rear Tyre	235/45 R19	GOODYEAR	6 mm	
4. Description of Damages				
THE VEHICLE SUSTAINED DAMAGES AT THE REAR N/S PORTION. DAMAGES SEE DETAILS.				
5. General Information				
Accident Date	16/12/2020	Inspection Date	21/12/2020	
Survey held at	PERFORMANCE MOTORS LTD 303 ALEXANDRA ROAD SINGAPORE 159941			
5a. Remarks				
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.				
5b. Estimate Days of Repair				
ESTIMATED NORMAL PERIOD FOR REPAIR:			5 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 3

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SJY 5575A

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	FRONT OR REAR WINDSCREEN SOLAR FILM (SN)	NOT NECESSARY	531.00	-
1	SUNDRIES (SN)	NECESSARY	150.00	150.00
2	SCREW SELF TAPPING (SN)	NOT NECESSARY	2.40	-
1	SILENCER CLAMPING BUSH (SN)	NECESSARY	54.60	54.60
1	REAR SILENCER (SN)	BENT	1,184.25	1,184.25
1	TAILPIPE TRIM BLACK CHROME (SN)	SCRATCHED	113.85	113.85
1	BOOTLID (SN)	TO REPAIR SEE LABOUR	1,236.65	-
1	REAR LH BUMPER MOUNT (SN)	SERVICEABLE	161.40	-
1	REAR RH BUMPER MOUNT (SN)	SERVICEABLE	161.40	-
1	RR BUMPER CARRIER (SN)	SERVICEABLE	496.35	-
1	REAR BUMPER TRIM PANEL BOTTOM (BASI) (SN)	DEFORMED	206.85	206.85
1	MOUNTING SMART OPENER (SN)	NECESSARY	45.75	45.75
1	RR BUMPER LH CORNER MOUNTING (SN)	CRACKED	143.35	143.35
1	RR BUMPER RH CORNER MOUNTING (SN)	SERVICEABLE	142.65	-
1	REAR BUMPER PANEL PRIMED (SN)	DEFORMED	907.90	907.90
2	EMBLEM GROMMET (SN)	NOT NECESSARY	1.70	-
1	BMW PLAQUE WITH ADHESIVE FILM (SN)	NOT NECESSARY	71.60	-
1	LETTERING S DRIVE 18I (SN)	NOT NECESSARY	96.65	-
1	LETTERING X1 (SN)	NOT NECESSARY	64.45	-
10	BUMP STOP (SN)	NOT NECESSARY	32.00	-
1	REAR WINDOW (ESG) (SN)	NOT NECESSARY	851.00	-
10	HOOK AND LOOP FASTENER (SN)	NOT NECESSARY	28.50	-
1	REAR BUMPER HEAT INSULATION (SN)	BENT	69.85	69.85
1	SENSOR WIRE FOR SMART OPENER TOP (SN)	NOT NECESSARY	46.30	-
1	SENSOR WIRE FOR SMART OPENER BOTTOM (SN)	NOT NECESSARY	50.90	-
1	CONTROL UNIT SMART OPENER (SN)	NOT NECESSARY	497.05	-
4	DECOUPING RING PDC TORQUE CONVERTER (SN)	NOT NECESSARY	20.40	-
1	(DG) CLEANER R1 (100 ML) (SN)	NOT NECESSARY	26.15	-
2	(DG/SL) W/SCREEN SEALANT (COLD 1 HOUR) (SN)	NOT NECESSARY	263.10	-
1	(DG/SL) ADHESIVE PRIMER VP 206 (30 ML) (SN)	NOT NECESSARY	27.85	-

Report Ref No. CC4/LPC20014109/R1pa3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	SILENCER CLAMPING BUSH (SN) (ADDITIONAL)	REPEATED	54.60	-
1	GASKET RING (SN) (ADDITIONAL)	NECESSARY	30.60	30.60
1	V BAND CLAMP (SN) (ADDITIONAL)	NECESSARY	43.25	43.25
1	HOLDER EXHAUST SYSTEM (SN) (ADDITIONAL)	NECESSARY	28.75	28.75
1	FRONT SILENCER (SN) (ADDITIONAL)	BENT	1,025.85	1,025.85
1	EXCH CATALYTIC CONVERTER CLOSE TO EN (SN) (ADDITIONAL)	BENT	2,118.50	2,118.50
1	STEERING BOX HEAT RESISTANT PLATE (SN) (ADDITIONAL)	BENT	61.55	61.55
1	REAR BUMPER MIDDLE TRIM PANEL (PDC) (SN) (ADDITIONAL)	DEFORMED	266.95	266.95
20	EXPANDING RIVET BLACK (SN) (ADDITIONAL)	NECESSARY	28.00	28.00
6	PLUG BLACK D=5MM (SN) (ADDITIONAL)	NECESSARY	5.70	5.70
			11,349.65	6,485.55
	LABOUR			
	TO REPLACE FRONT EXHAUST SILENCER INCLUDE ALIGNMENT AND CHECK LEAK .(ADDITIONAL)		451.00	451.00
	TO REPLACE EXHAUST CAT CONVERTOR INCLUDE ALIGNMENT AND CHECK LEAK.(ADDITIONAL)		451.00	451.00
	GRAPHEVE COATING PACKAGES.(ADDITIONAL)		400.00	400.00
	TO REPLACE REAR BUMPER PANEL AND ATTACHMENTS ,BOOTLID .INCLUSIVE OF THE REPAIR OF BOOTLID.		2,550.00	2,550.00
	TO REPLACE REAR BUMPER AND BOOTLID .		2,076.00	2,500.00
	TO REPLACE REAR WINDSCREEN GLASS .	NOT NECESSARY	676.00	-
	TO CONDUCT WATER LEAK TESTS.	NOT NECESSARY	75.00	-
	TO REPLACE REAR EXHAUST SILENCER INCLUDING ALIGNMENT SYSTEM AND CONDUCT CHECK FOR LEAK.		531.00	451.00
	TO CHECK ELECTRICAL WIRING SYSTEM AND LIGHTING AT THE REAR SECTION FOR PROPER FUNCTION .		177.00	150.00
	TO REPLACE BOOTLID SMART OPENER CONTROL UNIT ,TOP AND BOTTOM SENSOR LINE INCLUDING PROGRAM AND CONDUCT CHECK FOR PROPER FUNCTION .		661.00	561.00
	TO CARRY OUT BODY CAVITY PRESERVATION .(PER PANEL).		118.00	100.00
			8,166.00	7,614.00
	GRAND TOTAL		19,515.65	14,099.55

Report Ref No. CC4/LPC20014109/R1pa3q2



RECOMMENDED COST OF REPAIRS			14,099.55
-----------------------------	--	--	------------------

Report Ref No. CC4/LPC20014109/R1pa3q2

MOHAMMED RASUL BIN MOHD YUNUS

Automotive Assessor

HO LEONG CHUAN

Automotive Assessor

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SJY 5575A

INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd


51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SJY 5575A

RE-INSPECTION

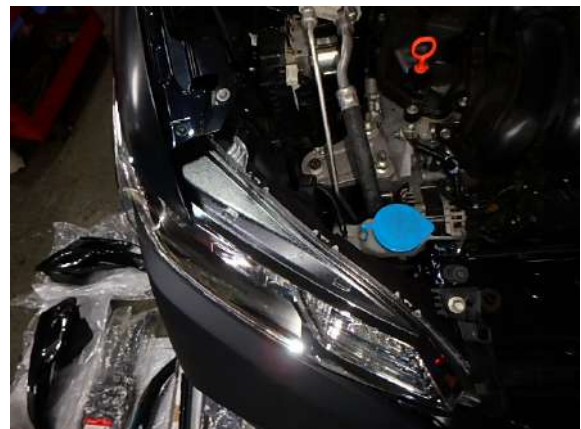



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

