



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

MS FIRST CAPITAL INSURANCE LTD

INV No. AC2102452

36 ROBINSON ROAD
#16-01 CITY HOUSE
SINGAPORE 068877

INV Date 12/04/2021
Reference CC3/FCI20014461/Kea3q2
Code FCI2

PROFESSIONAL SERVICE FEE

Vehicle No. SHD 9035A
Insured Veh. SHC 7809C
Claim No. D20005252MFSH
Policy No. D-18088937MFSH
Accident Date 21/12/2020
Inspection Date 22/12/2020

Description	Total
Third Party Express Settlement	600.00
Subtotal	600.00
GST (7%)	42.00
Grand Total	642.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
MS FIRST CAPITAL INSURANCE LTD 36 ROBINSON ROAD #16-01 CITY HOUSESINGAPORE 068877			Ref: CC3/FCI20014461/Kea3q2	
			Date: 12/04/2021	
			Code: FCI2	
1. Policy Particulars :- THIRD PARTY CLAIM				
Insured Veh.	SHC 7809C	Veh. Inspected	SHD 9035A	
Policy No.	D-18088937MFSH	Coverage (\$)	0.00	
Claim No.	D20005252MFSH	Excess (\$)	0.00	
Assign From	ERIC	Assign Date	22/12/2020	
2. Vehicle Particulars & Condition				
Make & Model	TOYOTA PRIUS (A)	c.c	1798	
Engine No.	HIDDEN	Year of Reg.	2018	
Chassis No.	JTDKB3FU803078670	Colour	M . P. WHITE / RED	
Odometer	189544 KM	Steering	IN ORDER	
Brakes	IN ORDER	Modification	STANDARD ALLOY RIM	
General	GOOD			
3. Conditions of Tyres				
	Size	Make	Balance	
R/H Front Tyre	195/65 R15	SAILUN	7 mm	
L/H Front Tyre	195/65 R15	SAILUN	7 mm	
R/H Rear Tyre	195/65 R15	SAILUN	8 mm	
L/H Rear Tyre	195/65 R15	SAILUN	8 mm	
4. Description of Damages				
THE VEHICLE SUSTAINED DAMAGES AT THE O/S FRONT PORTION. DAMAGES SEE DETAILS.				
5. General Information				
Accident Date	21/12/2020	Inspection Date	22/12/2020	
Survey held at	TRANS-CAB AUTO SERVICES PTE LTD NO.2 ANG MO KIO ST 63 SINGAPORE 569111			
5a. Remarks				
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.				
5b. Estimate Days of Repair				
ESTIMATED NORMAL PERIOD FOR REPAIR:			2 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 3

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SHD 9035A

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	FENDER SUB-ASSY ,FRONT RH	BENT	977.80	977.80
1	FRONT FENDER EMBLEM RH	NECESSARY	54.60	54.60
1	LINER ,FRONT FENDER RH	DISTORTED	202.50	202.50
1	MOULDING ASSY ,BODY ROCKER PANEL LH	TO REPAIR SEE LABOUR	594.80	-
1	PANEL SUB-ASSY ,FRONT DOOR ,LH	TO REPAIR SEE LABOUR	1,300.70	-
1	WEATHERSTRIP ,FRONT DOOR ,LH	SERVICEABLE	231.30	-
1	HINGE ASSY ,FRONT DOOR ,LOWER LH	TO REPAIR SEE LABOUR	110.60	-
1	HINGE ASSY ,FRONT DOOR ,UPPER LH	TO REPAIR SEE LABOUR	97.50	-
1	TAPE, BLACK OUT ,NO.1 FRT LH	NOT NECESSARY	13.30	-
1	TAPE, BLACK OUT ,NO.2 FRT LH	NOT NECESSARY	43.50	-
1	TAPE, BLACK OUT ,NO.3 FRT LH	NOT NECESSARY	26.30	-
1	MOTOR ASSY ,POWER WINDOW REGULATOR ,FRT LH	SERVICEABLE	926.00	-
1	REGULATOR SUB-ASSY ,FRONT DOOR WINDOW ,LH	SERVICEABLE	238.30	-
1	PANEL SUB-ASSY ,REAR DOOR ,LH	TO REPAIR SEE LABOUR	1,294.90	-
1	WEATHERSTRIP ,REAR DOOR OPENING TRIM ,LH	SERVICEABLE	293.00	-
1	HINGE ASSY ,REAR DOOR LOWER LH	TO REPAIR SEE LABOUR	87.10	-
1	HINGE ASSY ,REAR DOOR UPPER LH	TO REPAIR SEE LABOUR	98.90	-
1	TAPE ,BLACK OUT,NO.1 REAR LH	NOT NECESSARY	21.90	-
1	TAPE ,BLACK OUT,NO.2 REAR LH	NOT NECESSARY	34.90	-
1	TAPE ,BLACK OUT,NO.3 REAR LH	NOT NECESSARY	15.40	-
1	MOTOR ASSY ,POWER WINDOW REGULATOR ,REAR LH	SERVICEABLE	926.00	-
1	REGULATOR SUB-ASSY ,REAR DOOR WINDOW ,LH	SERVICEABLE	206.70	-
1	MOULDING ASSY ,BODY ROCKER PANEL ,LH	SERVICEABLE	594.80	-
1	REINFORCE SUB-ASSY ,ROCKER ,OUTER LH	TO REPAIR SEE LABOUR	583.40	-
1	REINFORCEMENT SUB-ASSY ,ROCKER PANEL ,LH	TO REPAIR SEE LABOUR	343.40	-

Report Ref No. CC3/FCI20014461/Kea3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	PANEL SUB-ASSY ,QUARTER ,LH	TO REPAIR SEE LABOUR	871.50	-
1	COVER ,REAR BUMPER	SERVICEABLE	442.60	-
1	FILLER ,REAR BUMPER EXTENSION ,LH	SERVICEABLE	123.70	-
1	MIRROR ASSY ,OUTER REAR VIEW ,LH	SERVICEABLE	1,339.30	-
	LESS 25% DISCOUNT		-3,023.68	-308.72
			9,071.02	926.18
	<u>SPECIAL NETT ITEMS</u>			
1	FRT BUMPER CLIP (SN)	NECESSARY	65.00	60.00
1	REAR BUMPER CLIP (SN)	NOT NECESSARY	65.00	-
1	SET DOOR WEATHERSTRIP CLIP (SN)	NOT NECESSARY	65.00	-
1	FRT TYRE (SN)	SERVICEABLE	350.00	-
1	REAR TYRE (SN)	SERVICEABLE	350.00	-
1	FRT RIM (SN)	DENTED	1,879.40	1,879.40
1	REAR RIM (SN)	SERVICEABLE	1,879.40	-
1	FRT DOOR STICKER 'TRANSCAB' (SN)	NOT NECESSARY	100.00	-
1	REAR DOOR STICKER '65553333' (SN)	NOT NECESSARY	100.00	-
1	SET CLIP ,ROCKER PANEL MOULDING (SN)	NOT NECESSARY	65.00	-
			4,918.80	1,939.40
	<u>LABOUR</u>			
	TO REMOVE AND REFIT INTERIOR FITTINGS,TRIMINGS,GARNISH,FITTINGS AND OTHER ,TO ENABLE REPAIR.	NOT NECESSARY	380.00	-
	PANEL BEATING ,KNOCKING AND STRAIGHTENING THE NECESSARY PORTION,REMOVE AND RENEWAL OF PARTS ,ADJUST AND REALIGN THE SAME.INCLUSIVE OF THE REPAIR OF MOULDING ASSY ,BODY ROCKER PANEL ,LH,PANEL SUB-ASSY ,FRONT DOOR ,LH,HINGE ASSY ,FRONT DOOR ,LOWER LH,HINGE ASSY ,FRONT DOOR ,UPPER LH,PANEL SUB-ASSY ,REAR DOOR ,LH,HINGE ASSY ,REAR DOOR ,LOWER LH,HINGE ASSY ,REAR DOOR ,UPPER LH,REINFORCEMENT SUB-ASSY,ROCKER,OUTER LH,REINFORCEMENT SUB-ASSY ,ROCKER PANEL,LH AND PANEL SUB-ASSY ,QUARTER ,LH.		1,400.00	400.00
	PUTTY AND SPRAY PAINTING OF THE AFFECTED PORTION .		1,400.00	440.00

Report Ref No. CC3/FCI20014461/Kea3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:3 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	TO RUST-PROOFING AND APPLY UNDERCOAT OF THE AFFECTED AREAS.		240.00	30.00
	TO CHECK ELECTRICAL LIGHTING CONCERNED.		170.00	15.00
			3,590.00	885.00
GRAND TOTAL			17,579.82	3,750.58
RECOMMENDED COST OF REPAIRS				3,750.58

Report Ref No. CC3/FCI20014461/Kea3q2

KONG SENG CHEONG

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd




51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SHD 9035A

INSPECTION

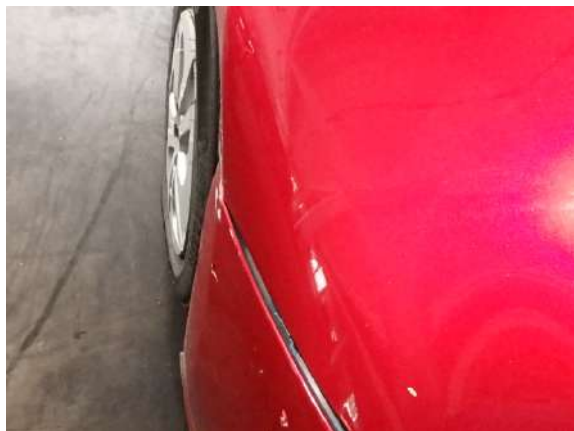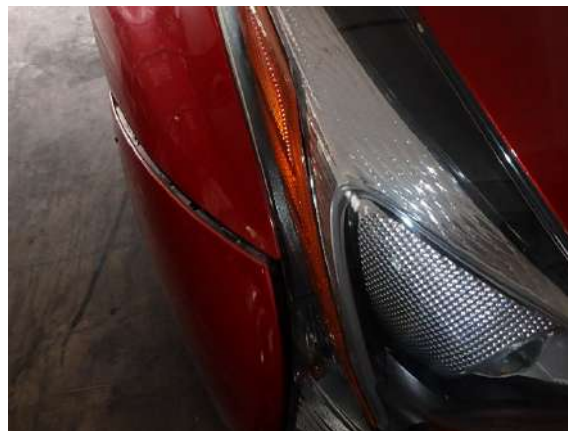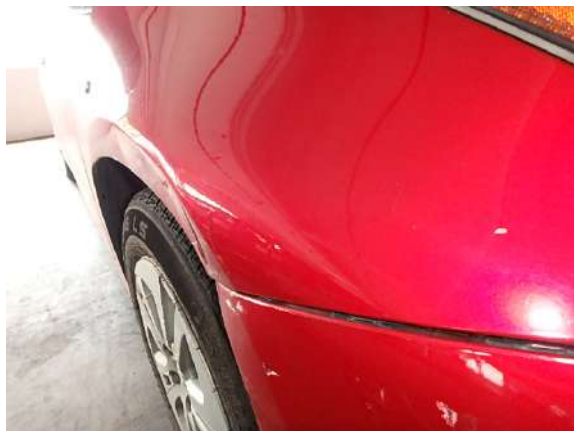




LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

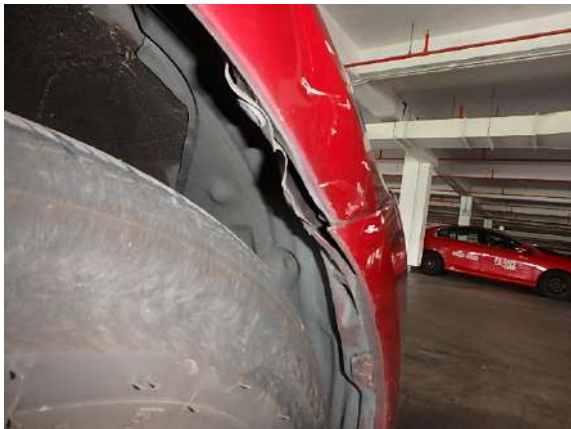



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

