

ASS. REC. BY:

REF:

CS/MSG21000 341/RITd3

744B

ASSIGNMENT

From: _____ Date: _____

Estimated Cost: _____

OD / TP / WS / TP RES / OD RES / EVA / INV / MV

To Inspect Vehicle No: SGQ 8383Uat Workshop m/s XIN YUN Autoof 8 Kori Bukit M6 4 #25-23Insured: MSIA

Policy No. _____


Claims No. _____

Sum Insured: _____ Excess: _____

(Client's Record)

Make of Veh: _____

(Policy Condition)

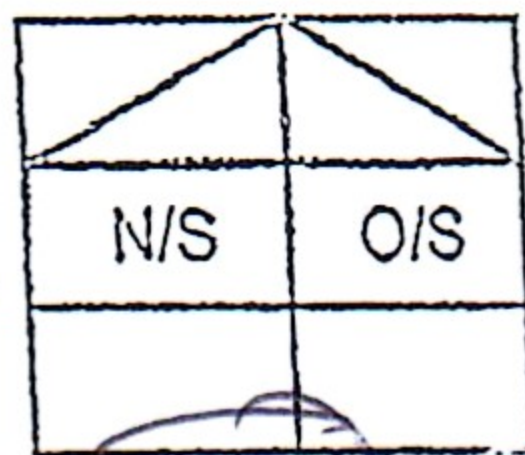Remark: The veh had commenced its
repair at the time of inspection.Bal. or Market Value: 67K

IDAC Accident Rpt: _____ Consistent? : Yes or No

GIA / PR Seen: _____ Consistent? : Yes or No

Est. Repairs: _____ days Res.: Yes or No

Lum Sum: _____ % 3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Date: _____ Person Contacted: _____

Vehicle: IN / OUT

Veh No: SGQ 8383UYr Regn: 2017 / July

Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make: TOYOTA PRINS HYBRID 1.8S AT c.c. 1797Colour: Grey

A/C: Insured / Std / NI / NA

Sp. Reading: 646

T/Radio: Insured / Std / NI / NA

Eng/No: _____

C/No: ZVW50 605 7549Gen. Cond: Good / Fair / Poor / BurntSteering: Inorder / Jammed / Leaked / Burnt orBrake: Inorder / Jammed / Leaked / Burnt orModi: Nil / S/Rim / STD A/Rim orTyre Size: F: 195/65R15

R: _____

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or

HABILEAD

Front

Rear

R/Bal. 6 mmR/Bal. 6 mmL/Bal. 6 mmL/Bal. 6 mmD.O.A. 07/01/2021D.O.I. 08/01/2021Survey held at XINYUNDes. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time

Action / Instruction


Repair / mit 32KLump Sum \$10,600, 10 days
(Red: 20,447.10 : 65%)

Date/Time, File Pass to?



: Prel. Report

1)

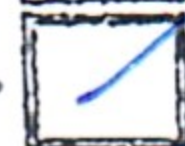

: Final Report

Date/Time, File Return to?

2)

Days Of Repair: 10Resurvey No. of Trip: 2

Add Fee:



: Site Insp (\$ _____)



: Interview (\$ _____)



: Tech. Invs (\$ _____)



: Weekend (\$ _____)

Survey Fee:

Transportation:

S + RS, SI

Photos

Others

TOTAL

Rep. Format: TPLump Sum / L.B.A. (\$ 10,600)



Xin Yun Auto Private Limited

辛运汽车服务有限公司

Tel: 6634 0858 Email: xinyunauto1@gmail.com

Blk 8 Kaki Bukit Avenue 4 #05-23 Premier Singapore 415875

SGQ8383U Toyota

No	Qty	Parts Description	Estimated Parts Price
1	1	Rear bumper assy <i>de</i>	\$ 850.00 <i>652</i>
2	1	Rear bumper left bracket <i>ne</i>	\$ 68.00
3	1	Rear bumper right bracket <i>ne</i>	\$ 68.00
4	1	Rear bumper left retainer <i>ne</i>	\$ 65.00
5	1	Rear bumper right retainer <i>ne</i>	\$ 65.00
6	1	Rear bumper tow cover <i>ne</i>	\$ 88.00
7	<i>2</i>	Bumper side cover <i>cm</i>	\$ 220.00
8	1	Bumper lower lip <i>de</i>	\$ 676.30
9	1	Bumper lower side support big / neear wheel cowling <i>X suc</i>	\$ 255.30 <i>X</i>
10	1	Bumper lower side support small / near wheel cowling <i>X suc</i>	\$ 225.30 <i>X</i>
11	1	Bumper lower middle trim-rectangle rubber <i>X nn</i>	\$ 258.30 <i>X</i>
12	1	Rear tailgate rubber garnish <i>de</i>	\$ 372.20
13	1	Rear reinforcement <i>bt</i>	\$ 676.30 <i>496</i>
14	1	Rear boot assy <i>bt</i>	\$ 1,500.00
15	1	Boot lid outer garnish <i>de</i>	\$ 925.60 <i>620</i>
16	1	Rear tailgate emblem <i>ne</i>	\$ 85.00
17	1	Rear tailgate weatherstrip <i>ne</i>	\$ 275.00 <i>255</i>
18	1	Rear boot lock mechanism <i>bt</i>	\$ 280.00
19	1	Boot lower lock cover <i>de</i>	\$ 48.00
20	1	Rear tailgate inner trim board <i>cm</i>	\$ 375.00
21	1	Tailgate internal board <i>X suc</i>	\$ 350.00 <i>X</i>
22	1	Rear fender trim left (inside boot) <i>cm</i>	\$ 425.00
23	1	Rear fender trim right (inside boot) <i>de</i>	\$ 425.00
24	1	Pull pocket / on bonent <i>de</i>	\$ 88.00
25	1	Rear tailgate no plate lamp <i>X suc</i>	\$ 65.00 <i>X</i>
26	1	Rear tailgate left taillamp <i>cm</i>	\$ 485.80
27	1	Rear tailgate right taillamp <i>cm</i>	\$ 485.80
28	1	Rear left taillamp <i>cm</i>	\$ 525.00
29	1	Rear right taillamp <i>cm</i>	\$ 525.00
30	1	Taillight side cover left <i>X suc</i>	\$ 125.00 <i>X</i>
31	1	Taillight side cover right <i>X suc</i>	\$ 125.00 <i>X</i>
32	2	Rear tailgate damper / impact big got sounds <i>X suc</i>	\$ 560.00 <i>X</i>
33	1	Rear end lower panel / bent badly	\$ 580.00
		Edge molding / middle panel side molding <i>bt</i>	
34	2	comes with 2 molding at both side / borken/missing <i>X nn</i>	\$ 220.00 <i>X</i>
35	1	Rear end tool box big cover <i>de</i>	\$ 385.00
36	1	Top tool board <i>de</i>	\$ 550.00
37	1	Floor panel flooring & carpeting <i>X nn</i>	\$ 525.00 <i>X</i>
38	1	Floor panel control / spare tyre panel <i>bm</i>	\$ 585.40
39	1	Floor side panel left <i>regr</i>	\$ 285.00 <i>X R</i>
40	1	Floor side panel right <i>regr</i>	\$ 285.00 <i>X R</i>
42	1	Rear quarter panel left <i>X suc</i>	\$ 325.00 <i>X</i>
43	1	Rear quarter panel right <i>bt</i>	\$ 325.00
44	1	Rear end lower panel top garnish / 1 piece near lock <i>de</i>	\$ 225.00
45	1	Rear exhaust top silver cover piece dent <i>bt</i>	\$ 195.00
46	1	Rear exhaust muffler assy dent <i>bt</i>	\$ 680.00

47	3	Rear exhaust muffler mounding <i>new</i>	\$	90.00
49	1	Roof top side panel-right / squeeze sunken <i>repair</i>	\$	380.00 <i>XR</i>
50	1	Roof top side panel -left /squeeze sunken <i>repair</i>	\$	380.00 <i>XR</i>
51	1	Fender left <i>X SVC</i>	\$	685.00 <i>X</i>
52	1	Fender right <i>X SVC</i>	\$	685.00 <i>X</i>
53	1	Fender top cover <i>X SVC</i>	\$	225.00 <i>X</i>
54	1	Fender top cover <i>X SVC</i>	\$	225.00 <i>X</i>
55	3	Fener internal side trim coverx3pc <i>X SVC</i>	\$	450.00 <i>X</i>
56	2	Fender internal board <i>X SVC</i>	\$	600.00 <i>X</i>
57	1	Rear right top window flow <i>X new</i>	\$	525.00 <i>X</i>
58	1	Rear boot middle glass / at middle panel <i>X SVC</i>	\$	450.00 <i>X</i>
59	1	Rear middle glass moulding <i>new</i>	\$	150.00
60	1	Tool box RH <i>X SVC</i>	\$	480.40 <i>X</i>
61	1	Tool box LH <i>X SVC</i>	\$	580.40 <i>X</i>
62	1	Antena, electrical key <i>CM</i>	\$	185.00
			\$	22,817.10

12843.50

2596

9632.62



Xin Yun Auto Private Limited

辛运汽车服务有限公司

Tel: 6634 0858 Email: xinyunauto1@gmail.com

Blk 8 Kaki Bukit Avenue 4 #05-23 Premier Singapore 415875

SGQ8383U Toyota

No	Qty	Parts Description	Estimated Parts Price
<u>Special Nett Items</u>			
1	10	Rear bumper clips <i>new</i>	\$ 80.00 40
2	6	Rear end lower panel top garnish clips <i>new</i>	\$ 50.00 30
3	1	Rear end lower panel sealant <i>new</i>	\$ 120.00 60
4	8	Rear tailgate inner trim board clips <i>new</i>	\$ 50.00 30
5	6	Rear tailgate outer garnish clips <i>new</i>	\$ 50.00 30
6	1	Rear floor panel insulator pad <i>new</i>	\$ 150.00 60
7	1	Rear floor panel sealant <i>new</i>	\$ 120.00 60
8	1	Rear windscreen glass sealant <i>new</i>	\$ 80.00 60
9	3	Rear windscreen mounding <i>new</i>	\$ 320.00 100
10	2	Rear bumper reverse sensor <i>new</i>	\$ 250.00 200
11	1	Rear no plate with garnish <i>CM</i>	\$ 80.00 35
12	1	Rear end camera <i>X SVC</i>	\$ 450.00 <i>X</i>
48	1	Rerve sensor <i>X SVC</i>	\$ 250.00 <i>X</i>
sub total special nett			\$ 2,050.00
Total special nett			\$ 2,050.00

705



Xin Yun Auto Private Limited

辛运汽车服务有限公司

Tel: 6634 0858 Email: xinyunauto1@gmail.com

Blk 8 Kaki Bukit Avenue 4 #05-23 Premier Singapore 415875

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

SGQ8383U Toyota

No	Description	Labour Charges
1	Labour for panel beating, cut, weld, straighten rear affected area and replace rear damaged parts.	\$ 2,500.00
2	To putty and spray painting rear portion.	\$ 1,800.00
3	To check rear lighting and wiring.	\$ 50.00
4	To remove and install rear tailgate lock mechanism.	\$ 80.00
5	To remove & install rear windscreen glass to facilitate the repair.	\$ 150.00
6	To apply anti rust proofing to rear affected area including behind spare tyre area	\$ 250.00
7	To remove and install rear end panel	\$ 120.00
8	To remove and install rear bumper reverse sensor.	\$ 80.00
9	To remove and install rear exhaust muffler assy.	\$ 120.00
10	To remove and interal side fender trims to facilitate the repair	\$ 180.00
11	To remove the ceiling to facilitate the repair	\$ 250.00
12	To remove and install rear camera	\$ 80.00
13	To remove the behind windscreen to faciltete change boot	\$ 150.00
14	To remove boot middle glass panel to faciltate the repair	\$ 120.00
15	To remove both side roof side panel, adjust the squeeze and dent	\$ 250.00
Total labour :		\$ 6,180.00

Total parts : 24,867.10

Total labour : 6,180.00

Total repair cost : 31,047.10

9632.62
705.00
2950.00
13,287.62

20%

10,630.09

45-10,600

10 days

Rasul

45 9000068

10 days

45

08/01/2022 @ 1510

Resurvey after repair

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date: