



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

CHINA TAIPING INSURANCE (S) PTE LTD	INV No.	AC2102027
3 ANSON ROAD #16-00	INV Date	29/03/2021
SPRINGLEAF TOWER	Reference	CC6/CTI21000435/Ars3q2
SINGAPORE 079909	Code	CTI

PROFESSIONAL SERVICE FEE

Vehicle No.	SLT 269U
Insured Veh.	SLE 3765M
Claim No.	SNM20D205128/C02
Policy No.	DMPCSNA00075502003
Accident Date	27/12/2020
Inspection Date	12/01/2021

Description	Total
Third Party Express Settlement	400.00
Subtotal	400.00
GST (7%)	28.00
Grand Total	428.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile			
CHINA TAIPING INSURANCE (S) PTE LTD 3 ANSON ROAD #16-00 SPRINGLEAF TOWERSINGAPORE 079909		Ref: CC6/CTI21000435/Ars3q2 Date: 29/03/2021 Code: CTI	
1. Policy Particulars :- THIRD PARTY CLAIM			
Insured Veh.	SLE 3765M	Veh. Inspected	SLT 269U
Policy No.	DMPCSNA00075502003	Coverage (\$)	0.00
Claim No.	SNM20D205128/C02	Excess (\$)	0.00
Assign From		Assign Date	12/01/2021
2. Vehicle Particulars & Condition			
Make & Model	HYUNDAI ELANTRA	c.c	1591
Engine No.	HIDDEN	Year of Reg.	2017
Chassis No.	KMHD841CMJU551119	Colour	WHITE
Odometer	70722 KM	Steering	IN ORDER
Brakes	IN ORDER	Modification	SPORTS RIM
General	GOOD		
3. Conditions of Tyres			
	Size	Make	Balance
R/H Front Tyre	195/65 R15	MICHELIN	6 mm
L/H Front Tyre	195/65 R15	MICHELIN	6 mm
R/H Rear Tyre	195/65 R15	MICHELIN	6 mm
L/H Rear Tyre	195/65 R15	MICHELIN	6 mm
4. Description of Damages			
THE VEHICLE SUSTAINED DAMAGES AT THE FRONT PORTION. DAMAGES SEE DETAILS.			
5. General Information			
Accident Date	27/12/2020	Inspection Date	12/01/2021
Survey held at	CAS GARAGE PTE LTD NO. 1 KAKI BUKIT AVE 6, #02-22 AUTOBAY 417883 KAKI BUKIT		
5a. Remarks			
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.			
5b. Estimate Days of Repair			
ESTIMATED NORMAL PERIOD FOR REPAIR:		6 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SLT 269U

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
REPLACEMENT OF PARTS				
1	FRONT BONNET	DENTED	1,741.20	1,741.20
1	FRONT BONNET INSULATOR	NOT NECESSARY	245.20	-
1	FRONT BONNET INNER LOCK	NOT NECESSARY	235.90	-
4	FRONT BONNET STOPPER @\$38.50	NOT NECESSARY	154.00	-
1	FRONT BUMPER	DEFORMED	586.30	474.90
2	FRONT BUMPER SIDE AIR GUIDE @\$145.60	DEFORMED	291.20	291.20
1	FRONT BUMPER TOP SEAL (RUBBER)	NOT NECESSARY	98.70	-
1	FRONT BUMPER LOWER BEAM	NOT NECESSARY	186.50	-
2	FRONT BUMPER SIDE RETAINERS @\$86.30	N/S NECESSARY	172.60	86.30
2	FRONT BUMPER BRACKETS @\$75.80	N/S DAMAGED	151.60	75.80
1	FRONT BUMPER REINFORCEMENT	DENTED	385.50	385.50
1	FRONT RADIATOR GRILLE	CRACKED	385.50	385.50
1	FRONT BUMPER NUMBER PLATE GARNISH	CRACKED	45.20	45.20
1	FRONT BUMPER SPONGE	CRACKED	186.30	186.30
1	FRONT BUMPER TOW COVER	NOT NECESSARY	48.20	-
1	FRONT BUMPER LOWER LIP	NOT NECESSARY	108.50	-
1	FRONT FOGLAMP COVER	CRACKED	156.30	156.30
1	FRONT ENGINE UNDERCOVER	NOT NECESSARY	286.50	-
1	FRONT SUPPORT PANEL	CRACKED	987.50	987.50
1	FRONT SUPPORT PANEL TOP GARNISH	CRACKED	224.60	224.60
1	FRONT HEADLAMP LH	CRACKED	1,248.60	1,248.60
1	FRONT HEADLAMP BRACKET LH	NOT NECESSARY	89.70	-
1	FRONT AIR CLEANER BOX	NOT NECESSARY	196.30	-
1	FRONT FENDER LH	NOT NECESSARY	489.60	-
1	FRONT FENDER INNER COWLING	NOT NECESSARY	156.30	-
1	FRONT CONDENSER	NOT NECESSARY	798.70	-
1	FRONT RADIATOR	NOT NECESSARY	145.60	-
1	FRONT RADIATOR TOP HOSE	NOT NECESSARY	799.80	-
	LESS 20% DISCOUNT		-2,120.38	-1,257.78
			8,481.52	5,031.12

Report Ref No. CC6/CTI21000435/Ars3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>SPECIAL NETT ITEMS</u>			
1	SET FRONT BONNET CLIPS (SN)	NOT NECESSARY	50.00	-
1	SET FRONT BUMPER CLIPS (SN)	NECESSARY	30.00	30.00
1	SET FRONT NUMBER PLATE WITH CASING (SN)	DENTED	30.00	30.00
1	SET SUPPORT TOP GARNISH CLIPS (SN)	NECESSARY	30.00	30.00
1	SET FRONT GRILLE CLIPS (SN)	NECESSARY	30.00	30.00
1	SET FRONT ENGINE UNDERCOVER CLIPS (SN)	NOT NECESSARY	30.00	-
1	SET FRONT FENDER INNER COWLING CLIPS (SN)	NOT NECESSARY	30.00	-
1	SET RADIATOR COOLANT (SN)	NECESSARY	60.00	40.00
			290.00	160.00
	<u>LABOUR</u>			
	TO REMOVE AND REPLACE ACCIDENT AFFECTED PORTION .		1,600.00	800.00
	TO RESPRAY ACCIDENT AFFECTED PORTION .		1,800.00	400.00
	TO TUFF COAT AFFECTED AREAS.	NOT NECESSARY	150.00	-
	TO APPLY SEALANT AND UNDER COATING TO THE AFFECTED AREAS.	NOT NECESSARY	180.00	-
	TO CONDUCT WIRING CHECK .		80.00	30.00
	TO CONDUCT WATER LEAKAGE .	NOT NECESSARY	120.00	-
	TO REMOVE/INSTALL CONDENSER AND TOP UP AIR CON GAS.		150.00	120.00
			4,080.00	1,350.00
	GRAND TOTAL		12,851.52	6,541.12
	RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)			5,200.00

Report Ref No. CC6/CTI21000435/Ars3q2

ADRIAN LING WAI PING

B.Eng,AMSOE,AMIRTE,AMSAE-A,M.MATAI

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd


51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SLT 269U

INSPECTION

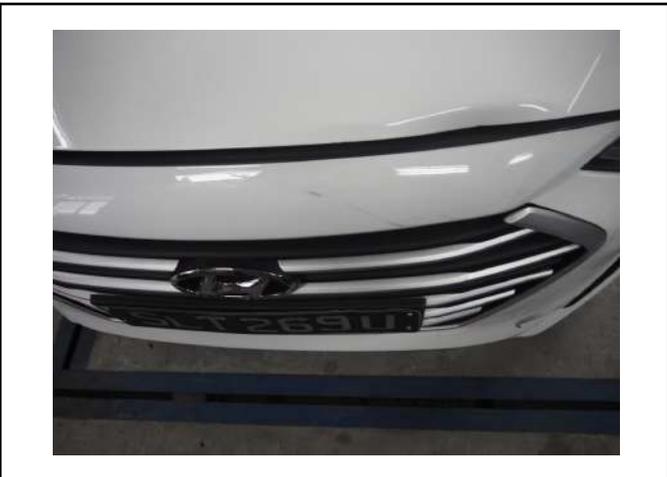



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SLT 269U

RE-INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

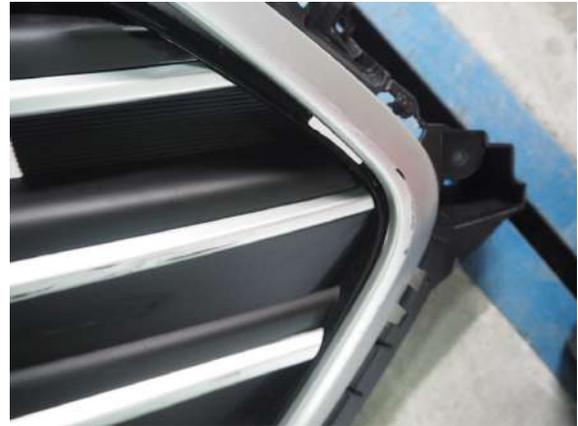




LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

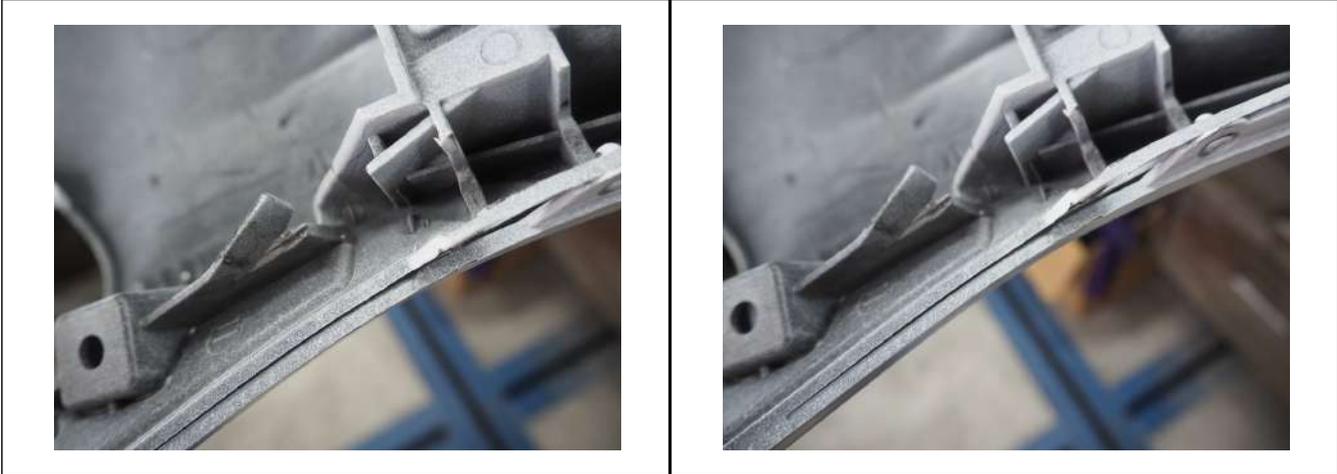




LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

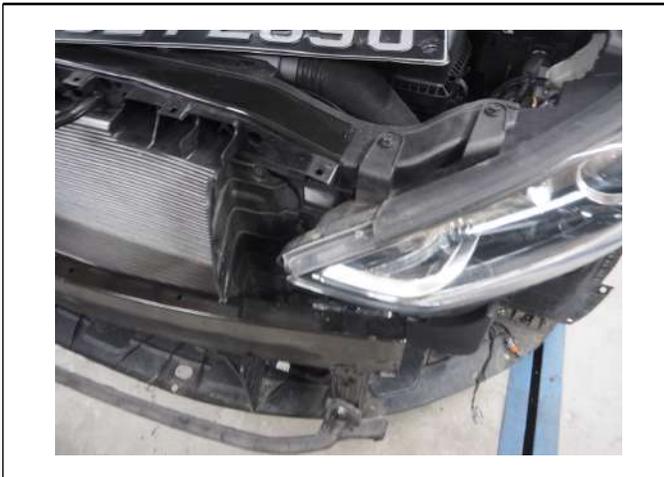



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

