

Constant Appraiser Services

Qualified Automobile Accident Damage Appraisers/Loss Adjusters

Blk 2 Rivervale Link, #09-02 Singapore 545040

Tel/Fax: 6886 1106 Mobile: 9007 5234

Email: constant_as@yahoo.com.sg

RCB No. 53138015K

Automobile Inspection Report

To: Tay Wan Chee
c/o 60 Jalan Lam Huat
#07-60 Carros Centre
Singapore 737869

Date : 02/12/2020

Reference No : CAS/20-12/002

General Information

Registration No. : SGJ 6072S
Accident Date : 14/11/2020

Particulars of Damaged Vehicle

Colour	: Silver	Make & Model	: Honda Civic 1.8L A
Engine Capacity	: 1799 cc	Pre-Accident Condition	: Good
Mileage (KM)	: 138962	Engine No.	: R18A1103412
Chassis No.	: JHMFD16306S210640	Steering	: In Order
Registration Date	: 15/07/2006	Brake	: In Order

Tyre Condition

	Size	Make	Balance
R/H Front Tyre	205/55R16	PIRELLI	90%
L/H Front Tyre	205/55R16	PIRELLI	90%
R/H Rear Tyre	205/55R16	PIRELLI	90%
L/H Rear Tyre	205/55R16	PIRELLI	90%

Inspection

Repairer : Seah Motor Trading Co. LLP
60 Jalan Lam Huat, #07-60 Carros Centre, Singapore 737869

Adjustment And Recommendation Cost Of Repair

Repairer's Estimate : \$10,376.80
Revised Amount : \$5,750.00
Less Excess : -
Nett Total : \$5,750.00

Remarks

- (A) Survey was done on 17/11/2020
- (B) Re-survey was done on 18/11/2020
- (C) Re-survey was repair was done on 30/11/2020
- (D) The survey was conducted entirely on WITHOUT PREJUDICE basis.
- (E) We have NOT given any instruction to authorize the repair of the vehicle.

NOTE: The revised estimate was made from a visual inspection. Should there be any discrepancy or unseen damage/item in this survey, kindly notified the company within 7 (seven) days from the date hereof. Otherwise, the revised amount shall be deem to be valid.

Adjustment On Repair Costs And Replacement Of Parts:

S/No	Qty	Descriptions	Assessed Condition	Estimate by Workshop (\$)	Revised Amount (\$)
<u>PARTS REPLACEMENT – LIST ITEMS</u>					
1	1pc	Bootlid / CR4	Dented/Buckled	787.82	787.82 610
2	1pc	Bootlid lock / Jam	Bent/Jammed	208.68	208.68 /
3	1pc	Bootlid lock catch Xsvc	Bent	18.70	18.70 X
4	1pc	Bootlid weatherstrip / CR4	Distorted	112.47	112.47 /
5	2pcs	Bootlid hinge @ \$53.46 / BT	Bent	106.92	106.92 /
6	2pcs	Bootlid reverse lamp @ \$308.78 / BR	Broken	617.56	617.56 580
7	1pc	Bootlid emblem (logo) / Nec	Necessary	80.11	80.11 405
8	1pc	Bootlid emblem (Civic) / Nec	Necessary	79.92	79.92 32
9	1pc	Bootlid emblem (1.8) / Nec	Necessary	78.30	78.30 31
10	1pc	Bootlid emblem (I-Vtec) / Nec	Necessary	82.13	82.13 32
11	1pc	Rear boot licence lamp garnish / Def.	Broken	97.10	97.10 /
12	2pcs	Rear boot licence lamp @ \$55.00 Xsvc	Cracked	110.00	110.00 X
13	2pcs	Taillamp @ \$336.50 / CR4	Cracked/Broken	673.00	673.00 /
14	2pcs	Taillamp lower bracket @ \$12.76 / BR	N/S Bent	25.52	12.76 /
15	2pcs	Taillamp panel @ \$99.12 / DP	N/S Dented LH	198.24	99.12 /
16	1pc	Rear end panel / DP	Dented/Warped	419.56	419.56 340
17	1pc	Rear end panel garnish / CR4	Deformed	127.40	127.40 /
18	1pc	Rear fender LH / CR4	Dented/Buckled	786.20	786.20 /
19	2pcs	Rear fender inner trim @ \$280.40 / Def.	Deformed	560.80	560.80 500
20	1pc	Rear fender air vent LH Xsvc	Serviceable	79.40	-
21	1pc	Rear windscreen moulding / Nec	Necessary	125.60	125.60 /
22	1pc	Rear exhaust pipe X R	Repair	716.20	-
23	1pc	Rear bumper / CR4	Dented/Broken	701.00	701.00 550
24	2pcs	Rear bumper side retainer @ \$38.60 / BR	Broken	77.20	77.20 /
25	1pc	Rear compartment panel X R	Repair	942.44	-
26	1pc	Rear compartment panel cover X svc	Serviceable	256.23	-
Less 20%				8,068.50	5,962.35 5,141.95
				(1,613.70)	(1,192.47) -20%
Sub total				6,454.80	4,769.88 4,113.56
<u>PARTS REPLACEMENT – SPECIAL NETT ITEMS</u>					
1	2sets	Rear fender inner trim ^{clip} @ \$34.00 / Nec	Necessary	68.00	68.00 30

S/No	Qty	Descriptions	Assessed Condition	Estimate by Workshop (\$)	Revised Amount (\$)
<u>PARTS REPLACEMENT – SPECIAL NETT ITEMS (CONT'D)</u>					
2	1set	Rear end panel garnish clip ✓NEC	Necessary	22.00	22.00 ✓
3	1set	Rear bumper clip ✓NEC	Necessary	48.00	48.00 30
4	1pc	Reverse camera X SUC	Serviceable	450.00	-
5	1set	Reverse sensor ✓NEC	Broken	250.00	220.00 ✓
Sub total				7,292.80	5,127.88 302
<u>LABOUR & MISC. CHARGES</u>					
1		Labour to repair & replace damaged parts		1,300.00	900.00 ✓
2		Spray painting on affected area		1,300.00	900.00 ✓
3		Remove & refix rear trim board & garnish		100.00	80.00 ✓
4		Remove & refix exhaust pipe	Not Necessary	100.00	-
5		Check wiring system		60.00	20.00 ✓
6		Remove, renew reverse sensor & camera		100.00	60.00 30
7		Spray anti rust on affected area		100.00	60.00 40
Grand total				10,376.80	7,147.88 1,970
Recommended cost of lump sum repair (To its pre-accident condition)					5,750.00


Adjustment/Recommendations

We have thoroughly inspected each and every item on the estimate against the physical damage found on the vehicle and we have listed the breakdown of our finding and our recommendation.

The repairer has agreed to undertake the job at a lump sum of \$5,750.00 on a contractual basis. Under normal circumstances, the repair period would be about 10 (Ten) working days.

Repair day 8 days

Yours faithfully,
Constant Appraiser Services

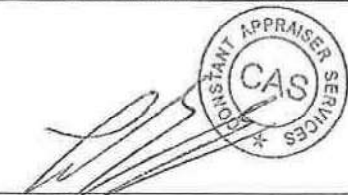

Lim Yong Tian (Sebastian)
Licensed Appraiser
Adv. Dip. In Mechanical Engineering (AUS)
MSAAA

Repair limit

4/5
\$3,000

4,113.56
302
1,970
6,385.56
- 20%
5,108.45