Correspondence Address: 1 Simei St.3 #02-24 S(529890) Mobile: 9295 2204 Fax: 6722 8508 Email: pasvcs@hotmail.com

Business Reg. 201404434D

# VEHICLE INSPECTION REPORT

Report No.: PAS/TP/0491219

Date of Report

: 30/01/2020

To: Mr Pay Ah Yan

C/o. 53 Ubi Avenue 1 #01-33 Paya Ubi Industrial Park Singapore 408934

Date of Assignment : 31/12/2019 Report requested by

: Mr Pay Ah Yan

Date of Accident Date of Inspection

: 25/12/2019 : 31/12/2019

Claim No.

: Third Party Claim

Policy No.

## PARTICULARS OF DAMAGED VEHICLE

Vehicle Registration No.

: SLL7730A

Engine Capacity (cc): 1497cc

Make & Model

: Honda City

Mileage (km)

: Battery Flat Chassis / Frame No. : MRHGM6660HP000598

Date of Registration

: 09/03/2017

Colour

: Met. Maroon

Engine No.

: L15Z14116779

#### TYRE CONDITION

Front LH

: 5 mm

Front RH

: 5 mm

: Bridgestone

Make

: Bridgestone

Rear LH

Make

: 5 mm

Rear RH

: 5 mm

Make : Bridgestone

Make

: Bridgestone

Road wheels Type: Alloy

(The above represents the approximate remaining life of tyre treads)

# PRE-ACCIDENT CONDITION OF DAMAGED VEHICLE (Static tests only)

General Bodywork

: Good

Paintwork

: Good

Handbrake

: Serviceable

Footbrake

: Serviceable

: Serviceable

Steering Apparent Engine Modification

: Nil

# PLACE OF REPAIRER OFFICE/WORKSHOP

Location

M/s. My Car Consultant Pte Ltd

53, Ubi Avenue 1, #01-33, Paya Ubi Industrial Park, Singapore 408934

# ASSESSMENT

Repairer's Estimate

Recommended Reserve

6,466.64

Revised Amount

: \$ 5,206.80

Less Excess

\$

: \$

4,160.00 (Lump Sum)

Estimated Normal Period of Repairs : 8 Working Days

Disclaimer: The information contained in this report is intended for exclusive use of the addresses (including any attachments) solely in relation to the loss occurrence in which the assessed vehicle involved. It is confidential and may protected by legal privileged. No liability or responsibility whatsoever shall be held by PROMINENT APPRAISER SERVICES PTE LTD for any reliance on this report by any third party. If you are not the intended recipient, please contact us immediately to arrange for its return and you should not disseminate, distribute, copy any information contained herein or use of this communication is strictly prohibited.

Page 1 of 4

Qualified Loss Adjusters And Motor Appraisers
Correspondence Address: 1 Simei St.3 #02-24 S(529890)
Mobile: 9295 2204 Fax: 6722 8508 Email: pasvcs@hotmail.com

Business Reg. 201404434D

Report No.: PAS/TP/0491219

Vehicle No: SLL7730A

NERAL REMARKS

WITHOUT PREJUDICE

#### THE ASSIGNMENT

The survey was conducted at M/s. My Car Consultant Pte Ltd, 53, Ubi Avenue 1, #01-33, Paya Ubi Industrial Park, Singapore 408934.

(Subsequent inspections have been conducted)

#### POINT OF IMPACT

At the rear portion.

#### **DAMAGES**

The boot lid, rear bumper, rear end panel, rear floor panel, rear chassis members, rear fenders, LH reflector, taillamps, etc.

Other parts were also found damaged. (See schedule for details)

## ADJUSTMENT / RECOMMENDATION

We have inspected thoroughly each and every item on the repairer's estimate against the actual damaged found on the vehicle. We list the breakdown of our findings and our recommendation as per schedule attached.

Our adjusted amount for the cost of repairs is SGD \$5,206.80.

#### CONCLUSION

The repairer has agreed to undertake the repairs at a lump sum of SGD \$4,160.00.

This inspection was conducted entirely on a 'Without Prejudice' basis. We have not given an authorization and/or instruction to the repairer to proceed with the repairs.

We hereby reverting the matter to you for your discretion on repairs.

Assuring you of our best services always.

Yours Truly,

Prominent Appraiser Services Pte Ltd

Andrew How

Automobile Appraiser

**MSAAA** 

Licensed Appraiser

Business Reg. 201404434D

Vehicle No: SLL7730A

## Report No.: PAS/TP/0491219

# APPRAISEMENT SCHEDULE

S/No.	Qty	Parts Descriptions	Condition		Repairer's Estimate (S\$)		Our Assessment (S\$)		
1	1 pc	Boot lid	Dented/Distorted			\$	483.20	\$	483.20
2	1 pc	Boot lid no.plate chrome garnish	Refit			\$	100.20	\$ \$	463,20
3	1 pc	_	Necessary			\$	22.40	\$	22.40
4	l pc	· ·	Necessary			\$	21.70	\$	22.40
5	1 pc	Boot lid emblem (iVtec)	Necessary			\$	18.40	\$	18.40
6	2 pcs	Boot lid reflector R/L	LH Cracked	\$	127.50	\$	255.00	\$	127.50
7	1 pc	Boot lid inner lining	Refit	•	121100	\$	142.30	\$	127.50
8	8 pcs	Boot lid inner lining clip	Necessary	\$	3.00	\$	24.00	\$	24.00
9		Boot lid lock	Bent/Jammed	•	2.00	\$	110.70	\$	110.70
10	1 pc	Boot lid lock striker	Bent			\$	12.30	\$	12.30
11	1 pc	Boot lid weatherstrip	Torn/Necessary			\$	112.70	\$	112.70
12	2 pcs	Taillamp R/L	Cracked	\$	272.30	\$	544.60	\$	544.60
13	1 pc	Rr bumper	Dented			\$	492.70	\$	492.70
14	4 pcs	Rr bumper reverse sensor R/L	Dented/Damaged	\$	152.30	\$	609.20	2pcs \$	304.60
15	6 pcs	Rr bumper clip	Necessary	\$	3.20	\$	19.20	2pcs \$	19.20
16	2 pcs	Rr bumper retainer R/L	Cracked/Necessary	\$	22.10	\$	44.20	\$	44.20
17	1 pc	Rr end panel assy	Dented			\$	376.00	\$	376.00
18	1 pc	Rr end panel garnish	Dented/Deformed			\$	92.40	\$	92,40
19	1 pc	Rr lock antenna	Dented/Damaged			\$	169.20	\$	169.20
20	1 pc	Rr warning buzzer	Dented/Damaged			\$	82.70	\$	82.70
21	1 pc	Rr spare tyre lid cover	Serviceable			\$	100.20	\$	-
22	2 pcs	Rr fender R/L	Dented/Repair			•		~	0. 3, 5 & 6)
23		Rr floor panel	Dented/Repair						o. 3, 5 & 6)
24	2 pcs	Rr chassis member R/L	Dented/Repair				(Refe		0. 3, 5 & 6)
						\$	3,833.30	\$	3,058.50
				Less D	Discount: 20%	\$	766.66	20% \$	611.70
			List	Parts Su	ıb-Total :	\$	3,066.64	\$	2,446.80
1	1 pc	Rr end panel sealant	Necessary		S/N	\$	50.00	\$	40.00
			Special	Nett Su	b-Total :	\$	50.00	\$	40.00
		•							
				Part	s Total :	\$	3,116.64		2,486.80

Correspondence Address: 1 Simei St.3 #02-24 S(529890) Mobile: 9295 2204 Fax: 6722 8508 Email: pasvcs@hotmail.com

Business Reg. 201404434D

Vehicle No: SLL7730A		Report No. : PAS/TP/0491219				
S/No. Labour Descriptions		Repairer's		Our Assessment (S\$)		
1 To transfer boot component parts to new boot.	\$	100.00	\$	70.00		
2 To check rear electrical wiring system.	\$	70.00	\$	50.00		
3 To remove and reinstall rear interior trims, garnishes, etc. for necessary repairs.	\$	150.00	\$	100.00		
4 To remove, replace and/or transfer rear reverse sensors to new bumper. (Include reset/reprogram control unit)	\$	150.00	\$	140.00		
5 To straighten, repair, realign on affected area and replace damaged parts.	\$	1,400.00	\$	1,100.00		
6 To spray painting, blending on affected and adjacent area.	\$	1,400.00	\$	1,200.00		
7 To spray anti-rust coating on new and affected panels.	\$	80.00	\$	60.00		
Labour Total :	\$	3,350.00	\$	2,720.00		

#### For Lump Sum Repairs


The final adjusted Lump Sum contract amount is \$ 4,160.00


Under normal circumstances, the repairs should be completed within a reasonable period

- of 8 Working Days. (Exclude waiting days of PRI, Sunday, Pubic Holiday and awaiting of shipment for spare parts)
- 64 Photographs were taken at the time of inspection.


N.B: By accepting to carry out the repairs on a contract Lump Sum basis, the repairer shall has the prerogative and discretion to replace the damaged parts with new, used, OEM or reconditioned parts and/or to repair the vehicle on a roadworthy condition to the entire satisfaction of owner.




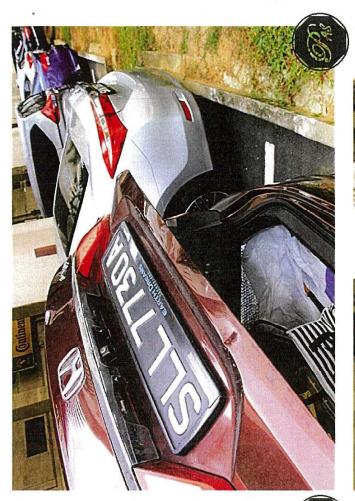


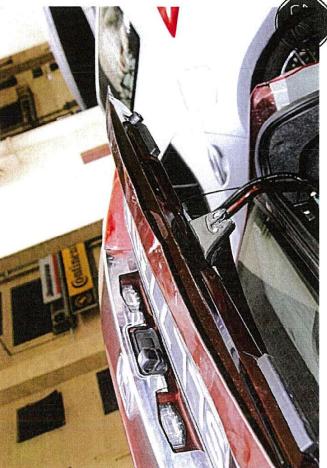




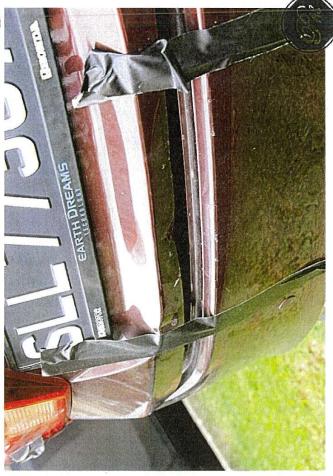

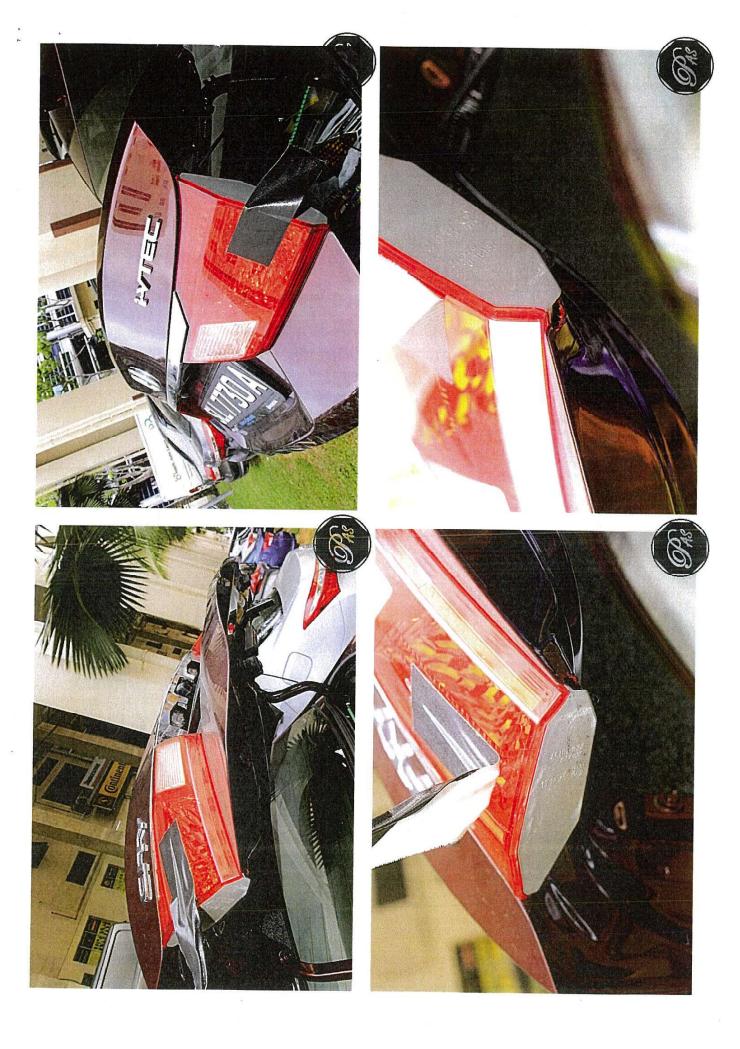


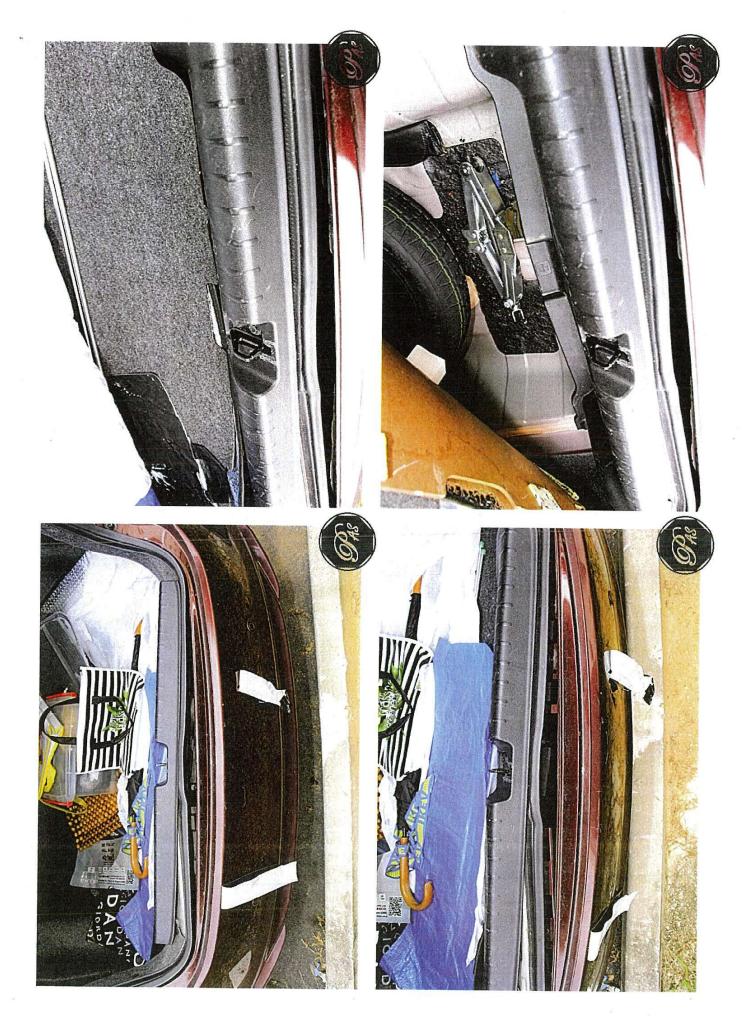


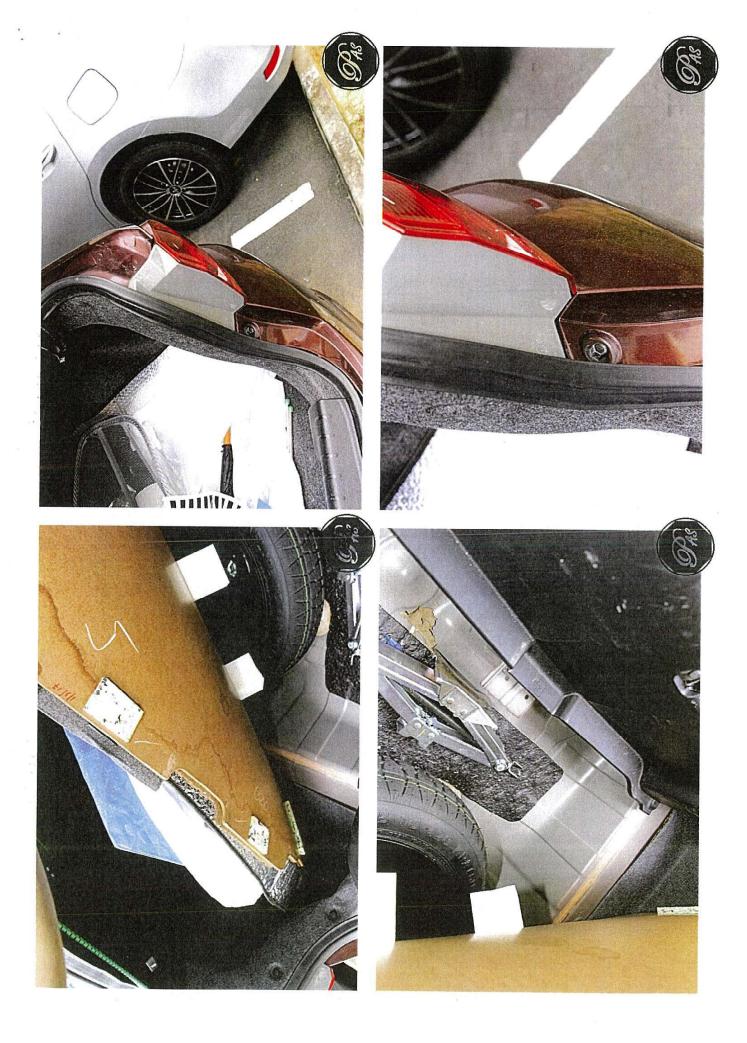







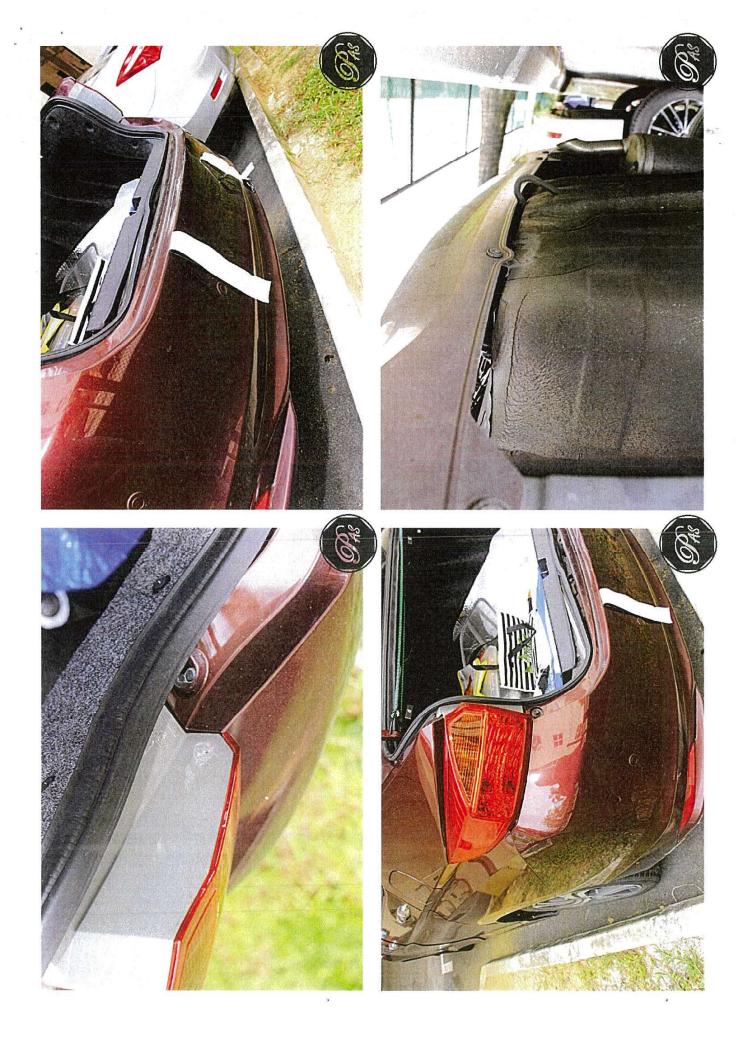


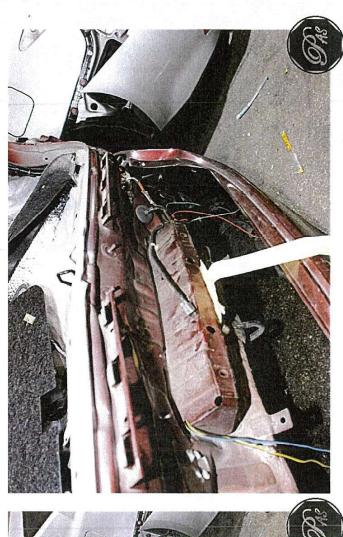



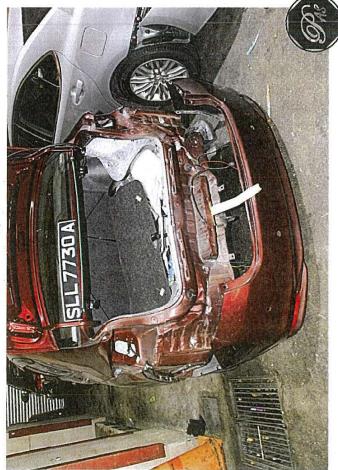

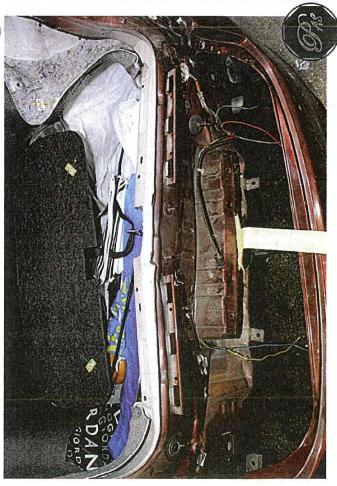

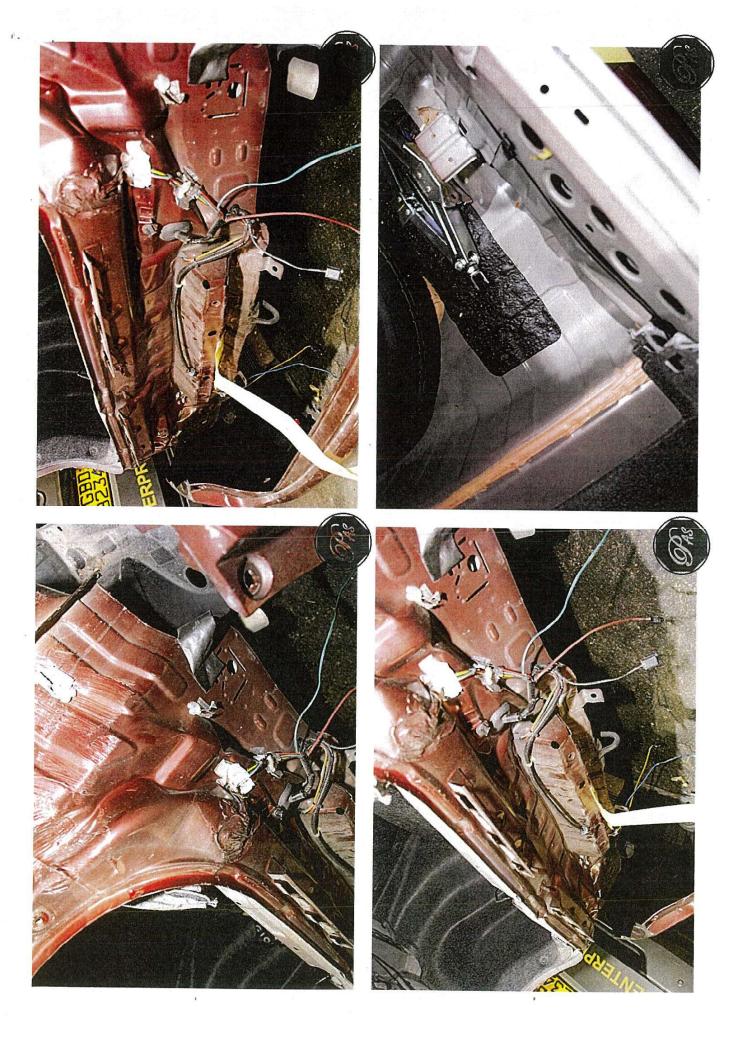











.





