

PAR Automotive Consultancy

Regn. No: 52986974L

Thomson Rd Post Office PO Box 029 Singapore 915701. Tel : 645 31173, Fax : 645 36131.

Report No: 0001-21-SHM

05 January 2021

- Lim Eng Yew
c/o Sau Heck Motor Services
Blk 10 Ang Mo Kio Ind Park 2A #02-14
AMK AutoPoint
Singapore 568047

INVOICE No. 0001-21-SHM


Vehicle No. SLE1874U

<u>S/NO.</u>	<u>SERVICES RENDERED</u>	<u>Amount due</u>
1	Being accident vehicle appraisal services, transport, photographs and re-inspection (work in progress and post repair inspection).	\$851.00
Total amount payable		<u>\$851.00</u>

Kindly cross your cheque in favour of "PAR Automotive Consultancy"

We thank you in anticipation for your prompt payment.

PAR Automotive Consultancy

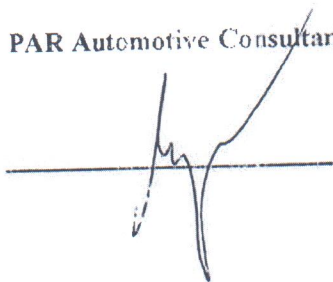

PAR Automotive Consultancy

Regn. No: 52986974L

Thomson Rd Post Office PO Box 029 Singapore 915701. Tel : 645 31173, Fax : 645 36131.

Report No: 0001-21-SHM

05 January 2021

ACCIDENT VEHICLE SURVEY REPORT

Lim Eng Yew
c/o Sau Hock Motor Services
Blk 10 Ang Mo Kio Ind Park 2A #02-14
AMK AutoPoint
Singapore 568047

VEHICLE INFORMATION:

Vehicle Reg No.:	SLE1874U	Odometer:	68687km
Make & Model:	Toyota Sienta	Colour:	Blue
Chassis number:	NSP1707008583	Date of accident:	05/12/2020
Year of Regn.:	12/07/2016	Date inspected:	14/12/2020
Repairer at:	Sau Hock Motor Services	Date inspected (After Repair):	24/12/2020
	Blk 10 Ang Mo Kio Ind Park 2A #02-14		
	AMK AutoPoint		
	Singapore 568047		

STATIC CHECKS, where applicable:

Steering :	serviceable
Footbrake :	serviceable
Handbrake :	serviceable
Paintwork :	Good
General condition :	Good

TIRE CONDITION:

	<u>LH / Make</u>	<u>RH / Make</u>	<u>Size</u>
Front:	3mm/Yokohama	3mm/Yokohama	195/60R15,
Rear:	3mm/Yokohama	3mm/Yokohama	195/60R15

POINT OF IMPACT AND DAMAGE, where applicable:

Impact on the rear portion.
Please see details as described in the Annex for parts and labour.

REMARKS:

We have inspected the above-mentioned vehicle on a "Without Prejudice" basis.

Parts and Labour Assessment

Report No 0001-21-SHM

Vehicle No: SLE1874U

Description of part	Qty	Condition as inspected	Repairer's estimate	Our adjustment
Rear bumper /	1	squashed	1,218.20	1,218.20 <i>788.7</i>
Rear bumper corner retainer RH/LH <i>X SVC</i>	2	necessary	263.40	263.40 <i>X</i>
Rear bumper side garnish RH/LH /	2	deformed/fractured	302.00	302.00 /
Rear bumper reflector RH/LH <i>X SVC</i>	2	fractured	166.20	166.20 <i>X</i>
Rear bumper side retainer RH/LH <i>X SVC</i>	2	necessary	282.80	282.80 <i>X</i>
Rear bumper side shield clip <i>X SVC</i>	6	necessary	39.00	39.00 <i>X</i>
Rear bumper side shield RH/LH <i>X SVC</i>	2	reuse	375.44	0.00
Rear bumper tow hook cover <i>X SVC</i>	1	warped	43.20	43.20 <i>X</i>
Rear end panel - inner <i>X repair</i>	1	repair	581.24	0.00
Rear end panel - outer <i>X repair</i>	1	buckled	480.85	480.85 <i>X</i>
Rear end panel inner top garnish /	1	fractured	289.74	289.74 /
Rear end panel inner top garnish clip /	6	necessary	39.00	39.00 /
Rear end panel lock striker <i>X</i>	1	bent	56.00	56.00 <i>X</i>
Rear fender inner air vent RH/LH <i>X</i>	2	reuse	343.60	0.00
Rear antenna sensor <i>X</i>	1	shorted	127.00	127.00 <i>X</i>
Tailgate /	1	buckled	1,217.80	1,217.80 /
Tailgate logo "Toyota" /	1	necessary	79.20	79.20 <i>6835</i>
Tailgate emblem "Sienta" <i>X SVC</i>	1	necessary	61.70	61.70 <i>X</i>
Tailgate damper RH/LH <i>X SVC</i>	2	bent	583.40	583.40 <i>X</i>
Tailgate hinge RH/LH <i>X SVC</i>	2	bent	543.60	543.60 <i>X</i>
Tailgate inner handle <i>X SVC</i>	1	reuse	137.40	0.00
Tailgate mechanism lock /	1	bent	591.40	591.40 <i>489</i>
Rear number plate lamp RH/LH <i>X</i>	2	reuse	83.70	0.00
Tailgate outer garnish <i>X SVC</i>	1	fractured	281.80	281.80 <i>X</i>
Tailgate outer garnish clip <i>X SVC</i>	4	necessary	26.00	26.00 <i>X</i>
Tailgate outer handle <i>X SVC</i>	1	distorted	171.47	171.47 <i>X</i>
Tailgate weatherstrip <i>X SVC</i>	1	deformed	281.40	281.40 <i>X</i>
Tailgate windscreen moulding /	1	necessary	192.40	192.40 <i>130.2</i>
Tailgate wiper motor <i>X SVC</i>	1	shorted	581.72	581.72 <i>X</i>
Spare tyre panel <i>X SVC</i>	1	repair	791.55	0.00
Subtotal before discount			10,232.21	7,919.28 <i>3324.79</i>
Percentage discount 0% and 25%			0.00	1,979.82
Sub-total 1			10,232.21	5,939.46

2493.59

PAR Automotive Consultancy

Rear number plate c/w holder

Tailgate reverses camera

Tailgate windscreen sealant

Spare tyre panel insulator mat

1 bent

1 shorted

1 necessary

1 necessary

Subtotal before discount

Percentage discount 0% and 0%

Sub-total 2

Parts-total

50.00

550.00

100.00

250.00

950.00

0.00

950.00

11,182.21

50.00

550.00

80.00

250.00

930.00

0.00

930.00

6,869.46

LABOUR

1. To straighten and panel beating rear fender RH/LH, rear boot, floor panel, spare tyre panel and rear frame members. To cut and weld rear end panel. To remove and refit above parts.

2. To putty, re-spray painting and polish affected areas.

3. To check and rectify wiring system.

4. To remove and refit rear windscreen.

5. To rust proof affected areas.

2,000.00

2,000.00

120.00

150.00

150.00

Labour total

Parts & Labour total

1,500.00

1,320.00

50.00

120.00

60.00

4,420.00

15,602.21

3,050.00

9,919.46

Results of inspection of the accident vehicle are as shown above.

We have taken into consideration the age and condition of the vehicle in our recommendation.

Hence, the recommended cost of repairs based on LUMP SUM repairs is :
and the recommended number of working days for the repairs is :

\$8,400.00

9

B J Loi (I Eng MIMI ARTE)
Automotive Appraiser

3703.59

2950

40 days