

ASS. REC. BY:

REF: CT2/ 21001463/Kg f3Kenneth

ASSIGNMENT

From: _____ Date: _____

Estimated Cost: _____

OD / TP / WS / TP RES / OD RES / EVA / INV / MV

To Inspect Vehicle No: _____

at Workshop m/s Cheng Hwe

of _____

Insured: _____

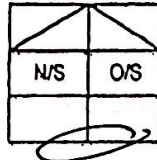
Policy No. DMB1SNW00003072002Claims No. SNM21D200575C02

Sum Insured: _____ Excess: _____

(Client's Record)

Make of Veh: _____

(Policy Condition)

Remark: The veh had commenced its
repair at the time of inspection.

Bal. or Market Value: _____

IDAC Accident Rpt: _____ Consistent?: Yes or No

GIA / PR Seen: _____ Consistent?: Yes or No

Est. Repairs: 06 days Res.: Yes or NoLum Sum: 1. B. / % 3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Date: _____ Person Contacted: _____

Vehicle: IN / OUT

Veh No: SMH 1206X Yr Regn: 01, 19

Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make: Toy Noah c.c. 1797Colour M. Black A/C: Insured / Std / NI / NASp. Reading 88823 T/Radio: Insured / Std / NI / NA

Eng/No: _____

C/No: ZWR80 0339728Gen. Cond: Good / Fair / Poor / Burnt

Steering: Inorder / Jammed / Leaked / Burnt or

Brake: Inorder / Jammed / Leaked / Burnt or

Modl: NII / SRIm / STD A/Rim or

Tyre Size: F: _____

R: 225/45R17BS / DUN / EXNOVA / GY / FS / LIZA / MIC OHTSU / PIR / SUMI /

TOYO / YOKO or

Front 8 mm Rear 8 mmR/Bal. 8 mm R/Bal. 8 mmL/Bal. 8 mm L/Bal. 8 mmD.O.A. 29/1/21 D.O.I. 17/2/2021

Survey held at _____

Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time	Action / Instruction
<u>1</u>	<u>GIA & Est not ready. Tailgate jammed</u>
	<u>Previously survey at Optima??</u>
	<u>Kenneth confirmed final fig \$4,153.00, 6 days. (Red \$2785, 40%)</u>

Date/Time, File Pass to?

☐: Prell. Report

1) 16/04 Typist

☐: Final Report

Date/Time, File Return to?

2)

Days Of Repair: 6Resurvey No. of Trip: 2

Survey Fee:

Transportation:

Add Fee: ☐: Site Insp (\$ _____) \$ - RS. \$ _____☐: Interview (\$ _____) \$ - RS. \$ _____☐: Tech Invs (\$ _____) \$ - RS. \$ _____☐: Weekend (\$ _____) \$ - RS. \$ _____

TOTAL

Report Format: MER-TPLump Sum / I.B.I: (\$ 4153)

TP3CHINA

ZWR800339728

SMH1206 X

buy

1 m rear bumper \$250 ✓

low cover \$15 ✓

side retainers \$38 ✓

side reflectors \$35 X

1 m earl gate

\$750 ✓

inner lock \$200 ✓

inner rubber \$155 ✓

inner trim board \$300 ✓

emblem 'MARIO' \$40 ✓

centre outer moulding \$380 ✓

\$55 ✓

1 m rear w/s moulding

\$280 ✓

1 m rear end panel outer
inner

1 m rear spare tyre compartment \$450 ✓

1 m rear 1/4 corner panel \$130 ✓

2 m earl lamp \$280 x 2 = \$560 ✓

\$3638

SMH 1206X

1 pr rear w/ gun
1 set reverse sensor
1 set reverse camera

mac #40/9N ✓

pd #200/9N ✓

#380/9N ✓

#100/ ✓

① RAR rear w/ glass

② RAR tail gate, rear upper assy,

tail lamps, rear ~~to~~ lock assy,

To cutting, welding and renew rear end
panel, rear spare tyre compartment.

KAR rear floor board panel,

rear dr side panel and realign
the same

#1200/ ?

③ RAR seat, carpet, & garnish etc

#1200/ 1000

④ Rusty & respray on rear floor board
panel, rear bumper, tail gate,

rear dr side panel

#1200/ 9000

⑤ Rustproof

#60/ ✓

#6938