

ASS. REC. BY:

REF:

CC4 | ALG 21001585 | Dga³

ASSIGNMENT

From: _____ Date: _____

Estimated Cost: _____

OD / TP / WS / TP RES / OD RES / EVA / INV / MV

To Inspect Vehicle No: _____

at Workshop m/s _____

of _____

Insured: _____

Policy No. _____


Claims No. _____

Sum Insured: _____ Excess: _____

(Client's Record)

Make of Veh: _____

(Policy Condition)

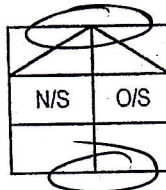Remark: The veh had commenced its
repair at the time of inspection.

Bal. or Market Value: _____

IDAC Accident Rpt: _____ Consistent? : Yes or No

GIA / PR Seen: _____ Consistent? : Yes or No

Est. Repairs: 9 days Res.: Yes or NoLum Sum: 20 % 3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Date: _____ Person Contacted: _____

Vehicle: IN / OUT

Veh No: SM3 442 D Yr Regn: Feb / 2020Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or _____

Make: Honda Fit C.C. 1317Colour: Blue A/C: Insured / Std / NI / NASp. Reading: 29212 T/Radio: Insured / Std / NI / NAEng/No: L13B 3935213C/No: GK33420722 *Gen. Cond: Good / Fair / Poor / BurntSteering: In order / Jammed / Leaked / Burnt or _____Brake: In order / Jammed / Leaked / Burnt or _____Modi: Nil S/Rim / STD A/Rim or _____Tyre Size: F: 185/60R15R: — 11 —

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or Yokohama

Front _____ Rear _____

R/Bal. S mm R/Bal. S mmL/Bal. S mm L/Bal. S mmD.O.A. 30/01/2021 D.O.I. 02/02/2021Survey held at Teamwork Pura Ubi

Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or

Rear & Front

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time _____ Action / Instruction _____

ALG SM3 7878RMV 55KLTA 18.6KHL 36.4K24/03/2021 known 2/3 15400/- with 9 days 7 days

Date/Time, File Pass to?

☐ : Preli. Report

1)

☐ : Final Report

Date/Time, File Return to?

2)

Rep. Format: _____

Lump Sum / L.B. (\$) _____

Days Of Repair: _____

Resurvey No. of Trip: _____

Add Fee:

☐ : Site Insp (\$ _____)☐ : Interview (\$ _____)☐ : Tech. Invs (\$ _____)☐ : Weekend (\$ _____)

Survey Fee:

Transportation:

S + RS. SI

Photos

Others

TOTAL

AIG

Vehicle number	SMS442D
Make / Model	HONDA FIT
Chassis number	GK33420722
Accident date	30/1/21
Reference	2102-03

Qty	Particulars	Unit Price - SGD \$	
PARTS REPLACEMENT - LIST ITEMS			
1	TAILGATE <i>Inc</i>	1012.81 ✓	845.20
2	TAILGATE HINGE <i>req</i>	89.02 X	
2	TAILGATE DAMPER <i>Inc</i>	277.62 X	
1	TAILGATE LOCK <i>Dem</i>	234.00 ✓	146.30
1	TAILGATE LOCK STRIKER <i>vt</i>	36.84 ✓	
1	TAILGATE INNER TRIM <i>Ht</i>	336.00 X	
1	TAILGATE GLASS MOULDING <i>Hec</i>	122.90 ✓	
1	TAILGATE OUTER GARNISH <i>broken</i>	348.00 ✓	250.80
1	TAILGATE EMBLEM LOGO <i>Hec</i>	45.60 ✓	
1	TAILGATE EMBLEM -FIT <i>Hec</i>	43.20 ✓	
1	TAILGATE WIPER MOTOR <i>vt</i>	354.00 ✓	274.40
1	TAILGATE INNER HANDLE COVER <i>defunct</i>	45.60 ✓	
1	REAR WIPER BLADE <i>Ht</i>	158.56 X	
1	REAR WIPER ARM <i>Ht</i>	170.56 X	
1	REAR BUMPER <i>Demol</i>	622.68 ✓	495.00
2	REAR BUMPER RETAINER o/s <i>crack</i> <i>H/S</i> <i>Ht</i>	78.48 ✓	39.24
2	REAR BUMPER SIDE COVER o/s <i>cut</i> <i>H/S</i> <i>Ht</i>	116.88 ✓	58.44
1	REAR BUMPER LOWER GARNISH <i>vt</i> <i>Demol</i>	482.44 ✓	178.70
1	REAR BUMPER TOW COVER <i>sv2</i>	42.00 X	
1	REAR BUMPER UNDERCOVER <i>Ht</i>	126.48 X	
1	KEYLESS SENSOR <i>Ht</i>	148.05 X	
1	KEYLESS SPEAKER <i>Ht</i>	161.60 X	
1	END PANEL <i>Demol</i>	692.00 ✓	373.50
1	END PANEL TOP GARNISH <i>defunct</i>	296.84 ✓	127.50
2	REAR EXTENSION PANEL RH/LH <i>Ht</i> <i>req</i>	689.68 X	
1	FLOOR COMPARTMENT <i>Demol</i>	956.88 ✓	780.40
1	SPARE TYRE TOP BOARD <i>vt</i>	347.64 ✓	240.30
1	SPARE TYRE TOOL SPONGE <i>form</i> <i>defunct</i>	294.00 ✓	198.20
2	REAR AIRVENT <i>2</i> <i>Ht</i>	140.88 X	
2	REAR FENDER o/s <i>Demol</i> <i>H/S</i> <i>req</i>	2809.44 ✓	726.00
2	REAR FENDER INNER TRIM <i>defunct</i> <i>vt</i> 333.84 x 2	816.00 ✓	667.68

5695.80

2	REAR TAILLAMP <i>broken</i>	740.88	✓	
2	REAR TAILLAMP PANEL <i>Dented.</i>	284.88	✓	
1	REAR EXHAUST SILENCER <i>bst</i>	744.44	✓	476.60
2	REAR EXHAUST MOUNTING <i>HM</i>	68.88	X	
2	REAR EXHAUST MUFFLER <i>HM</i>	1088.88	X	
1	BONNET <i>Bru</i>	680.04	✓	551.50
2	BONNET HINGE <i>bst</i>	116.88	✓	
1	BONNET INSULATOR <i>bst</i>	140.04	✓	
1	BONNET LOCK <i>bst</i>	182.44	✓	
1	FRONT GRILLE ASSY <i>crack HM HS</i>	309.60	X	
1	FRONT GRILLE CASING <i>broken</i>	462.00	✓	302.00
1	FRONT GRILLE TOP CHROME MOULDING <i>cut</i>	201.60	✓	
1	FRONT GRILLE BOTTOM CHROME MOULDING <i>broken</i>	189.60	✓	
1	FRONT GRILLE EMBLEM LOGO <i>cut / ruc</i>	82.44	✓	
1	FRONT BUMPER <i>Dented</i>	669.60	✓	517.70
2	FRONT BUMPER RETAINER <i>src</i>	91.20	X	
2	FRONT BUMPER SIDE GARNISH <i>HM</i>	213.12	X	
1	FRONT BUMPER REINFORCEMENT <i>Dented</i>	336.00	✓	
1	FRONT BUMPER TOW COVER <i>src</i>	38.40	X	
1	FRONT BUMPER LOWER GRILLE <i>src damaged</i>	238.44	✓	152.30
2	FRONT BUMPER LOWER GRILLE SIDE GARNISH <i>HM</i>	124.60	X	
2	FRONT HEADLAMP <i>broken</i>	3780.52	✓	2340.00
		1170.00 x 2		
2	FRONT HEADLAMP BRACKET <i>HM</i>	187.20	X	
1	SUPPORT PANEL <i>Dented</i>	482.40	✓	
1	SUPPORT PANEL TOP GARNISH <i>crack / broken</i>	182.44	✓	
1	ARCON CONDENSER ASSY <i>bst / punctured</i>	863.31	✓	
1	RADIATOR <i>punctured / windy broken</i>	1102.90	✓	
1	RADIATOR FAN COWLING <i>broken</i>	761.90	✓	
		26461.31		
		Less 20 %	5292.26	
		Subtotal	21169.09	
		Balance C/F	21169.09	
<u>PARTS REPLACEMENT - SPECIAL NETT ITEMS</u>				
1	FRONT NUMBER PATE <i>bst / ruc</i>	80.00	45/-	
1 SET	FRONT BUMPER CLIP <i>Hec</i>	30.00	20/-	
1 SET	FRONT SUPPORT PANEL TOP GARNISH CLIP <i>HM</i>	20.00	X	
1 BOT	COOLANT <i>HM</i>	60.00	X	
1	REAR NUMBER PLATE <i>Hec</i>	80.00	45/-	
1 SET	REAR BUMPER CLIP <i>Hec</i>	30.00	20/-	
1 SET	REAR FENDER INNER TRIM CLIP <i>Hec</i>	30.00	15/-	
1 SET	REAR TAILGATE INNER TRIM CLIP <i>HM</i>	20.00	X	
1 SET	REAR REVERSE SENSOR <i>Dam</i>	400.00	220/-	
1	REAR REVERSE CAMERA <i>HM</i>	600.00	X	
1	FLOOR INSULATOR <i>Hec</i>	120.00	50/-	
1	JOINT SEALANT <i>Hec</i>	120.00	40/-	
1	WINDSCREEN SEALANT <i>Hec</i>	120.00	40/-	
		Subtotal	1710.00	
		Balance C/F	22879.09	

10067-81

1170.00 x 2

15703.61

12562.88

Less 20 %

Subtotal

Balance C/F

PARTS REPLACEMENT - SPECIAL NETT ITEMS

495.00

<u>LABOUR AND MISCELLANEOUS CHARGES</u>		
1	CHECK ALL WIRING AND LIGHTNING SYSTEM	80.00 30/-
2	REMOVE, REFIT CONDENSER AND TOP UP GAS	150.00 120/-
3	REMOVE, REFIT RADIATOR AND TOP UP COOLANT	150.00 50/-
4	REMOVE AND RENEW REAR REVERSE SENSOR	120.00 40/-
5	REMOVE AND RENEW KEYLESS SENSOR	120.00 44
6	REMOVE, REFIT LINING, TRIM AND GARNISH	200.00 120/-
7	REMOVE AND RENEW REAR EXHAUST	120.00 60/-
8	REMOVE AND REFIT FUEL TANK	120.00 44
9	REMOVE AND REFIT REAR WINDSCREEN	120.00 80/-
10	CHASSIS BENCHMARK FOR CHASSIS ALIGNMENT	500.00 44
11	TRANSFER PARTS, ATTACHMENT FROM OLD TAILGATE TO NEW	200.00 60/-
12	PANEL BEATING ON AFFECTED AREAS	2600.00 1400/-
13	SPRAY PAINTING ON AFFECTED AREAS	2600.00 1400/-
14	APPLY ANTI RUST ON AFFECTED AREAS	150.00 40/-
Subtotal		7230.00
Grand total		30109.09

3800.00

1600/-

1600/-


02/02/2021 @ 1600hrs

H/A Antura

L/smr 9 days.

Man

LKK Auto

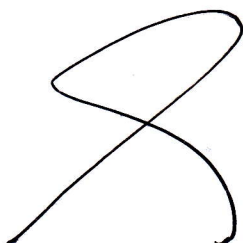

16857-88

Supp 2486.19

19344.07

L/S 15400/-

Check Part prices

Check Repair Limit.

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

REPAIR PERFORMANCE INVOICE

AIG

Vehicle number	SMS442D
Make / Model	HONDA FIT
Chassis number	GK33420722
Accident date	30/1/21
Reference	2102-03

Qty	Particulars	Unit Price - SGD \$
<u>PARTS REPLACEMENT - LIST ITEMS</u>		
1	INTAKE MANIFOLD <i>crack/broken</i>	700.92 ✓
1	BATTERY <i>distorted/damaged</i>	290.40 ✓
1	TAILGATE WEATHERSTRIP <i>damaged</i>	166.20 ✓
2	TAILGATE LAMP <i>mostly crack</i>	621.12 ✓
2	FRONT FENDER BRACKET <i>1st</i>	180.80 ✓
2	FRONT FENDER <i>crack</i>	1410.82 ✓
1	BATTERY TRAY <i>crack/broken</i>	76.60 ✓
1	WIPER TANK <i>damaged/broken</i>	156.80 ✓
		3603.66
		Less 20 %
		720.73
		Subtotal
		2882.93
		2720.24
		2176.19
		80.00 SH
<u>LABOUR AND MISCELLANEOUS CHARGES</u>		
1	R&R REAR SEAT TO FACILITATE REPAIR <i>HL</i>	300.00 ✗
2	R&R INTAKE MANIFOLD	300.00 150/-
3	RE-SEAL WEEKEND SEAL <i>HL</i>	150.00 80/-
		230.00
		Subtotal
		750.00
		Grand total
		3448.93

80/- SH

817.80

2486.19

Jan
2kk Auto
[Signature]