



## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

### TAX INVOICE

EQ INSURANCE COMPANY LTD

5 MAXWELL ROAD  
#17-00 TOWER BLOCK  
MND COMPLEX  
SINGAPORE 069110

INV No. AC2102258

INV Date 06/04/2021

Reference CC3/EQI21001607/Ktf3q2

Code EQI

#### PROFESSIONAL SERVICE FEE

Vehicle No. SMR 9062M  
Insured Veh. SLU 9027L  
Claim No. DM21HO00186-JG  
Policy No.  
Accident Date 31/01/2021  
Inspection Date 02/02/2021

Description	Total
Survey Inspection	300.00
Resurvey Inspection	
Digital Photographs	
Transportation	
<b>Subtotal</b>	<b>300.00</b>
<b>GST (7%)</b>	<b>21.00</b>
<b>Grand Total</b>	<b>321.00</b>

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

**LKM**



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

## Affiliated to Federation Internationale Des Experts En Automobile

EQ INSURANCE COMPANY LTD  
5 MAXWELL ROAD  
#17-00 TOWER BLOCK  
MND COMPLEX SINGAPORE 069110

Ref: CC3/EQI21001607/Ktf3q2

Date: 06/04/2021

Code: EQI

### 1. Policy Particulars :- THIRD PARTY CLAIM

<b>Insured Veh.</b>	SLU 9027L	<b>Veh. Inspected</b>	SMR 9062M
<b>Policy No.</b>		<b>Coverage (\$)</b>	0.00
<b>Claim No.</b>	DM21HO00186-JG	<b>Excess (\$)</b>	0.00
<b>Assign From</b>		<b>Assign Date</b>	02/02/2021

### 2. Vehicle Particulars & Condition

<b>Make &amp; Model</b>	TOYOTA PRIUS (A)	<b>c.c</b>	1798
<b>Engine No.</b>	HIDDEN	<b>Year of Reg.</b>	2020
<b>Chassis No.</b>	JTDKB3FU503091053	<b>Colour</b>	METALLIC RED
<b>Odometer</b>	106682 KM	<b>Steering</b>	IN ORDER
<b>Brakes</b>	IN ORDER	<b>Modification</b>	STANDARD ALLOY RIM
<b>General</b>	GOOD		

### 3. Conditions of Tyres

	Size	Make	Balance
<b>R/H Front Tyre</b>	195/65 R15	SAILUN	9 mm
<b>L/H Front Tyre</b>	195/65 R15	SAILUN	9 mm
<b>R/H Rear Tyre</b>	195/65 R15	SAILUN	9 mm
<b>L/H Rear Tyre</b>	195/65 R15	SAILUN	9 mm

### 4. Description of Damages

THE VEHICLE SUSTAINED DAMAGES AT THE REAR & FRONT PORTION.  
DAMAGES SEE DETAILS.

### 5. General Information

<b>Accident Date</b>	31/01/2021	<b>Inspection Date</b>	02/02/2021
<b>Survey held at</b>	TRANS-CAB AUTO SERVICES PTE LTD NO.2 ANG MO KIO ST 63 SINGAPORE 569111		

### 5a. Remarks

A) THE INSPECTION WAS CONDUCTED ON A "WITHOUT PREJUDICE" BASIS.  
B) IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.

### 5b. Estimate Days of Repair

ESTIMATED NORMAL PERIOD FOR REPAIR: **7 Working Days**



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 4

## ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SMR 9062M

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
<b>REPLACEMENT OF PARTS</b>				
1	COVER ,REAR BUMPER	BUCKLED / CRACKED	485.60	485.60
1	REINFORCEMENT SUB-ASSY ,REAR BUMPER	BENT	332.70	332.70
1	COVER ,REAR BUMPER ,LOWER	DENTED	22.00	22.00
1	GUARD ,REAR BUMPER ,CENTER	BENT	374.50	374.50
1	RETAINER ,REAR BUMPER SIDE ,LH	NO SUCH PARTS	132.60	-
1	RETAINER ,REAR BUMPER SIDE ,RH	NO SUCH PARTS	132.60	-
1	REFLECTOR ASSY ,REFIX LH	SERVICEABLE	39.00	-
1	REFLECTOR ASSY ,REFIX RH	SCRATCHED	39.00	39.00
1	PANEL SUB-ASSY ,BACK DOOR	BENT	1,147.80	1,147.80
1	COVER ,REAR COMBINATION LAMP ,RH	SERVICEABLE	69.90	-
1	COVER ,REAR COMBINATION LAMP ,LH	SERVICEABLE	69.90	-
1	BOARD ASSY ,BACK DOOR TRIM	SERVICEABLE	259.20	-
1	WEATHERSTRIP ,BACK DOOR	SERVICEABLE	372.30	-
1	MOULDING ,BACK DOOR OUTSIDE GARNISH ,LOWER RH	SERVICEABLE	56.50	-
1	BOARD ,BACK DOOR TRIM	SERVICEABLE	225.20	-
1	LENS & BODY ,REAR COMBINATION LAMP ,LH	SERVICEABLE	339.60	-
1	LENS & BODY ,REAR COMBINATION LAMP ,RH	SERVICEABLE	339.60	-
1	LENS & BODY ,REAR COMBINATION LAMP ,NO.2 LH	SERVICEABLE	261.00	-
1	LENS & BODY ,REAR COMBINATION LAMP ,NO.2 RH	SERVICEABLE	261.00	-
1	LAMP ASSY ,REAR ,LH	SERVICEABLE	293.60	-
1	LAMP ASSY ,REAR ,RH	SERVICEABLE	293.60	-
1	PANEL ASSY ,DECK TRIM SIDE ,RH	SERVICEABLE	355.90	-
1	COVER ,FRONT BUMPER	BUCKLED / DENTED	521.00	521.00
1	BRACKET ,FRONT BUMPER EXTENSION MOUNTING	SERVICEABLE	110.50	-
1	REINFORCEMENT SUB-ASSY ,FRONT BUMPER	TO REPAIR SEE LABOUR	716.60	-
1	REINFORCEMENT ,FRONT BUMPER ,NO.2	TO REPAIR SEE LABOUR	246.10	-
1	ABSORBER ,FRONT BUMPER ,LOWER	SERVICEABLE	132.70	-
1	ABSORBER ,FRONT BUMPER ENERGY	SERVICEABLE	80.20	-

Report Ref No. CC3/EQI21001607/Ktf3q2



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 4

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	SUPPORT FRONT BUMPER SIDE ,RH	SERVICEABLE	80.10	-
1	SUPPORT FRONT BUMPER SIDE ,LH	SERVICEABLE	82.30	-
1	EXTENSION ,FRONT BUMPER ,RH	SERVICEABLE	120.10	-
1	EXTENSION ,FRONT BUMPER ,LH	SERVICEABLE	120.10	-
1	COVER ,FRONT BUMPER HOLE ,LH	SERVICEABLE	30.20	-
1	COVER ,FRONT BUMPER HOLE ,RH	MISSING	30.20	30.20
1	LAMP ASSY ,FOG, LH	SERVICEABLE	237.10	-
1	LAMP ASSY ,FOG, RH	SERVICEABLE	237.10	-
1	UNIT ASSY ,HEADLAMP ,LH	SERVICEABLE	2,637.60	-
1	COMPUTER SUB-ASSY ,HEADLAMP ,LH NO.1	SERVICEABLE	3,772.50	-
1	UNIT ASSY ,HEADLAMP ,RH	SERVICEABLE	2,637.60	-
1	COMPUTER SUB-ASSY ,HEADLAMP ,RH NO.1	SERVICEABLE	3,772.50	-
1	GRILLE SUB-ASSY ,RADIATOR	DENTED / CRACKED	422.50	422.50
1	GRILLE RADIATOR ,LOWER NO.1	SERVICEABLE	178.60	-
1	EMBLEM ASSY ,RADIATOR GRILLE	SERVICEABLE	105.80	-
1	GRILLE RADIATOR	SERVICEABLE	160.50	-
1	HOOD SUB-ASSY	TO REPAIR SEE LABOUR	983.10	-
1	HINGE ASSY ,HOOD ,LH	TO REPAIR SEE LABOUR	58.90	-
1	HINGE ASSY ,HOOD ,RH	TO REPAIR SEE LABOUR	58.90	-
1	BRACE ,HOOD LOCK SUPPORT	TO REPAIR SEE LABOUR	78.30	-
1	GUIDE ,RADIATOR AIR NO.1 LH	SERVICEABLE	69.90	-
1	GUIDE ,RADIATOR AIR NO.1 RH	SERVICEABLE	65.30	-
1	GUIDE ,RADIATOR AIR NO.3	SERVICEABLE	112.70	-
1	SEAL ,RADIATOR TO SUPPORT ,NO.3	SERVICEABLE	32.40	-
1	SEAL ,RADIATOR TO SUPPORT ,NO.2	SERVICEABLE	32.60	-
1	INLET ,AIR CLEANER NO.3	SERVICEABLE	42.10	-
1	INLET ,AIR CLEANER NO.2	SERVICEABLE	112.70	-
1	JAR ASSY ,WINDSHIELD WASHER	SERVICEABLE	219.10	-
	LESS 25% DISCOUNT		-6,050.25	-843.83
			18,150.75	2,531.47

Report Ref No. CC3/EQI21001607/Ktf3q2



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:3 of 4

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
<b><u>NETT ITEMS</u></b>				
1	REAR TAILGATE TOYOTA LOGO (N)	NECESSARY	47.90	47.90
1	REAR TAILGATE WORDING 'PRIUS' (N)	NECESSARY	54.60	54.60
1	REAR TAILGATE WORDING 'HYBRID' (N)	NECESSARY	54.60	54.60
	LESS 25% DISCOUNT		-	-39.27
			157.10	117.83
<b><u>SPECIAL NETT ITEMS</u></b>				
1	SET PARKING AID (SN)	SHORTED	700.00	200.00
1	SET REAR BUMPER CLIP (SN)	NECESSARY	85.00	50.00
2	REAR WINDSCREEN SEALANT (SN)	NECESSARY	150.00	80.00
1	WINDSCREEN MOULDING (SN)	NECESSARY	200.00	200.00
1	REAR WINDSCREEN INNER SPONGE SEAL (SN)	NECESSARY	130.00	30.00
1	REAR BUMPER PROTECTOR (SN)	NO SUCH PARTS	180.00	-
2	SEAM SEALANT (SN)	NOT NECESSARY	250.00	-
1	SET BUMPER CLIP FRT (SN)	NECESSARY	80.00	50.00
1	FRONT NUMBER PLATE WITH MOULDING (SN)	BENT	200.00	45.00
1	SET CLIP ,FRONT FENDER LINER (SN)	NOT NECESSARY	70.00	-
1	SET FRNT BUMPER RETAINER CLIP (SN)	NOT NECESSARY	70.00	-
1	SET REAR BUMPER RETAINER CLIP (SN)	NOT NECESSARY	70.00	-
1	FRT NUMBER PLATE WITH HOLDER (SN)	NOT NECESSARY	190.00	-
1	SET REAR COMBINATION LAMP CLIP (SN)	NOT NECESSARY	55.00	-
1	END PANEL TRIM CLIP (SN)	NOT NECESSARY	60.00	-
1	REAR SPOILER CLIP (SN)	NOT NECESSARY	60.00	-
			2,550.00	655.00
<b><u>LABOUR</u></b>				
	TO REMOVE AND REFIT INTERIOR FITTINGS,TRIMINGS,GARNISH,FITTINGS AND OTHER ,TO ENABLE REPAIR.		380.00	50.00
	TO TRANSFER OF FRONT BUMPER FITTINGS ,ATTACHMENTS AND PERFORM WATER SEEPAGE TEST.	NOT NECESSARY	170.00	-



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:4 of 4

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	PANEL BEATING ,KNOCKING AND STRAIGHTENING THE NECESSARY PORTION,REMOVE AND RENEWAL OF PARTS ,ADJUST AND REALIGN THE SAME.INCLUSIVE OF THE REPAIR OF REINFORCEMENT SUB-ASSY ,FRONT BUMPER,REINFORCEMENT ,FRONT BUMPER ,NO.2,HOOD SUB-ASSY,HINGE ASSY ,HOOD ,LH,HINGE ASSY ,HOOD ,RH AND BRACE ,HOOD LOCK SUPPORT .		2,000.00	700.00
	TO TRANSFER OF REAR END PANEL FITTINGS ,ATTACHMENTS AND PERFORM WATER SEEPAGE TEST.	NOT NECESSARY	380.00	-
	TO TRANSFER OF REAR BUMPER FITTINGS ,ATTACHMENTS AND PERFORM WATER SEEPAGE TEST.	NOT NECESSARY	170.00	-
	TO TRANSFER OF TAILGATE FITTINGS ,ATTACHMENTS AND PERFORM WATER SEEPAGE TEST.	NOT NECESSARY	170.00	-
	TO CHECK STEERING GEOMETRY AND COMPUTER WHEEL ALIGNMENT .	NOT NECESSARY	220.00	-
	TO RUST-PROOFING AND APPLY UNDERCOAT OF THE AFFECTED AREAS .	NOT NECESSARY	250.00	-
	TO REMOVE AND REFIT REAR BIG AND SMALL W/SCREEN GLASS TO FACILITATE BODYWORK REPAIR .		280.00	180.00
	PUTTY AND SPRAY PAINTING OF THE AFFECTED PORTION .		2,000.00	1,100.00
	TO REINSTALL REAR BUMPER PARKING SENSOR .		170.00	50.00
	TO CHECK ELECTRICAL LIGHTING CONCERNED .		170.00	40.00
	TO TRANSFER OF TIRE,RIM AND ON WHEEL BALANCING .	NOT NECESSARY	170.00	-
	TO REMOVE AND REFIT REAR EXHAUST PIPE TO FACILITATE BODYWORK REPAIR .	NOT NECESSARY	170.00	-
			6,700.00	2,120.00
<b>GRAND TOTAL</b>			<b>27,557.85</b>	<b>5,424.30</b>
<b>RECOMMENDED COST OF REPAIRS</b>				<b>5,424.30</b>

Report Ref No. CC3/EQI21001607/Ktf3q2

**KONG SENG CHEONG**

Licensed Appraiser

**DISCLAIMER OF LIABILITY TO THIRD PARTIES:-** This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



# SINGAPORE POLICE FORCE

Police Station Of Origin:  
Yishun North N.P.C  
31 Yishun Central SINGAPORE 768827  
Tel No: 1800-8529999



T/20210201/2128

1 of 3

Report No. T/20210201/2128

## REPORT OF A TRAFFIC ACCIDENT

Date/Time Report Made: 01/02/2021 19:08	Vide Report No.: T/20210131/7035	Station Diary No.: 106
--	-------------------------------------	---------------------------

Informant's Particulars			
Name of Informant: CHAN PENG FAI		Address: APT BLK 265 YISHUN STREET 22 #03-216 SINGAPORE 760265	
ID Type / ID No.: NRIC NO / S1601892I		Contact No.: Home/Office:	Mobile: 98785093
Nationality: SINGAPORE CITIZEN		Email:	
Sex: Male	Age: 57	Date of Birth: 15/03/1963	Type of Informant: Driver
Race: Chinese		Language:	Institution / School Name:
Occupation: DRIVER		Driving Licence Information: Class:	Date of Expiry:

General Information of the Accident				
Type of Accident:	Injury Others	Drink Drive: No	Date/Time of Accident: 31/01/2021 15:25	Type of Location: Flyover
Location: CENTRAL EXPRESSWAY				
Lamp Post Number: 98				
Weather: Clear		Road Surface: Dry	Road Speed Limit:	
Traffic Flow:		Traffic Control:	Traffic Volume: Heavy	
Type of Collision: Vehicle Chain Collision			Anyone conveyed by ambulance: No	

Details of Vehicle Involved						
Vehicle No.	Type	Make	Model	Color	Condition	No of Passenger
SJF7685C	Car	HONDA	STREAM 1.8X A	Black		0
SLU9027L	Car	OPEL	ASTRA HB 1.0 AT	White		0
SMR9062M	Car	TOYOTA	PRIUS 5DR HATCHBAC K (AUTO)	Red		0



# SINGAPORE POLICE FORCE



T/20210201/2128

2 of 3

Report No. T/20210201/2128

Police Station Of Origin:  
Yishun North N.P.C  
31 Yishun Central SINGAPORE 768827  
Tel No: 1800-8529999

## CONTINUATION OF REPORT

### Brief Details.

- 1) I had lodged a Traffic Police Reference T/20210131/7035. I would like to add on more information for the report that I lodged.
- 2) On 31 January 2021 at about 1525hrs, My vehicle ( SMR9062M ) along CTE towards SLE near LP 98 on the second lane from the right. There was a vehicle ( SJF7685C ) stopped in-front of my vehicle due to the traffic.
- 3) I stopped my vehicle gradually. However there was a vehicle ( SLU9027L ) came from the rear and knocked onto my vehicle causes my vehicle to moved forward and knocked onto the vehicle ( SJF7685C ) in-front of me.
- 4) All of us checked on the vehicle and exchanged particulars.
- 5) I went to the clinic and was given 4 days of medical leave and two of my passengers were given 3 days of medical leave.

PLEASE ATTACH A COPY OF YOUR VEHICLE'S INSURANCE CERTIFICATE TO THIS REPORT IF YOU DON'T HAVE THE CERTIFICATE WITH YOU NOW, PLEASE FAX A COPY TO 654 74805 Citing the report number as refer-ence

Signature Of Officer Rectifying The Report Sgt. Alan Yip LEONG, ALASTAIR	Signature Of Driver [Signature]
Signature Of Interpreter Not applicable	Date Of Report 31/01/2021
Officer In Charge Of Case Supt. RIZWAN BIN KAMALUDIN Contact No: 99471145	Classification [Signature]



# LKK Auto Consultants Pte Ltd


51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SMR 9062M

INSPECTION

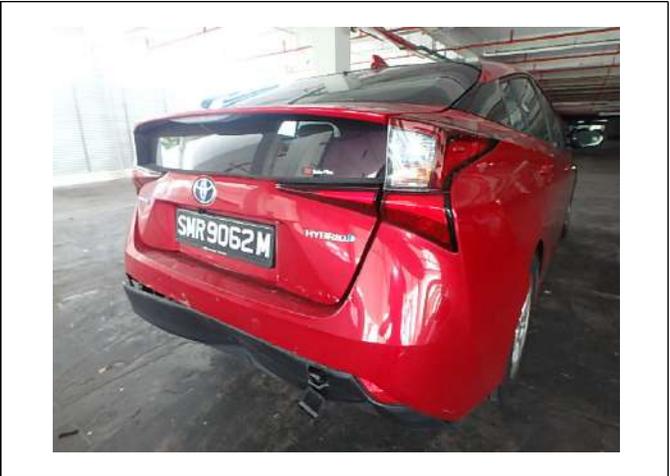




# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

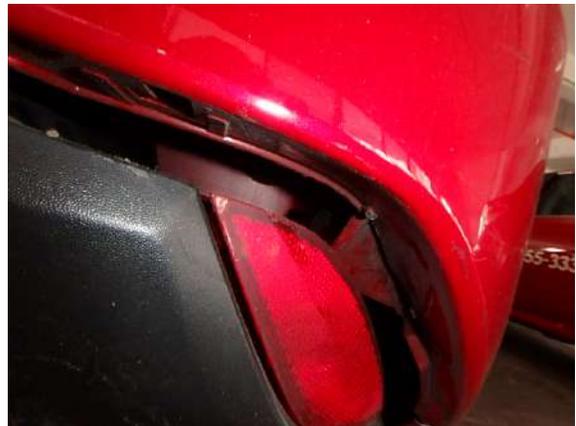



## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SMR 9062M

RE-INSPECTION

