



K A A S
kelvin automotive appraising services

6 tampines st 73, #01-03, singapore 528825
tel: 6746 2118 fax: 6746 1148
reg no: 53058468m

Insured : -
Policy No. : -
Sum Insured : -
Excess : -
Our Reference : KAAS/TA/5138/0076/TP/08.18
Date : 11 September 2018

To: Lim Chee Wee
c/o 25 Kaki Bukit Road 4
#01-55, Synergy @ Kaki Bukit
Singapore 417800

VEHICLE APPRAISAL REPORT

Name of Workshop : Apex Motoring
Place of inspection : 25 Kaki Bukit Road 4 #01-55, Synergy @ Kaki Bukit, Singapore 417800
Date of Assignment : 25 August 2018
Date of Accident : 23 August 2018
Date of Inspection : 25 August 2018

PARTICULARS OF INSPECTED VEHICLE

Registration No.	: SKX 76A	Engine No.	: Hidden From View
Make/Model	: Mercedes Benz GLC250 4matic Coupe (A)	Chassis Frame No.	: WDC2533462F442770
Year of Manufacture/Reg	: 2018	Colour	: White
Class/Type	: Coupe	Odometer Reading	: 3,957 KM

CONDITION OF VEHICLE DURING SURVEY (Visual & Static Check Only)

General Condition	: Good	Undercarriage (Front)	: Serviceable
Paintwork	: Good	Undercarriage (Rear)	: Serviceable
Footbrakes	: Serviceable	Market Value	: -
Steering	: Serviceable	Scrap Value (PARF/OMV)	: -

CONDITION OF TYRES ON VEHICLE

	<u>Make/Size</u>	<u>Thread Balance</u>
Front Left	HANKOOK 235 / 55 R19	8 mm
Rear Left	HANKOOK 235 / 55 R19	8 mm
Front Right	HANKOOK 235 / 55 R19	8 mm
Rear Right	HANKOOK 235 / 55 R19	8 mm

*The above is an estimate of the remaining life of the tyre thread in millimeters

The information contained in these documents may be privileged and confidential, and is intended for the exclusive use of the addressee designation. If you are not the addressee, any enclosure, reproduction, distribution or other dissemination or use of this communication is strictly prohibited. If you have received this survey report in error, please contact us immediately by phone so that we can arrange for its return.



Our Reference : KAAS/TA/5138/0076/TP/08.18
 Vehicle Number : SKX 76A

6 tampines st 73, #01-03, singapore 528825
 tel: 6746 2118 fax: 6746 1148
 reg no: 53058468m

APPRAISEMENT SCHEDULE

S/N	Qty	Descriptions	Comments/ Conditions	Repairer's Estimate	Revised Amount
LIST ITEMS:-					
1	1 pc	Front bumper	Deformed	\$ 1,450.00	\$ 1,450.00
2	1 pc	Front bumper lh side retainer	Necessary	\$ 170.00	\$ 170.00
3	1 set	Front bumper fasteners	Necessary	\$ 35.00	\$ 35.00
4	1 pc	Front bumper parking sensor	Not Working	\$ 275.00	\$ 275.00
5	1 pc	LH headlamp assy	Cracked	\$ 2,700.00	\$ 2,700.00
6	1 pc	LH front fender	Damaged	\$ 815.00	Repair
7	1 pc	LH front fender inner shield	Deformed	\$ 155.00	\$ 155.00
8	1 set	LH front fender inner shield fasteners	Necessary	\$ 32.00	\$ 32.00
9	1 pc	LH front fender arch moulding	Broken	\$ 275.00	\$ 275.00
10	1 set	LH front fender arch moulding fasteners	Necessary	\$ 28.00	\$ 28.00
11	1 pc	LH front lower arm	Bent	\$ 650.00	\$ 650.00
12	1 pc	LH front wheel bearing	Damaged	\$ 550.00	\$ 550.00
				\$ 7,135.00	\$ 6,320.00
Less 10%					\$ 632.00
				\$ 7,135.00	\$ 5,688.00
SPECIAL NETT ITEMS:-					
13	1 pc	LH front sports rim	Distorted	\$ 1,500.00	\$ 1,500.00
14	1 pc	LH front tyre @50% depreciation	Scratched	\$ 450.00	\$ 225.00
				\$ 1,950.00	\$ 1,725.00
Sub - Total				\$ 9,085.00	\$ 7,413.00



Our Reference : KAAS/TA/5138/0076/TP/08.18
 Vehicle Number : SKX 76A


6 tampines st 73, #01-03, singapore 528825
 tel: 6746 2118 fax: 6746 1148
 reg no: 53058468m

APPRAISEMENT SCHEDULE

S/N	Qty	Descriptions	Comments/ Conditions	Repairer's Estimate	Revised Amount
		B/F		\$ 9,085.00	\$ 7,413.00
		LABOUR & OTHER CHARGES:-			
1		To panel beat and renewal of all necessary damaged body parts		\$ 1,170.00	\$ 1,080.00
2		To realign headlamp focus		\$ 35.00	\$ 20.00
3		To check wiring and rewire		\$ 60.00	\$ 50.00
4		To remove and reinstall front undercarriage items		\$ 350.00	\$ 320.00
5		To perform 4 wheel alignment		\$ 120.00	\$ 100.00
6		To apply anti-rust		\$ 120.00	\$ 100.00
7		To putty and spray-paint of affected areas		\$ 960.00	\$ 880.00
				\$ 2,815.00	\$ 2,550.00
			Sub - Total	€ 11 000.00	€ 9 063.00

ASSESSMENT SUMMARY

Damages sustained were consistent with the subject vehicle being involved in a collision with another vehicle and the impact was delivered to the LH Front portion from rear to front; left to right; of the vehicle.

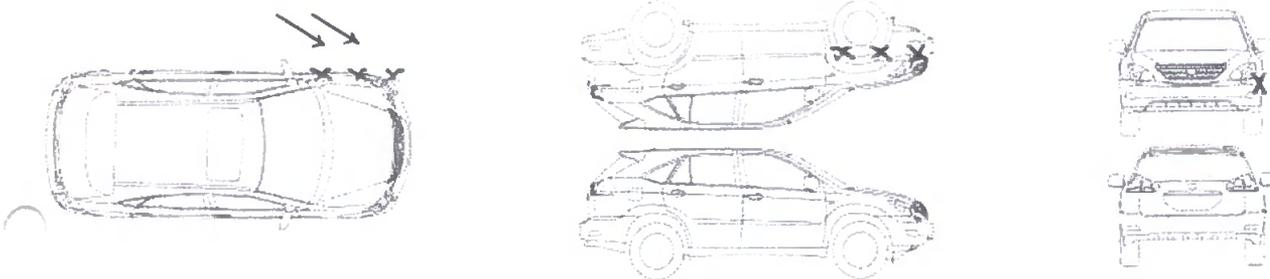

The general area of damages is at the **LH Front portion**
(Please refer to the parts list and photographs as attached for more information)

ASSESSOR'S RECOMMENDATIONS

The estimated repair costs submitted by Messrs **Apex Motoring** is \$ 11,900.00 .
We have adjusted the cost to \$ 9,963.00 and the repairer has agreed to undertake the repairs at a **Contract Lump Sum of \$ 8,450.00** to a acceptable quality and standards.
However, we have not given authorization and instruction to the repairer to proceed with the repairs.

The repairs should be completed within a reasonable period of **5** working days.

32 photographs were taken at the time of static inspection.

This report is strictly done in a **Without Prejudice Basis**.

We are reverting the matter to you a decision.

We enclose herewith our Invoice No. **5138** for our services rendered and we thank you for engaging our services.

Kelvin Automotive Appraising Services



KELVIN TEO
Licensed Automotive Appraiser
Nitec in Automotive Technology
Dip MS
MSAAA

