

Allied

Auto Appraisal

Our Reference : 20/0058/TP
Invoice Number : 1643


Date: 1 December 2020

M/s AG Teck Choon Logistics Pte Ltd
C/o 2 Kaki Bukit Avenue 2
#02-17 Kaki Bukit Autohub
Singapore 417921

INVOICE

DESCRIPTION	AMOUNT S\$
Professional Inspection Fee (XD 4475 G)	\$405.00
Coloured Photographs (69 pieces)	\$69.00
Transport Fee	\$60.00
Re-inspection Fee (26/11/2020, 27/11/2020 & 30/11/2020)	\$240.00
TOTAL	<u>\$774.00</u>

*Terms of payment: Cash on delivery
All payments payable to "Allied Auto Appraisal"*

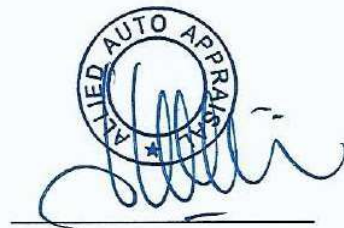

Allied Auto Appraisal

Allied Auto Appraisal
10 Hougang Street 92 ■ #07-02 ■ Singapore 538687
■ Email: alliedauto@ymail.com
Company Registration No.: 53127785B

Allied

Auto Appraisal

Our Ref : 20/0058/TP
Your Ref : Not Advised

Date: 23 November 2020

M/s AG Teck Choon Logistics Pte Ltd
C/o 2 Kaki Bukit Avenue 2
#02-17 Kaki Bukit Autohub
Singapore 417921

ACCIDENT DAMAGED VEHICLE INSPECTION REPORT (WITHOUT PREJUDICE)

Detailed accounts of our inspection are as follows:

(1) REFERENCE

Name of Claimant	: M/s AG Teck Choon Logistics Pte Ltd	Date of Request	: 23 November 2020
Policy Number	: 5112208399-01-000003	Referred By	: Insured
Claim Number	: Not Advised	Date of Inspection	: 23 November 2020
Accident Date	: 28 October 2020	Date of Re-inspection	: 26 Nov, 27 Nov & 30 Nov 20
Repairer	: M.S. Panel Beating Workshop	Sum Insured	: Not Applicable
	: 2 Kaki Bukit Avenue 2	Excess Amount	: Not Applicable
	: #02-17 Kaki Bukit Autohub	3rd Party Vehicle	: SDK 6168 E
	: Singapore 417921	3rd Party Insurer	: AIG Asia Pacific Insurance Pte Ltd

(2) PARTICULARS OF VEHICLE

Registration Number	: XD 4475 G	Mileage	: 493,818 km
Make & Model	: Scania P380CA4X2MSZ	Chassis Number	: XLEP4X20005237724
Date of Registration	: 11 January 2011	Engine Number	: 6617653
Colour	: Multicolor	Engine Capacity	: 11,705 cc


(3) PRE-ACCIDENT CONDITION (STATIC TEST ONLY)

Steering	: In order	Paint Work	: Good
Footbrake	: In order	Modification	: Nil
Handbrake	: In order	General Condition	: Average

(4) TYRE CONDITION

	Remaining Thread Depth (%)	Make	Size
Front right tyre	60%	Inning	315/80R22.5
Front left tyre	80%	Fromway	315/80R22.5
Rear right tyre	70%	Inning	315/80R22.5
Rear left tyre	70%	Hilo	315/80R22.5

(5) POINT OF IMPACT

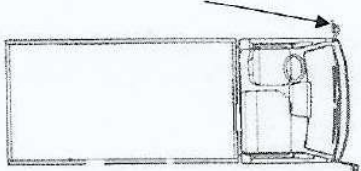Mainly on the near-side front portion.	
--	--

(6) GENERAL DESCRIPTION OF DAMAGES

The impact of the collision has damaged/affected the left headlamp, left front side & signal lamp, left headlamp top garnish, left front side bumper, left 2nd step board, left 2nd step board garnish, left 2nd step board garnish reflector, left 1st step plate panel, left front wheel front mudguard and etc.

Please refer to the Annex for a detailed account of the damages and photographs taken.

(7) RECOMMENDATION

We have inspected thoroughly the actual damages found on the vehicle before we conclude as to whether the parts needed replacement or repairs. The estimated cost of repair submitted by the repairer is **\$10,895.70**. We have adjusted the cost and recommend that the repairs to be taken on a part by part basis of **\$6,636.00**. In our opinion, the damaged parts are consistent with that caused by the accident.

(8) REMARKS

We have not authorised the repairs. However, for information, under normal circumstances, the period of repair should not exceed **6** working days.

This inspection was conducted on a "**Without Prejudice**" basis.

We are pleased to advise that the inspection work was carried out accordingly, and hereby submit our Appraisal Report and photographs.

Allied Auto Appraisal


H. C. Ng
Motor Vehicle Appraiser

ANNEX

REPAIR DETAILS (XD 4475 G)

Recommended Parts

No	Qty	Particulars	Condition	Repairer's Amount	Adjuster's Amount
1	1	Headlamp Assembly - N/s	Casing Broken	971.00	971.00 ✓
2	1	Front Side & Signal Lamp - N/s	Cracked/Broken	674.00	674.00 574 ✓
3	1	Headlamp Top Garnish - N/s	Grazed - To Re-paint NN	1,120.00	0.00
4	1	Front Side Bumper - N/s	Dented/Cracked	1,719.00	1,719.00 1519 ✓
5	1	2 nd Step Board - N/s	Grazed - To Re-paint NN	2,025.00	0.00
6	1	2 nd Step Board Garnish - N/s	Holder Broken	1,184.00	1,184.00 ✓
7	1	2 nd Step Board Garnish Reflector - N/s	Grazed	32.00	32.00 ✓
8	1	1 st Step Plate Panel - N/s	Cracked/Broken	356.00	356.00 274 ✓
9	1	Front Wheel Front Mudguard - N/s	Grazed - To Re-paint NN	679.70	0.00
Sub-Total				8,760.70	4,936.00
Less 0%				0.00	0.00
Total Parts (S\$)				8,760.70	4,936.00

Recommended Labours

No	Particulars	Repairer's Amount	Adjuster's Amount
1	To repair left headlamp top garnish, left 2 nd step board and left front wheel front mudguard including replacement of the left front accident damaged parts.	900.00	600.00 400
2	To check front lightings and electrical wiring system include focusing both headlights and adjust if necessary.	80.00	50.00 30
3	To putty and re-spray painting on left headlamp top garnish, left front side bumper, left 2 nd step board, left 2 nd step board garnish and left front wheel front mudguard.	1,155.00	1,050.00 500
Total Labour (S\$)		2,135.00	1,700.00
Total Repair Cost (S\$)		10,895.70	6,636.00

Adjusted Repair Cost (Part by Part basis)

S\$6,636.00

4 repair days