



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

LONPAC INSURANCE BHD

300 BEACH ROAD
#17-04/07 THE CONCOURSE
SINGAPORE 199555

INV No. AC2104060

INV Date 10/06/2021

Reference CC4/LPC21002057/Uba3q2

Code LPC2

PROFESSIONAL SERVICE FEE

Vehicle No. SMK 5791E
Insured Veh. GBC 7006Z
Claim No. 20/21/21/VC00/024227
Policy No. Z/20/VC00/107490
Accident Date 09/02/2021
Inspection Date 22/02/2021

Description	Total
Third Party Express Settlement	400.00
Subtotal	400.00
GST (7%)	28.00
Grand Total	428.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
LONPAC INSURANCE BHD 300 BEACH ROAD #17-04/07 THE CONCOURSESINGAPORE 199555			Ref: CC4/LPC21002057/Uba3q2 Date: 10/06/2021 Code: LPC2	
1. Policy Particulars :- THIRD PARTY CLAIM				
Insured Veh.	GBC 7006Z	Veh. Inspected	SMK 5791E	
Policy No.	Z/20/VC00/107490	Coverage (\$)	0.00	
Claim No.	20/21/21/VC00/024227	Excess (\$)	0.00	
Assign From	GERALD	Assign Date	10/02/2021	
2. Vehicle Particulars & Condition				
Make & Model	HONDA HRV (A)	c.c	1496	
Engine No.	HIDDEN	Year of Reg.	2019	
Chassis No.	JHMRU1830JX201528	Colour	WHITE	
Odometer	42337 KM	Steering	IN ORDER	
Brakes	IN ORDER	Modification	SPORTS RIM	
General	GOOD			
3. Conditions of Tyres				
	Size	Make	Balance	
R/H Front Tyre	215/60 R16	DUNLOP	7 mm	
L/H Front Tyre	215/60 R16	DUNLOP	7 mm	
R/H Rear Tyre	215/60 R16	DUNLOP	7 mm	
L/H Rear Tyre	215/60 R16	DUNLOP	7 mm	
4. Description of Damages				
THE VEHICLE SUSTAINED DAMAGES AT THE REAR PORTION. DAMAGES SEE DETAILS.				
5. General Information				
Accident Date	09/02/2021	Inspection Date	22/02/2021	
Survey held at	KAH MOTOR CO SDN BERHAD 15 UBI ROAD 4 SINGAPORE 408610			
5a. Remarks				
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.				
5b. Estimate Days of Repair				
ESTIMATED NORMAL PERIOD FOR REPAIR:			5 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SMK 5791E

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	RUBBER CR.WINDSHIELD DAMPER (SN)	NECESSARY	14.47	14.47
1	DAMPERSTD 5X5 (SN)	NECESSARY	6.52	6.52
1	RUBBER CL.WINDSHIELD DAMPER (SN)	NECESSARY	14.47	14.47
1	CAPPIVOT (SN)	NECESSARY	3.75	3.75
4	FASTENER BW/SHIELD (SN)	NECESSARY	15.90	15.90
2	FASTENER B (SN)	NECESSARY	7.95	7.95
2	FASTENER AW/SHIELD (SN)	NECESSARY	5.70	5.70
2	WINDSCREEN SEALANT (SN)	NECESSARY (1 PCS ONLY)	120.00	60.00
1	TAIL GATE COMP (SN)	BADLY DENTED	658.42	641.77
1	WEATHERSTRIP TAILGATE (SN)	NOT NECESSARY	75.97	-
1	LOCK ASSY ,TAILGATE ASSY (SN)	SERVICEABLE	125.55	-
1	FACE ,RR.BUMPER (SN)	DEFORMED	347.77	347.77
1	FACE,R.RR.BUMPER CORNER (SN)	NOT NECESSARY	72.37	-
1	FACE,L.RR.BUMPER CORNER (SN)	NOT NECESSARY	72.37	-
1	SPACER,R.RR.BUMPER SIDE (SN)	NOT NECESSARY	12.97	-
1	SPACER,L.RR.BPR S (SN)	NOT NECESSARY	12.97	-
8	CLIP ,BUMPER (SN)	NECESSARY	13.80	13.80
1	REFLECTOR ASSYR.RR (SN)	NOT NECESSARY	128.10	-
1	PANEL COMPRR (SN)	TO REPAIR SEE LABOUR	287.02	-
1	LIGHT ASSY ,R.LID (SN)	NOT NECESSARY	207.67	-
1	LIGHT ASSY ,L.LID (SN)	SERVICEABLE	207.67	-
1	LAMP UNIT,R (SN)	CUT	309.00	309.00
1	LAMP UNIT,L(SN)	NOT NECESSARY	309.00	-
1	NUMBER PLATE WITH CASING -L (SN)	NOT NECESSARY	45.00	-
1	EMBLEM ,RR.I-VTEC (SN)	NECESSARY	11.92	11.92
1	EMBLEMRR (SN)	NECESSARY	10.95	10.95
1	EMBLEM (SN)	NECESSARY	18.60	18.60
2	NUTPUSH 3MM (SN)	NECESSARY	3.15	3.15
1	GARNISH ASSY ,RR.LICENSE (SN)	NOT NECESSARY	170.02	-

Report Ref No. CC4/LPC21002057/Uba3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	BUZZER ASSYSMART (SN)	NOT NECESSARY	46.50	-
1	ANTENNA ASSYL.F (SN)	NOT NECESSARY	45.60	-
4	ACT RR.SENSOR (SN)	SERVICEABLE	320.00	-
1	SUNDRIES (SN)	NECESSARY	50.00	20.00
2	GROMMET.SCREW.5 (SN) (ADDITIONAL)	NECESSARY	3.60	3.60
			3,754.75	1,509.32
	LABOUR			
	INSPECT RR LIGHTING MECHANISMS ,PERFORM WATER		150.00	120.00
	REMOVE & REFIX REVERSE SENSORS.		180.00	150.00
	BODY JOINT SEALANT .	NOT NECESSARY	100.00	-
	BODY UNDERSIDE COATING.	NOT NECESSARY	100.00	-
	APPLY BODY UNDERSIDE COATING.	NOT NECESSARY	250.00	-
	REMOVE & INSTALL REAR COMPARTMENT LININGS .		450.00	200.00
	RESET VEHICLE SMART ENTRY SYSTEM.		450.00	350.00
	REMOVE INSTALL & CALIBRATION REAR VIEW CAMERA.		450.00	350.00
	REMOVE & INSTALL RR .WINDSCREEN .		650.00	650.00
	REMOVE & TRANSFER ITEMS TO NEW TAILGATE ADJUST &.		700.00	550.00
	CUF OFF & RENEW RR PANEL .STRAIGHTEN ALIGN.INCLUSIVE OF THE REPAIR OF PANEL COMPRR .		3,400.00	1,300.00
	SPRAY PAINTING ON REPAIRED OR REPLACED AREAS .		3,300.00	1,300.00
			10,180.00	4,970.00
GRAND TOTAL			13,934.75	6,479.32
RECOMMENDED COST OF REPAIRS				6,479.32

Report Ref No. CC4/LPC21002057/Uba3q2

CHUA KANG SENG

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SMK 5791E

INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

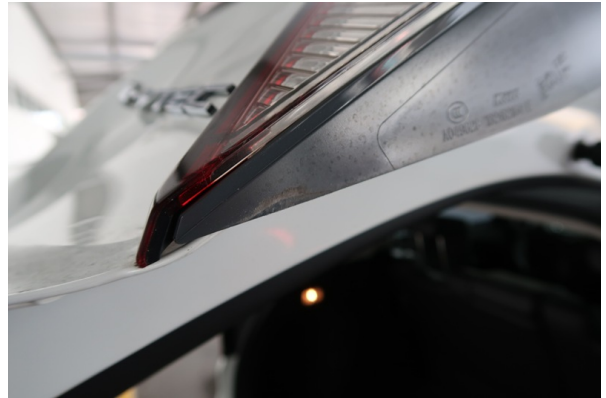



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SMK 5791E

RE-INSPECTION

