



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

CHINA TAIPING INSURANCE (S) PTE LTD	INV No.	AC2103571
3 ANSON ROAD #16-00	INV Date	19/05/2021
SPRINGLEAF TOWER	Reference	CC3/CTI21002241/Kea3q2
SINGAPORE 079909	Code	CTI

PROFESSIONAL SERVICE FEE

Vehicle No.	SHC 5982Y
Insured Veh.	SMH 2580H
Claim No.	SNM21D200923/C02
Policy No.	DMPCSW00005532101
Accident Date	11/02/2021
Inspection Date	16/02/2021

Description	Total
Third Party Express Settlement	400.00
Subtotal	400.00
GST (7%)	28.00
Grand Total	428.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile

CHINA TAIPING INSURANCE (S) PTE LTD
3 ANSON ROAD #16-00
SPRINGLEAF TOWERSINGAPORE 079909

Ref: CC3/CTI21002241/Kea3q2

Date: 19/05/2021

Code: CTI

1. Policy Particulars :- THIRD PARTY CLAIM

Insured Veh.	SMH 2580H	Veh. Inspected	SHC 5982Y
Policy No.	DMPCSW00005532101	Coverage (\$)	0.00
Claim No.	SNM21D200923/C02	Excess (\$)	0.00
Assign From		Assign Date	16/02/2021

2. Vehicle Particulars & Condition

Make & Model	RENAULT LATITUDE (A)	c.c	1995
Engine No.	HIDDEN	Year of Reg.	2014
Chassis No.	VF1ABL15AUC280993	Colour	METALLIC WHITE / RED
Odometer	846366 KM	Steering	IN ORDER
Brakes	IN ORDER	Modification	NIL
General	GOOD		

3. Conditions of Tyres

	Size	Make	Balance
R/H Front Tyre	215/60 R16	SAILUN	9 mm
L/H Front Tyre	215/60 R16	9 COLAS	9 mm
R/H Rear Tyre	215/60 R16	SAILUN	8 mm
L/H Rear Tyre	215/60 R16	SAILUN	8 mm

4. Description of Damages

THE VEHICLE SUSTAINED DAMAGES AT THE REAR PORTION.
DAMAGES SEE DETAILS.

5. General Information

Accident Date	11/02/2021	Inspection Date	16/02/2021
Survey held at	TRANS-CAB AUTO SERVICES PTE LTD NO.2 ANG MO KIO ST 63 SINGAPORE 569111		

5a. Remarks

A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS.
B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.

5b. Estimate Days of Repair

ESTIMATED NORMAL PERIOD FOR REPAIR: **5 Working Days**



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 3

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SHC 5982Y

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	REPLACEMENT OF PARTS			
1	REAR BOOT	BENT	1,677.20	1,677.20
1	BOOT FINISHER	SERVICEABLE	344.70	-
1	BOOT STRUT LH	SERVICEABLE	145.10	-
1	BOOT STRUT RH	SERVICEABLE	145.10	-
1	BOOT HINGE LH	TO REPAIR SEE LABOUR	254.20	-
1	BOOT HINGE RH	TO REPAIR SEE LABOUR	254.20	-
1	BOOT BADGE 'RENAULT'	NECESSARY	82.40	82.40
1	BOOT BADGE	NECESSARY	95.80	95.80
1	BOOT LOCK	TO REPAIR SEE LABOUR	246.60	-
1	BOOT REFLECTOR LAMP LH	DENTED	277.70	277.70
1	BOOT REFLECTOR LAMP RH	DENTED	277.70	277.70
1	BUMPER COVER REAR	BENT	561.70	561.70
1	BUMPER LOWER REAR	BENT	411.90	411.90
1	BUMPER REFLECTOR LH	CRACKED	16.60	16.60
1	BUMPER REFLECTOR RH	SERVICEABLE	16.60	-
1	BUMPER BRACKET CTR REAR	DISTORTED	98.10	98.10
1	BUMPER BRACKET SIDE RH REAR	SERVICEABLE	82.10	-
1	BUMPER RETAINER RH REAR	SERVICEABLE	59.80	-
1	BUMPER BRACKET SIDE LH REAR	SERVICEABLE	80.80	-
1	BUMPER RETAINER LH REAR	SERVICEABLE	54.20	-
1	BUMPER BEAM REAR	BENT	547.80	547.80
1	BUMPER BEAM BRACKET LH REAR	BENT	114.50	114.50
1	BUMPER BEAM BRACKET RH REAR	BENT	114.50	114.50
1	OUTER PANEL REAR (END PANEL)	BENT	745.80	745.80
1	OUTER PANEL REAR (END PANEL)TRIM	DENTED	404.56	404.56
1	FENDER PANEL REAR LH	TO REPAIR SEE LABOUR	1,933.20	-
1	WHEELARCH REAR LH	SERVICEABLE	275.40	-
1	TAILLAMP LH	MTG CRACKED	401.40	401.40

Report Ref No. CC3/CTI21002241/Kea3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	TAILLAMP RH	MTG CRACKED	401.40	401.40
	LESS 10% DISCOUNT		-1,012.11	-622.91
			9,108.95	5,606.15
1	BOOT WEATHERSTRIP (50%) (SN)	CUT	178.20	89.10
	LESS 10% DISCOUNT		-17.82	-
			160.38	89.10
	<u>SPECIAL NETT ITEMS</u>			
1	SET PARKING AID (SN)	DENTED / SHORTED	700.00	400.00
1	SET FENDER CLIP (SN)	NOT NECESSARY	65.00	-
1	SET FENDER LINER CLIP (SN)	NOT NECESSARY	60.00	-
1	SET REAR BUMPER CLIP (SN)	NECESSARY	66.00	66.00
1	SET BUMPER BRACKET CTR CLIP (SN)	NOT NECESSARY	33.00	-
1	SET BUMPER BRACKET SIDE CLIP RH RR (SN)	NOT NECESSARY	10.00	-
1	SET BUMPER RETAINER RH CLIP RR (SN)	NOT NECESSARY	20.00	-
1	SET BUMPER BRACKET SIDE CLIP LH RR (SN)	NOT NECESSARY	10.00	-
1	SET BUMPER RETAINER CLIP LH RR (SN)	NOT NECESSARY	20.00	-
1	SET BUMPER LOWER REAR CLIP (SN)	NECESSARY	66.00	66.00
1	EXHAUST MOUNTING REAR (SN)	SERVICEABLE	17.82	-
1	BUMPER CLIP FRT (SN)	SERVICEABLE	85.00	-
1	BUMPER RETAINER CLIP FRT (SN)	SERVICEABLE	70.00	-
1	BUMPER GRILLE LOWER CLIP (SN)	NOT NECESSARY	70.00	-
1	LINCESE PLATE WITH HOLDER FRT (SN)	SERVICEABLE	120.00	-
2	WINDSCREEN SEALANT (SN)	NOT NECESSARY	150.00	-
1	WINDSCREEN MOULDING (SN)	NOT NECESSARY	200.00	-
1	WINDSCREEN INNER SPONGE SEAL (SN)	NOT NECESSARY	130.00	-
			1,892.82	532.00
	<u>LABOUR</u>			
	TO REMOVE AND REFIT REAR BIG AND SMALL W/SCREEN GLASS TO FACILITATE BODYWORK REPAIR .	NOT NECESSARY	300.00	-
	PUTTY AND SPRAY PAINTING OF THE AFFECTED PORTION .		3,000.00	880.00

Report Ref No. CC3/CTI21002241/Kea3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:3 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	PANEL BEATING ,KNOCKING AND STRAIGHTENING THE NECESSARY PORTION,REMOVE AND RENEWAL OF PARTS ,ADJUST AND REALIGN THE SAME.INCLUSIVE OF THE REPAIR OF BOOT HINGE LH,BOOT HINGE RH,BOOT LOCK AND FENDER PANEL REAR LH .		3,000.00	700.00
	TO RUST-PROOFING OF THE AFFECTED AREAS .		170.00	60.00
	TO REINSTALL REAR BUMPER PARKING SENSOR .		170.00	60.00
	TO TRANSFER OF BOOTLID FITTINGS ,ATTACHMENTS AND PERFORM WATER SEEPAGE TEST.		170.00	60.00
	TO REPAIR AND REALIGN REAR EXHAUST PIPE .	NOT NECESSARY	170.00	-
	TO DROP REAR EXHAUST BOX ,RENEW THE SAME ,TO REPAIR AND REALIGN CENTRE EXHAUST PIPE.	NOT NECESSARY	170.00	-
	TO TRANSFER OF REAR END PANEL FITTINGS ,ATTACHMENTS AND PERFORM WATER SEEPAGE TEST.		170.00	60.00
	TO TRANSFER OF REAR WINDSCREEN FITTINGS AND CONDUCT WATER SEEPAGE TEST .	NOT NECESSARY	170.00	-
	TO CHECK STEERING GEOMETRY AND COMPUTER WHEEL ALIGNMENT .	NOT NECESSARY	220.00	-
	TO CHECK ELECTRICAL LIGHTING CONCERNED .		170.00	20.00
			7,880.00	1,840.00
GRAND TOTAL			19,042.15	8,067.25
RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)				6,450.00

Report Ref No. CC3/CTI21002241/Kea3q2

KONG SENG CHEONG

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SHC 5982Y

INSPECTION







LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

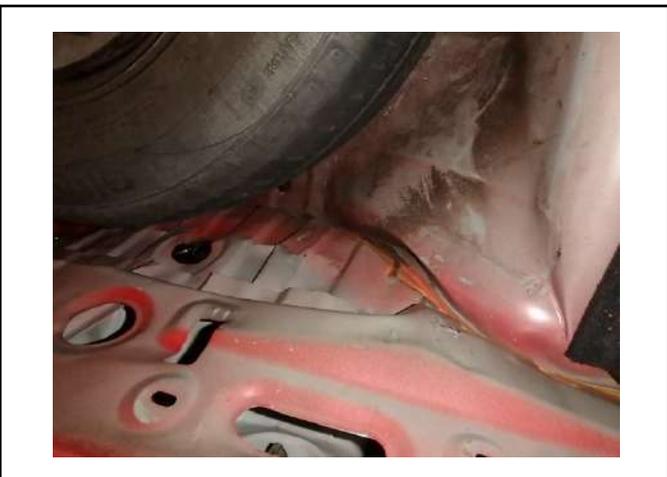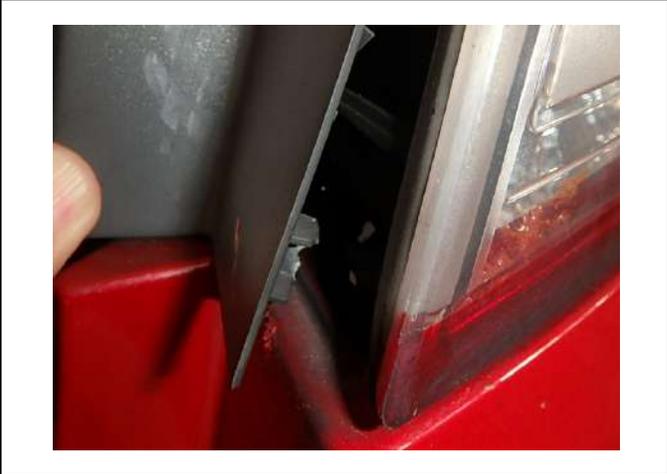



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

