

ASS. REC. BY:

REF:

TV / 20013534/Kt

ASSIGNMENT

From:

Date:

Estimated Cost:

OD/TP/WS/TP RES/ OD RES/ EVA/ INV/ MV

To Inspect Vehicle No:

at Workshop m/s

of

Insured:

Policy No.

Claims No.

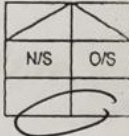
Sum Insured:

Excess:

(Client's Record)

Make of Veh:

(Policy Condition)

Remark: The veh had commenced its
repair at the time of inspection.

Bal. or Market Value:

IDAC Accident Rpt:

Consistent? : Yes or No

GIA / PR Seen:

Consistent? : Yes or No

Est. Repairs:

days

Res.: Yes or No

Lum Sum:

%

3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Date:

Person Contacted:

Vehicle: IN / OUT

Robert

Veh No:

SLE 1874U

Yr Regn:

07, 16

Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make:

Toy Sienta

Wagon

c.c 1496

Colour:

M.P. White

A/C: Insured / Std / NI / NA

Sp. Reading

M. Blue

T/Radio: Insured / Std / NI / NA

Eng/No.

92385

C/No:

NSP170 7008583

Gen. Cond: Good / Fair / Poor / Burnt

Steering: Inorder / Jammed / Leaked / Burnt or

Brake: Inorder / Jammed / Leaked / Burnt or

Modl: M / S/Rlm / STD / M/M or

Tyre Size:

185/60R15 215/60R17

R:

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / Yok or

Front

Rear

R/Bal.

8

mm

R/Bal.

8

mm

L/Bal.

8

mm

L/Bal.

8

mm

D.O.A.

/ /

D.O.I.

4/3/2021

Survey held at

Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time

Action / Instruction

lump sum \$3250,6days

red: 5150;61%

Date/Time, File Pass to?



: Prell. Report

1)



: Final Report

Date/Time, File Return to?

2)

Add Fee:



Site Insp (\$



Interview (\$



Tech Invs (\$



Weekend (\$

Days Of Repair: 6

Resurvey No. of Trlp:

Survey Fee:

Transportation:

S + RS, SI

Fees

Others

TOTAL

Report Format :

Lump Sum / I.B.I: (\$

Parts and Labour Assessment

Report No 0001-21-SHM

Vehicle No: SLE1874U

Description of part	Qty	Condition as inspected	Repairer's estimate	Our adjustment
Rear bumper	1	squashed	1,218.20	1,218.20
Rear bumper corner retainer RH/LH	2	necessary	263.40	263.40 X
Rear bumper side garnish RH/LH	2	deformed/fractured	302.00	302.00 4
Rear bumper reflector RH/LH	2	fractured	166.20	166.20 X
Rear bumper side retainer RH/LH	2	necessary	282.80	282.80 X
Rear bumper side shield clip	6	necessary	39.00	39.00 X
Rear bumper side shield RH/LH	2	reuse	375.44	0.00
Rear bumper tow hook cover	1	warped	43.20	43.20
Rear end panel - inner	1	repair	581.24	0.00
Rear end panel - outer	1	buckled	480.85	480.85 150mm
Rear end panel inner top garnish	1	fractured	289.74	289.74
Rear end panel inner top garnish clip	6	necessary	39.00	39.00
Rear end panel lock striker	1	bent	56.00	56.00 X
Rear fender inner air vent RH/LH	2	reuse	343.60	0.00
Rear antenna sensor	1	shorted	127.00	127.00
Tailgate	1	buckled	1,217.80	1,217.80
Tailgate logo "Toyota"	1	necessary	79.20	79.20
Tailgate emblem "Sienta"	1	necessary	61.70	61.70 X
Tailgate damper RH/LH	2	bent	583.40	583.40 X
Tailgate hinge RH/LH	2	bent	543.60	543.60 X
Tailgate inner handle	1	reuse	137.40	0.00
Tailgate mechanism lock	1	bent	591.40	591.40
Rear number plate lamp RH/LH	2	reuse	83.70	0.00
Tailgate outer garnish	1	fractured	281.80	281.80 X
Tailgate outer garnish clip	4	necessary	26.00	26.00 X
Tailgate outer handle	1	distorted	171.47	171.47 X
Tailgate weatherstrip	1	deformed	281.40	281.40 X
Tailgate windscreen moulding	1	necessary	192.40	192.40
Tailgate wiper motor	1	shorted	581.72	581.72 X
Spare tyre panel	1	repair	791.55	0.00
Subtotal before discount			10,232.21	7,919.28
Percentage discount 0% and 25%			0.00	1,979.82
Sub-total 1			10,232.21	5,939.46

AR Automotive Consultancy

Annex A Page 2
Report No: 0001-21-SHM-SLE18741

Rear number plate c/w holder	1	bent	50.00	50.00	
Tailgate reverses camera	1	shorted	N/A 550.00	550.00	X
Tailgate windscreen sealant	1	necessary	100.00	80.00	40% 60%
Spare tyre panel insulator mat	1	necessary	250.00	250.00	
Subtotal before discount			950.00	930.00	
Percentage discount 0% and 0%			0.00	0.00	
Sub-total 2			950.00	930.00	
Parts-total			11,182.21	6,869.46	

LABOUR

1. To straighten and panel beating rear fender RH/LH, rear boot, floor panel, spare tyre panel and rear frame members. To cut and weld rear end panel. To remove and refit above parts.

2. To putty, re-spray painting and polish affected areas.
3. To check and rectify wiring system.
4. To remove and refit rear windscreen.
5. To rust proof affected areas.

	2,000.00	1,500.00	50%
	2,000.00	1,320.00	66%
	120.00	50.00	20%
	150.00	120.00	
	150.00	60.00	30%
Labour total	4,420.00	3,050.00	
Parts & Labour total	15,602.21	9,919.46	

Results of inspection of the accident vehicle are as shown above.

We have taken into consideration the age and condition of the vehicle in our recommendation.

Hence, the recommended cost of repairs based on LUMP SUM repairs is :
and the recommended number of working days for the repairs is :

\$8,400.00

9

B J Loi (Eng. MIMI AIRTE)
Automotive Appraiser