



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

CHINA TAIPING INSURANCE (S) PTE LTD

INV No. AC2105990

3 ANSON ROAD #16-00
SPRINGLEAF TOWER
SINGAPORE 079909

INV Date 25/08/2021
Reference CC6/CTI21002712/Ara3q2
Code CTI

PROFESSIONAL SERVICE FEE

Vehicle No. SJT 8141A
Insured Veh. YN 9852D
Claim No. SNM21D201078
Policy No. DMCVSNW000101002000
Accident Date 24/02/2021
Inspection Date 26/02/2021

Description	Total
Third Party Express Settlement	400.00
Subtotal	400.00
GST (7%)	28.00
Grand Total	428.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
CHINA TAIPING INSURANCE (S) PTE LTD 3 ANSON ROAD #16-00 SPRINGLEAF TOWERSINGAPORE 079909			Ref: CC6/CTI21002712/Ara3q2 Date: 25/08/2021 Code: CTI	
1. Policy Particulars :- THIRD PARTY CLAIM				
Insured Veh.	YN 9852D	Veh. Inspected	SJT 8141A	
Policy No.	DMCVSNW000101002000	Coverage (\$)	0.00	
Claim No.	SNM21D201078	Excess (\$)	0.00	
Assign From		Assign Date	26/02/2021	
2. Vehicle Particulars & Condition				
Make & Model	CHEVROLET ORLANDO	c.c	1362	
Engine No.	HIDDEN	Year of Reg.	2017	
Chassis No.	KL1YA7589HK615994	Colour	WHITE	
Odometer	62556 KM	Steering	IN ORDER	
Brakes	IN ORDER	Modification	SPORTS RIM	
General	GOOD			
3. Conditions of Tyres				
	Size	Make	Balance	
R/H Front Tyre	225/50 R17	MICHELIN	6 mm	
L/H Front Tyre	225/50 R17	MICHELIN	6 mm	
R/H Rear Tyre	225/50 R17	MICHELIN	6 mm	
L/H Rear Tyre	225/50 R17	MICHELIN	6 mm	
4. Description of Damages				
THE VEHICLE SUSTAINED DAMAGES AT THE REAR PORTION. DAMAGES SEE DETAILS.				
5. General Information				
Accident Date	24/02/2021	Inspection Date	26/02/2021	
Survey held at	XIN HUA WORKSHOP PTE LTD 23 KAKI BUKIT AVENUE 4 #04-01 (SOUTH WING) SINGAPORE 415933			
5a. Remarks				
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.				
5b. Estimate Days of Repair				
ESTIMATED NORMAL PERIOD FOR REPAIR:			6 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 3

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SJT 8141A

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	REAR BUMPER STEP PANEL	DEFORMED	166.00	166.00
1	REAR BUMPER UPPER	DEFORMED	1,330.00	1,330.00
1	REAR BUMPER LOWER	DEFORMED	493.00	493.00
1	REAR BUMPER SILL PLATE (SILVER)	DISTORTED	223.00	223.00
1	REAR BUMPER TOWING COVER	NOT NECESSARY	93.00	-
1	LHR BUMPER REFLECTOR	CRACKED	140.00	140.00
1	RHR BUMPER REFLECTOR	CRACKED	140.00	140.00
1	REAR REVERSE LIGHT AND BRAKE LIGHT	CUT	307.00	307.00
1	REAR TAILGATE	DENTED	1,528.00	1,528.00
1	REAR TAILGATE CHROME HANDLE	CRACKED	563.00	563.00
1	RHR TAILLAMP	CUT	468.00	468.00
1	RHR TAILGATE LAMP	CUT	328.00	328.00
1	LHR TAILLAMP	CUT	468.00	468.00
1	LHR TAILGATE LAMP	CUT	328.00	328.00
1	RR TAILGATE KEYLESS RECEIVER SENSOR	NOT NECESSARY	274.00	-
1	RR TAILGATE WIPER ARM MOTOR	CRACKED	603.00	603.00
1	RR TAILGATE WIPER ARM	NOT NECESSARY	156.00	-
1	REAR END PANEL	DENTED	776.00	776.00
1	REAR END PANEL TRIM	DEFORMED	186.00	186.00
1	REAR SPARE TYRE TOOL BOX TOP COVER	DEFORMED	284.00	284.00
1	REAR SPARE TYRE TOOL BOX	CRACKED	418.00	418.00
1	REAR FENDER INNER TRIM LOW RH	NOT NECESSARY	781.00	-
1	REAR FENDER INNER TRIM LOW LH	CRACKED	781.00	781.00
1	REAR BUMPER CENTRE GUIDE	CRACKED	148.00	148.00
1	RHR BUMPER GUIDE OTR	NECESSARY	118.00	118.00
1	LHR BUMPER GUIDE OTR	NECESSARY	118.00	118.00
1	REAR BUMPER LEFT CENTRE GUIDE ,INR	NECESSARY	112.00	112.00
1	REAR BUMPER RIGHT CENTRE GUIDE ,INR	NECESSARY	112.00	112.00
1	REAR BUMPER BEAM	BENT	863.00	863.00
1	RR WINDSCREEN	NOT NECESSARY	712.00	-
1	RR TAILGATE LOGO	NECESSARY	187.00	187.00

Report Ref No. CC6/CTI21002712/Ara3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	RR TAILGATE EMBLEM 'CHEVROLET'	NECESSARY	133.00	133.00
1	RR TAILGATE EMBLEM 'ORLANDO LS'	NECESSARY	148.00	148.00
1	RR TAILGATE EMBLEM TURBO	NECESSARY	151.00	151.00
1	RR TAILGATE LOCK	DAMAGED	331.00	331.00
1	RR TAILGATE LOCK CATCH	NOT NECESSARY	121.00	-
2	RR TAILGATE NUMBER PLATE LAMP	NOT NECESSARY	132.00	-
1	RR TAILGATE INNER TRIM BOARD	CRACKED	311.00	311.00
1	RR TAILGATE INNER TRIM UPP RH	NOT NECESSARY	117.00	-
1	RR TAILGATE INNER TRIM UPP LH	CRACKED	117.00	117.00
1	RR TAILGATE RUBBER BEADING	CUT	272.00	272.00
4	RR BUMPER REVERSE SENSOR	DAMAGED (2 PCS ONLY)	860.00	430.00
4	RR BUMPER REVERSE SENSOR SEAL	NECESSARY	60.00	60.00
1	RR BUMPER REVERSE SENSOR WIRE HARNESS	CRACKED	291.00	291.00
1	RR EXHAUST SILENCER BOX	NOT NECESSARY	1,545.00	-
1	RR EXHAUST SILENCER BOX MOUNTING	NOT NECESSARY	269.00	-
1	RR FENDER PROTECTOR RH	NOT NECESSARY	167.00	-
1	RR FENDER PROTECTOR LH	NOT NECESSARY	167.00	-
	LESS 10% DISCOUNT		-1,839.60	-1,343.20
			16,556.40	12,088.80
	<u>SPECIAL NETT ITEMS</u>			
10	FENDER INNERSHIELD CLIP (SN)	NOT NECESSARY	40.00	-
10	RR BUMPER CLIP (SN)	NECESSARY	40.00	40.00
10	RR TAILGATE INNER TRIM BOARD CLIP (SN)	NECESSARY	40.00	40.00
5	RR END PANEL TRIM CLIP (SN)	NECESSARY	20.00	20.00
20	RR FENDER PROTECTOR CLIP (SN)	NOT NECESSARY	80.00	-
1	RR WINDSCREEN SEALANT (SN)	NECESSARY	65.00	40.00
1	RR WINDSCREEN INNER SEAL (SN)	NECESSARY	40.00	20.00
1	RR WINDSCREEN SOLAR FILM (SN)	NOT NECESSARY	200.00	-
1	RR EXHAUST CHROME FINISHER (SN)	BENT	200.00	120.00
1	RR ADVERTISE STICKER (SN)	NECESSARY	400.00	180.00
1	RR NUMBER PLATE (SN)	BENT	65.00	65.00
			1,190.00	525.00

Report Ref No. CC6/CTI21002712/Ara3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:3 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	LABOUR			
	TO DISMANTLE /RENEW THE ACCIDENT DAMAGED PORTION ,TO PANEL BEATING ,RESHAPE ,STRAIGHTEN ,ORIENTATE AND ALIGN REPAIR /REPLACEMENT PARTS.		1,200.00	800.00
	CARRY OUT SPRAY PAINTING ON AFFECTED AREA ,RR BUMPER ,RR TAILGATE ,RR END PANEL,RR FENDER RH ,RR FENDER LH.		1,200.00	800.00
	TO DISCONNECT FRONT WIRE HARNESS OF ELECTRICAL COMPONENT TO FACILITATE REPAIRS ,RECONNECT AND CHECK ELECTRICAL FUNCTION AFTER REPAIR .		120.00	30.00
	REMOVE AND REFIX SEAT CUSHION /UPHOLSTERY & ROOF LINING TO FACILITATE REPAIRS.		200.00	80.00
	TO REMOVE AND REFIX REVERSE SENSOR AND CONDUCT TEST .		120.00	60.00
	TO CONDUCT TRANSFER OF PARTS FROM OLD TAILGATE TO NEW TAILGATE .		200.00	80.00
	TO CONDUCT WATER LEAKAGE TEST AFTER REPAIRS OF VEHICLE .	NOT NECESSARY	80.00	-
	TO CONDUCT RESET OF ENGINE LIGHT ON .	NOT NECESSARY	200.00	-
	TO REMOVE AND REFIX REAR TAIL GATE WINDSCREEN .		180.00	120.00
	TO REMOVE AND REFIX REAR TAIL GATE WINDSCREEN .		180.00	80.00
			3,680.00	2,050.00
	GRAND TOTAL		21,426.40	14,663.80
	RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)			11,800.00

Report Ref No. CC6/CTI21002712/Ara3q2

ADRIAN LING WAI PING

B.Eng,AMSOE,AMIRTE,AMSAE-A,M.MATAI

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SJT 8141A

INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SJT 8141A

RE-INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

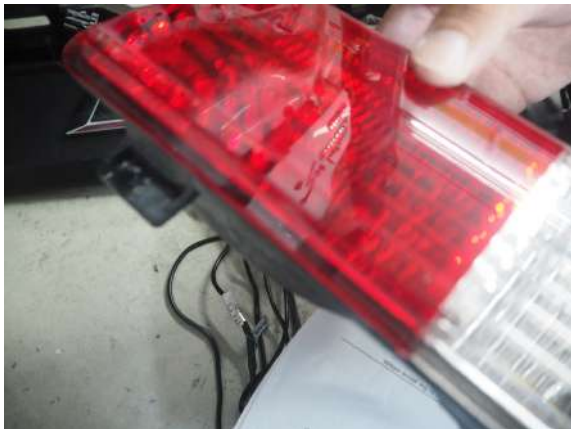



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

