

Constant Appraiser Services

Qualified Automobile Accident Damage Appraisers/Loss Adjusters

Blk 2 Rivervale Link, #09-02 Singapore 545040

Tel/Fax: 6886 1106 Mobile: 9007 5234

Email: constant_as@yahoo.com.sg

RCB No. 53138015K

INVOICE

To: Chua Chye Huat Danny
57 Hillview Avenue
#03-05
Singapore 669568

Date : 28/01/2021

Invoice No : IV21-01019/CAS

Particulars	Amount
Fee For Services Rendered In Respect Of: Surveying, Adjusting, and Re-inspection Of Accident Damaged Vehicle SMW 1313R (Inclusive Of Photographs And Transport Charges) Our reference : CAS/21-01/019	\$1,166.00
Total	\$1,166.00

E. & O.E

Constant Appraiser Services



Cheque Should Be Crossed And Made Payment To 'Constant Appraiser Services'

Constant Appraiser Services

Qualified Automobile Accident Damage Appraisers/Loss Adjusters

Blk 2 Rivervale Link, #09-02 Singapore 545040

Tel/Fax: 6886 1106 Mobile: 9007 5234

Email: constant_as@yahoo.com.sg

RCB No. 53138015K

Automobile Inspection Report

To: Chua Chye Huat Danny
57 Hillview Avenue
#03-05
Singapore 669568

Date : 28/01/2021

Reference No : CAS/21-01/019

General Information

Registration No. : SMW 1313R
Accident Date : 19/01/2021

Particulars of Damaged Vehicle

Colour	: Black	Make & Model	: Mercedes Benz E200 AVG
Engine Capacity	: 1991 cc	Pre-Accident Condition	: Good
Mileage (KM)	: 222706	Engine No.	: 27492030707069
Chassis No.	: WDD2130422A043271	Steering	: Affected
Registration Date	: 04/07/2017	Brake	: In Order

Tyre Condition

	Size	Make	Balance
R/H Front Tyre	245/45R18	GOODYEAR	90%
L/H Front Tyre	245/45R18	GOODYEAR	90%
R/H Rear Tyre	245/45R18	GOODYEAR	90%
L/H Rear Tyre	245/45R18	GOODYEAR	90%

Inspection

Repairer : Welltac Auto Spray Centre
60, Jalan Lam Huat, #07-35/36 Carros Centre, Singapore 737869

Adjustment And Recommendation Cost Of Repair

Repairer's Estimate : \$28,925.24
Revised Amount : \$21,200.00
Less Excess : -
Nett Total : \$21,200.00

Remarks

- (A) Survey was done on 19/01/2021
- (B) Re-survey was done on 20/01/2021
- (C) Re-survey after repair was done on 25/01/2021
- (D) The survey was conducted entirely on WITHOUT PREJUDICE basis.
- (E) We have NOT given any instruction to authorize the repair of the vehicle.

NOTE: The revised estimate was made from a visual inspection. Should there be any discrepancy or unseen damage/item in this survey, kindly notified the company within 7 (seven) days from the date hereof. Otherwise, the revised amount shall be deem to be valid.

Adjustment On Repair Costs And Replacement Of Parts:

S/No	Qty	Descriptions	Assessed Condition	Estimate by Workshop (\$)	Revised Amount (\$)
<u>PARTS REPLACEMENT – LIST ITEMS</u>					
1	1pc	Front bumper	Dented/Broken	1,508.94	1,508.94
2	1pc	Front bumper reinforcement	Repair	593.86	-
3	1pc	Front bumper retainer RH	Damaged	80.42	80.42
4	1pc	Headlamp RH	Grazed/Broken	4,142.14	4,142.14
5	1pc	Front fender RH	Dented/Twisted	1,226.07	1,226.07
6	1pc	Front fender cowling RH	Serviceable	145.50	-
7	1pc	Front shock absorber RH	Bent	1,048.81	1,048.81
8	1pc	Front knuckle arm RH	Bent	2,562.35	2,562.35
9	1pc	Front wheel bearing RH	Necessary	658.43	658.43
10	1pc	Front lower arm RH	Bent	867.24	867.24
11	1pc	Front control arm RH	Bent	1,256.25	1,256.25
12	1pc	Front top arm RH	Bent	1,103.74	1,103.74
13	1pc	Front stabilizer bar	Serviceable	1,014.89	-
14	1pc	Front stabilizer bar link RH	Bent	194.31	194.31
15	1pc	Steering rack & pinion	Bent/Jammed	10,696.64	10,696.64
				27,099.59	25,345.34
Less 10%				(2,709.95)	(2,534.53)
Sub total				24,389.64	22,810.81
<u>PARTS REPLACEMENT – SPECIAL NETT ITEMS</u>					
1	1pc	Front sport rim RH	Grazed/Warped	686.60	686.60
2	1set	Front fender cowling clip LH	Necessary	34.00	34.00
3	1set	Front bumper clip	Necessary	55.00	55.00
Sub total				25,165.24	23,586.41
<u>LABOUR & MISC. CHARGES</u>					
1		Repair & replace damaged parts		800.00	600.00
2		Spray paint affected area		1,200.00	900.00
3		Check wiring & refocus headlamp		50.00	20.00
4		Spray anti rust on affected area		80.00	30.00
5		Remove & refix front undercarriage		360.00	320.00
6		Check wheel alignment (before & after repair)		300.00	240.00

S/No	Qty	Descriptions	Assessed Condition	Estimate by Workshop (\$)	Revised Amount (\$)
		<u>LABOUR & MISC. CHARGES (CONT'D)</u>			
7		To calibration & align steering rack & pinion		320.00	240.00
8		Diagnose & reset system after repair		420.00	380.00
9		Remove & renew front parking sensor		80.00	60.00
10		Towing charges		150.00	120.00
			Grand total	28,925.24	26,496.41
Recommended cost of lump sum repair (To its pre-accident condition)					21,200.00

Adjustment/Recommendations

We have thoroughly inspected each and every item on the estimate against the physical damage found on the vehicle and we have listed the breakdown of our finding and our recommendation.

The repairer has agreed to undertake the job at a lump sum of **\$21,200.00** on a contractual basis. Under normal circumstances, the repair period would be about **6 (Six)** working days.

Yours faithfully,

Constant Appraiser Services



Lim Yong Tian (Sebastian)
 Licensed Appraiser
 Adv. Dip. In Mechanical Engineering (AUS)
 MSAAA

Constant Appraiser Services

















Constant Appraiser Services



Constant Appraiser Services

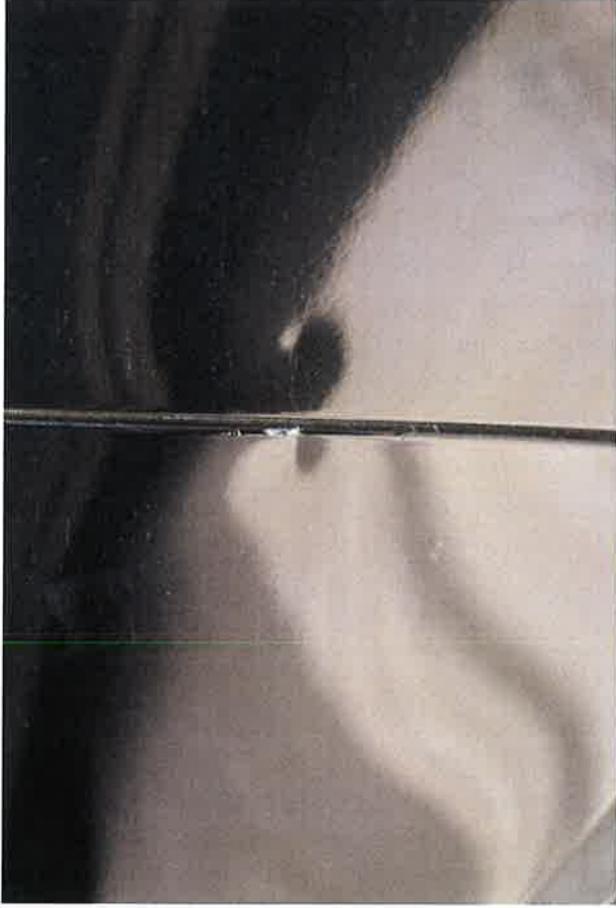

Constant Appraiser Services


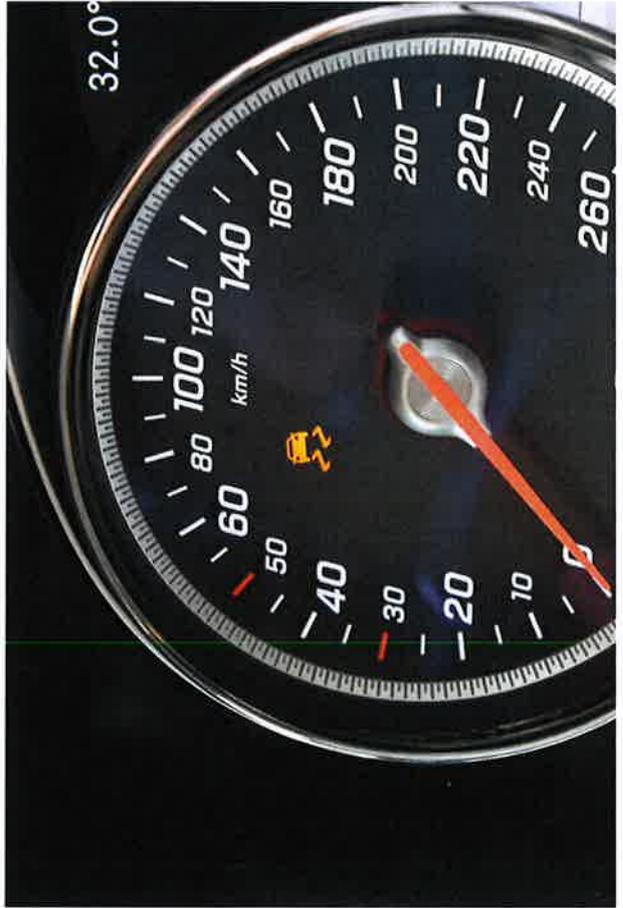


Constant Appraiser Services










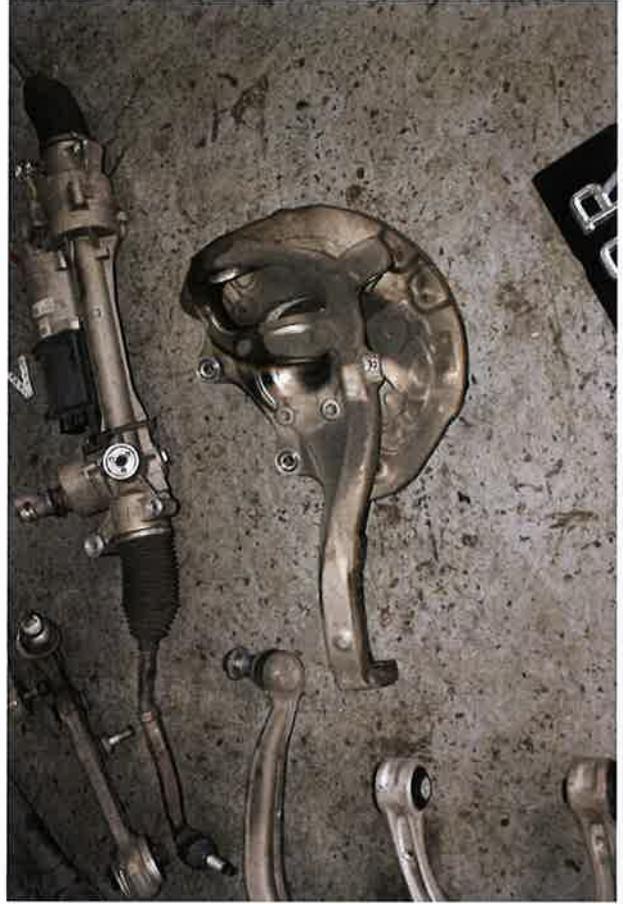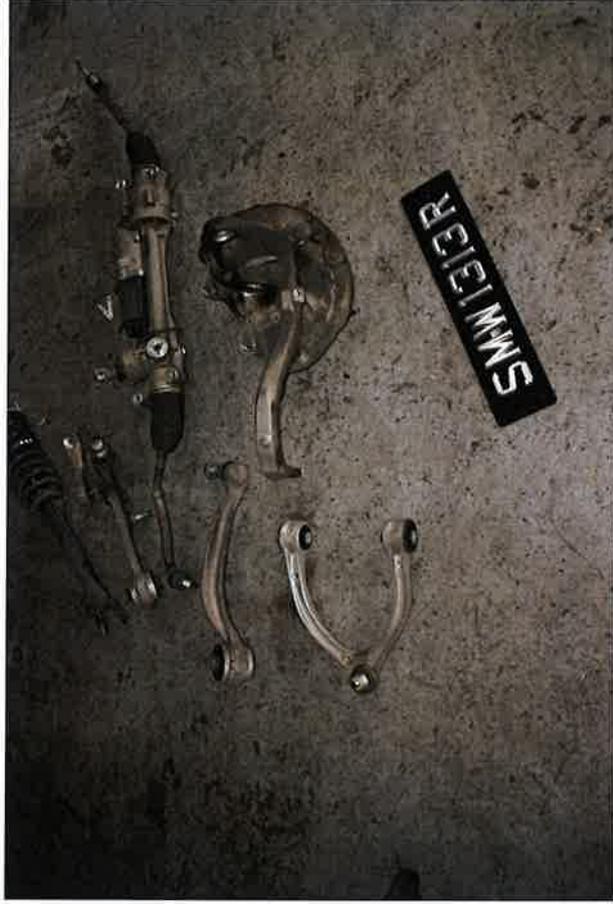


Constant Appraiser Services

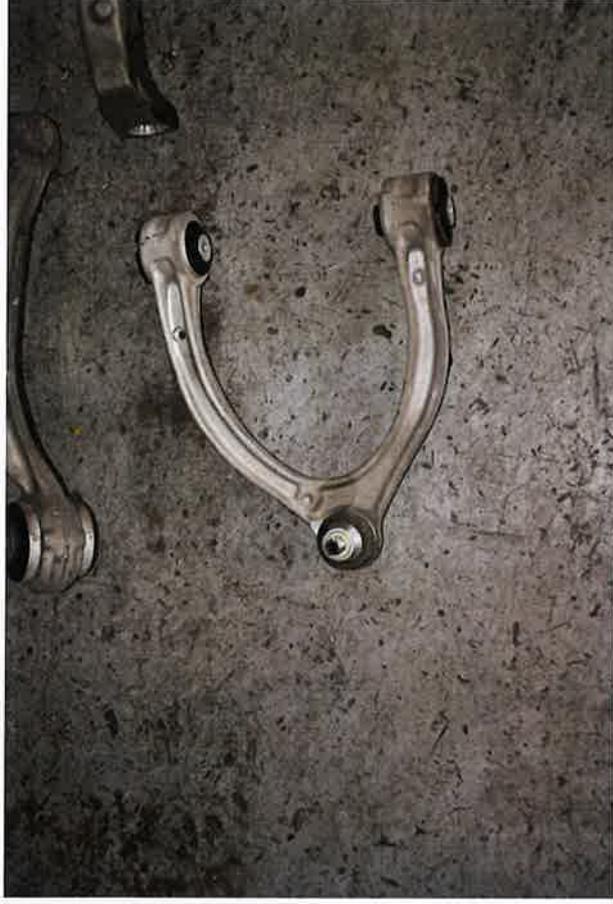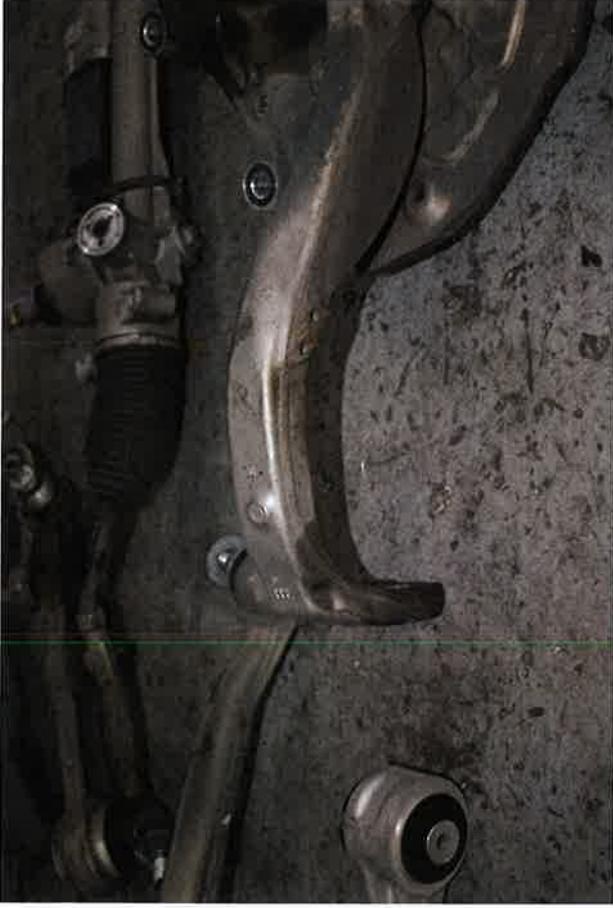


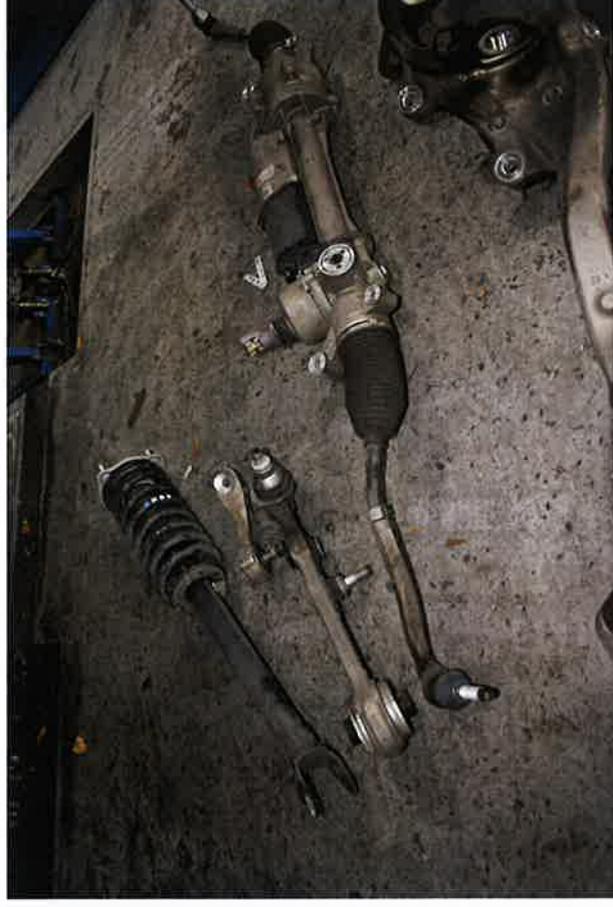



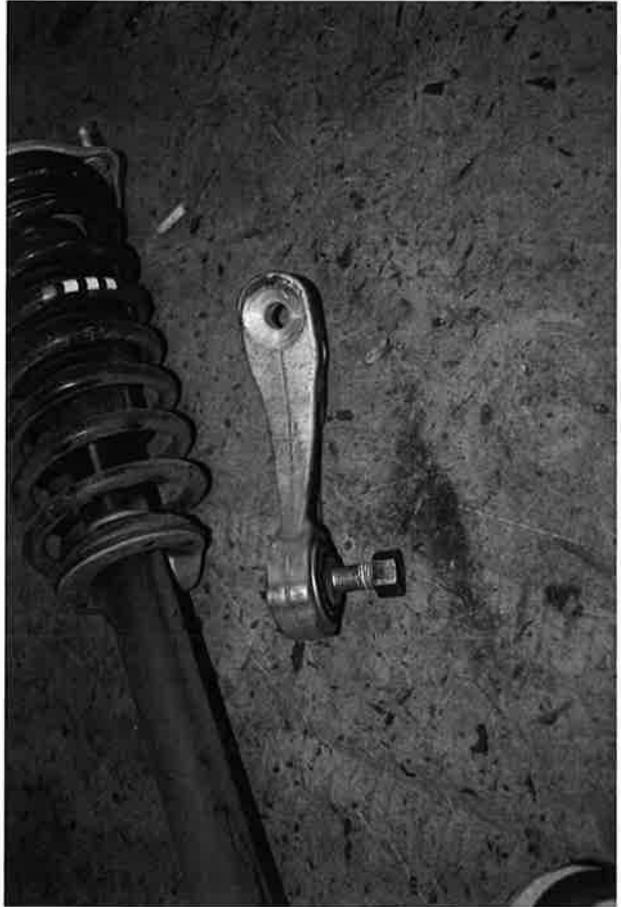

Constant Appraiser Services

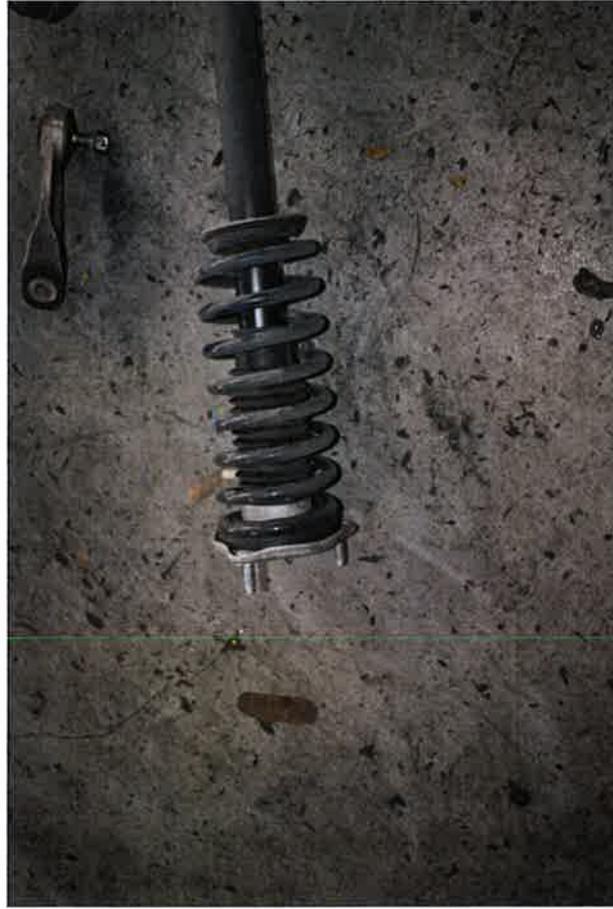

Constant Appraiser Services



Constant Appraiser Services



Constant Appraiser Services



Constant Appraiser Services



