



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

CHINA TAIPING INSURANCE (S) PTE LTD	INV No.	AC2108379
3 ANSON ROAD #16-00	INV Date	06/12/2021
SPRINGLEAF TOWER	Reference	CC3/CTI21002843/Ges3q2
SINGAPORE 079909	Code	CTI

PROFESSIONAL SERVICE FEE

Vehicle No.	SHD 3054J
Insured Veh.	SLT 7807X
Claim No.	SNM21D201198/C02
Policy No.	DMHCSNA00002732000
Accident Date	28/02/2021
Inspection Date	01/03/2021

Description	Total
Third Party Express Settlement	400.00
Subtotal	400.00
GST (7%)	28.00
Grand Total	428.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile

CHINA TAIPING INSURANCE (S) PTE LTD
3 ANSON ROAD #16-00
SPRINGLEAF TOWERSINGAPORE 079909

Ref: CC3/CTI21002843/Ges3q2

Date: 06/12/2021

Code: CTI

1. Policy Particulars :- THIRD PARTY CLAIM

Insured Veh.	SLT 7807X	Veh. Inspected	SHD 3054J
Policy No.	DMHCSNA00002732000	Coverage (\$)	0.00
Claim No.	SNM21D201198/C02	Excess (\$)	0.00
Assign From		Assign Date	01/03/2021

2. Vehicle Particulars & Condition

Make & Model	HYUNDAI I40	c.c	1685
Engine No.	HIDDEN	Year of Reg.	2016
Chassis No.	KMHLB41UMGU091891	Colour	BLUE
Odometer	546677 KM	Steering	IN ORDER
Brakes	IN ORDER	Modification	NIL
General	GOOD		

3. Conditions of Tyres

	Size	Make	Balance
R/H Front Tyre	205/60 R16	WEST LAKE	5 mm
L/H Front Tyre	205/60 R16	WEST LAKE	5 mm
R/H Rear Tyre	205/60 R16	WEST LAKE	5 mm
L/H Rear Tyre	205/60 R16	WEST LAKE	5 mm

4. Description of Damages

THE VEHICLE SUSTAINED DAMAGES AT THE O/S BODY.THE UNDERCARRIAGE AFFECTED DUE TO COLLISION.

DAMAGES SEE DETAILS.

5. General Information

Accident Date	28/02/2021	Inspection Date	01/03/2021
Survey held at	COMFORTDELGRO ENGINEERING PTE LTD 59 LOYANG DRIVE SINGAPORE 508969		

5a. Remarks

A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS.
B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.

5b. Estimate Days of Repair

ESTIMATED NORMAL PERIOD FOR REPAIR:	4 Working Days
-------------------------------------	-----------------------



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SHD 3054J

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
<u>REPLACEMENT OF PARTS</u>				
1	REAR BUMPER	BROKEN	1,106.00	1,106.00
1	REAR BUMPER SIDE BRKT RH	NOT NECESSARY	35.60	-
10	REAR BUMPER CLIPS	NECESSARY	22.00	22.00
1	TAILLAMP RH	CRACKED	697.80	697.80
1	REAR WHEEL CAP RH	CUT	217.20	217.20
1	REAR FENDER RH	TO REPAIR SEE LABOUR	2,171.40	-
1	REAR FENDER SHIELD RH	CUT	169.30	169.30
1	REAR DOOR RH	TO REPAIR SEE LABOUR	2,201.10	-
1	REAR WINDSCREEN MOULDING	NOT NECESSARY	51.80	-
	LESS 20% DISCOUNT		-1,334.44	-442.46
			5,337.76	1,769.84
<u>SPECIAL NETT ITEMS</u>				
1	REAR BUMPER MAT (SN)	NECESSARY	50.00	50.00
1	REAR DOOR APPS STICKER RH (SN)	NECESSARY	80.00	80.00
2	WINDSCREEN AHESIVE -310ML (SN)	NOT NECESSARY	92.00	-
			222.00	130.00
<u>LABOUR</u>				
	PANEL BEATING .INCLUSIVE OF THE REPAIR OF REAR FENDER RH AND REAR DOOR RH .		900.00	560.00
	SPRAYPAINT CHARGE.		900.00	750.00
	CHECK ALL LIGHTING.		40.00	30.00
	TUFF COAT ON AFFECTED PARTS.	NOT NECESSARY	60.00	-
	R/I REVERSE SENSOR .		120.00	40.00
	R/I UPHOLSTERY ETC.		150.00	60.00
	R/I REAR WINDSCREEN.	NOT NECESSARY	150.00	-
	WHEEL ALIGNMENT.		120.00	60.00
			2,440.00	1,500.00
GRAND TOTAL			7,999.76	3,399.84



RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)			2,700.00
---	--	--	-----------------

Report Ref No. CC3/CTI21002843/Ges3q2

XING GUO QIANG

M.MATAI, AMSAE-A

Automotive Assessor

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd



51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SHD 3054J

INSPECTION

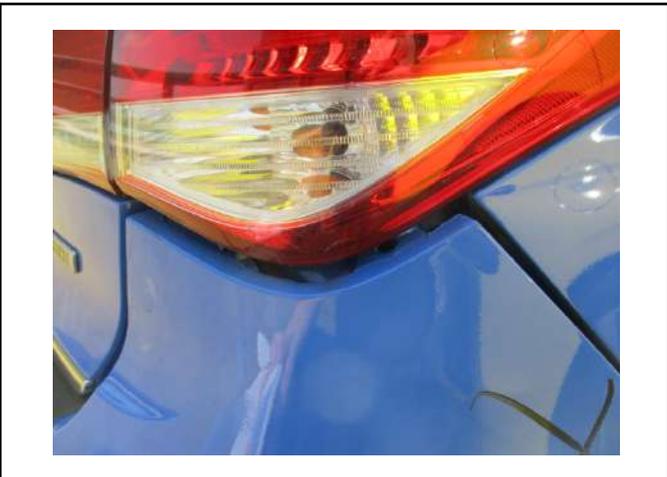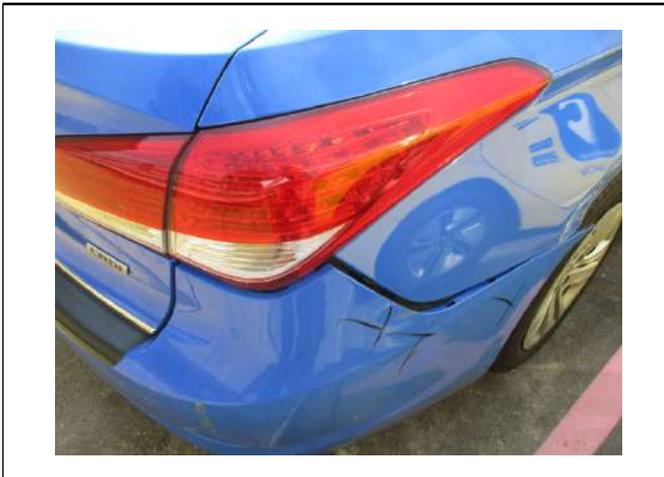








LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

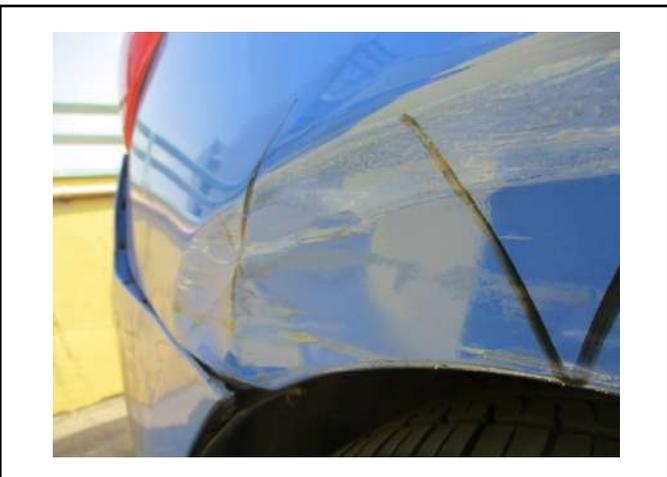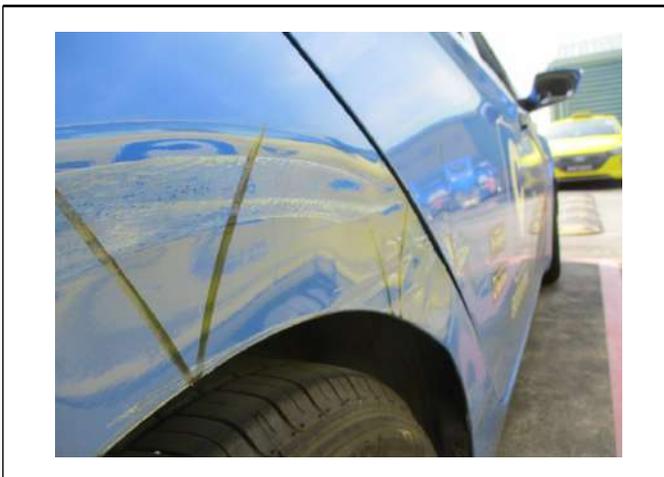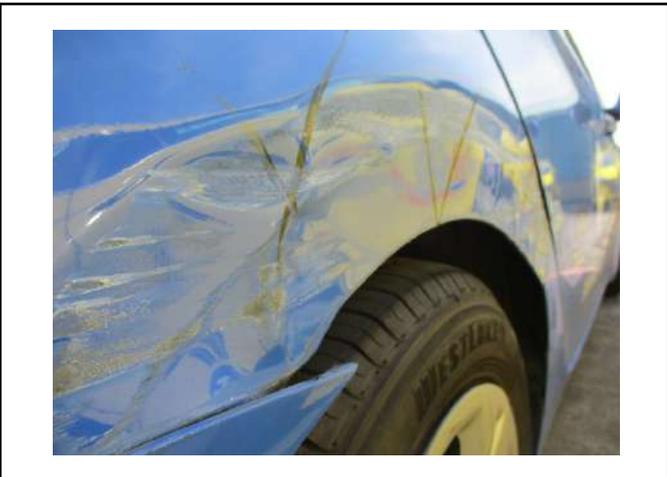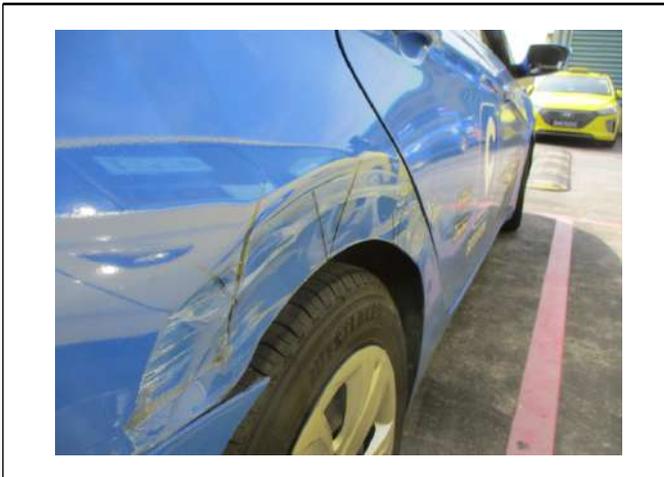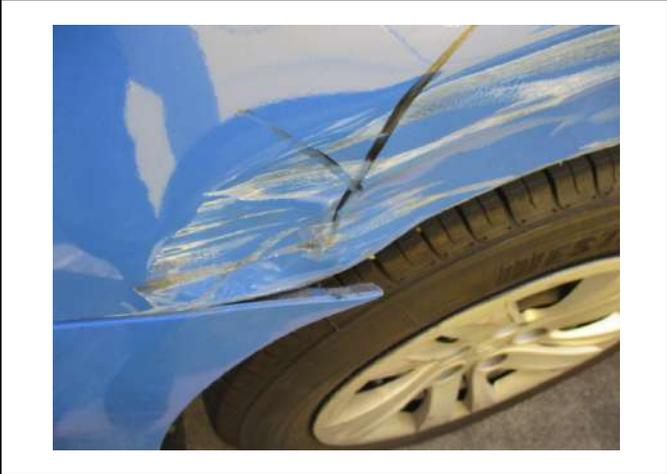




LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

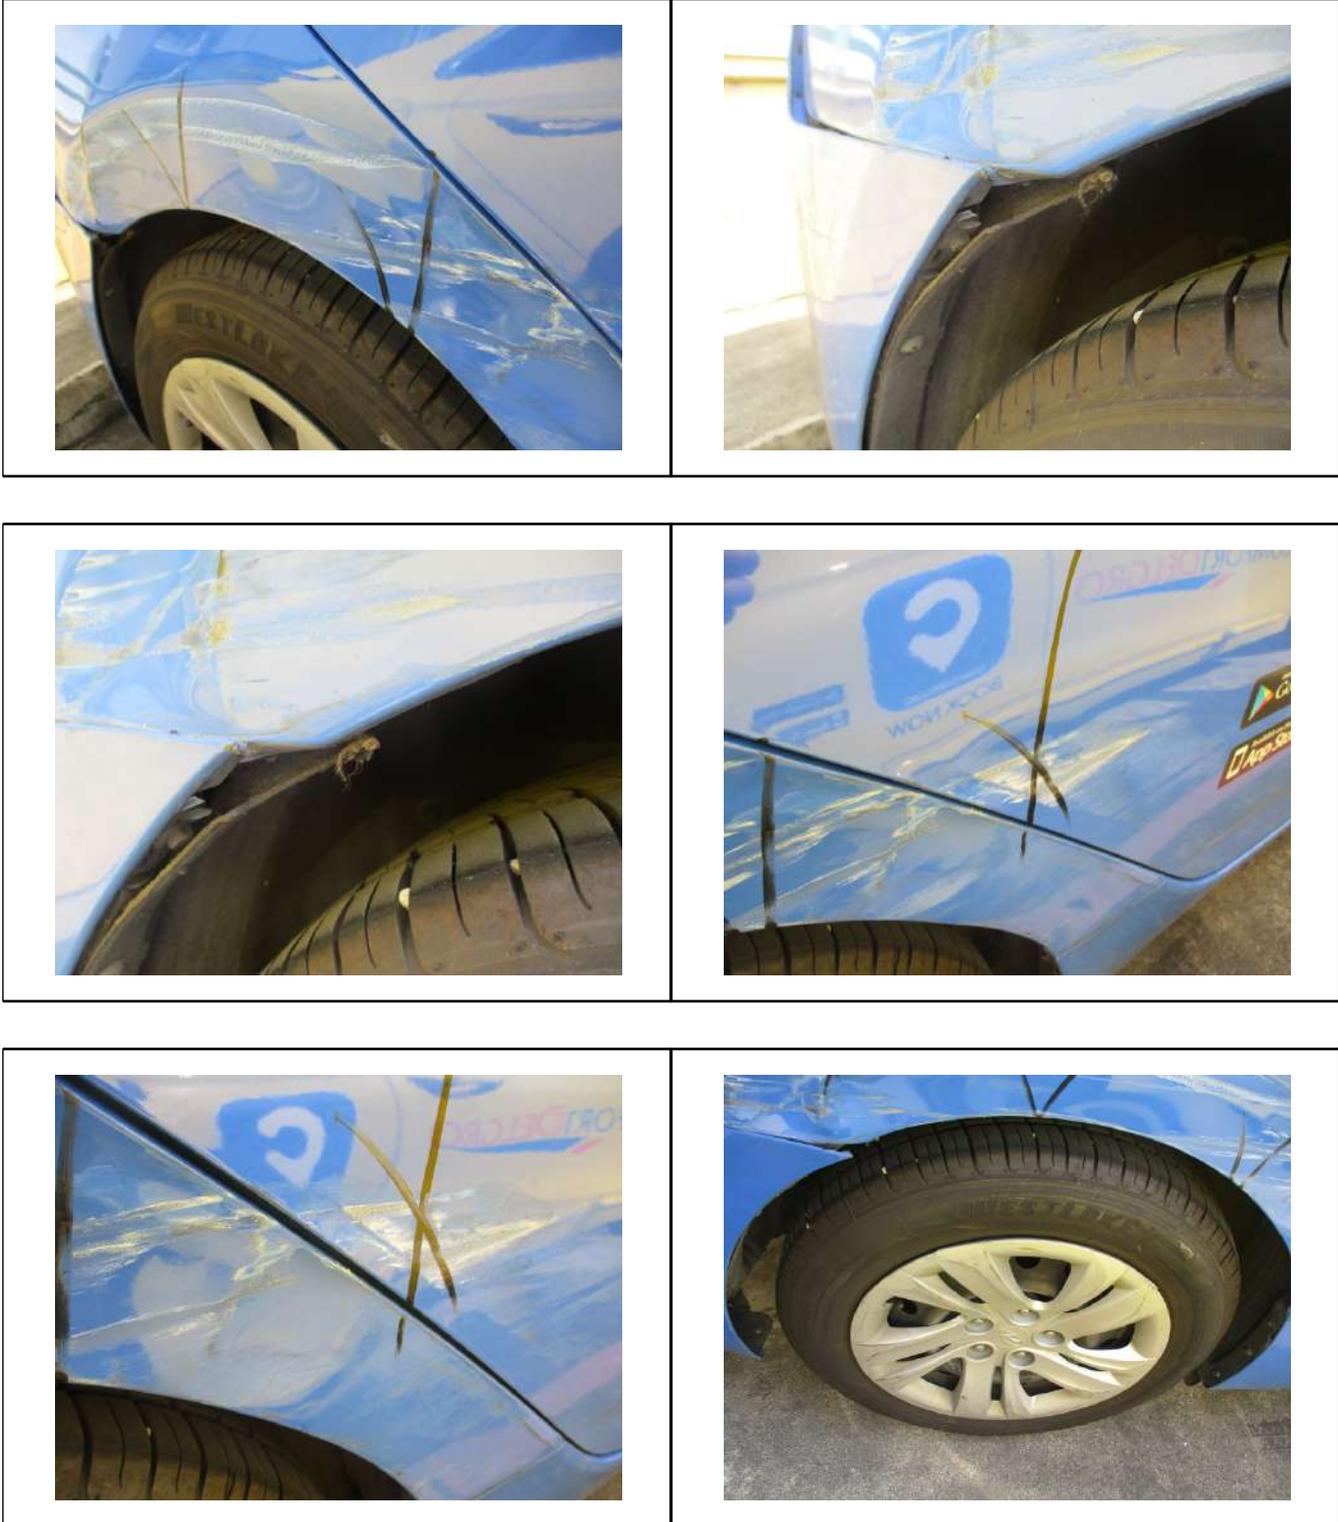



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SHD 3054J

RE-INSPECTION

