

Kenneth

ASSIGNMENT

From: _____ Date: _____

Estimated Cost: _____

OD / TP / WS / TP RES / OD RES / EVA / INV / MV

To Inspect Vehicle No: _____

at Workshop m/s _____
of _____

Insured: GY 8878S

Policy No. DMCVSNW00030332005


Claims No. SNM21D201228/C02/GBK8070M/THAM

Sum Insured: _____ Excess: _____

(Client's Record)

Make of Veh: _____

(Policy Condition)

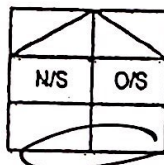Remark: The veh had commenced its
repair at the time of inspection.

Bal. or Market Value: _____

IDAC Accident Report: _____ Consistent? : Yes or No

GIA / PR Seen: _____ Consistent? : Yes or No

Est. Repairs: 10 days Res.: Yes or NoLum Sum: 1.3.1 % 3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Date: _____ Person Contacted: _____

Vehicle: IN / OUT

Veh No: GBK 8070M Yr Regn: 12.20

Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or _____

Make: Fiat Fiorino c.c. 1248Colour: White A/C: Insured / Std / NI / NASp. Reading: 6758 T/Radio: Insured / Std / NI / NA

Eng/No: _____

C/No: ZFA 22500006S40638Gen. Cond: Good / Fair / Poor / BurntSteering: In order / Jammed / Leaked / Burnt orBrake: In order / Jammed / Leaked / Burnt orModl: Nil / S/Rim / STD A/Rim orTyre Size: F: 185/65R15

R: _____

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or Continental

Front _____ Rear _____

R/Bal. 9 mm R/Bal. 9 mmL/Bal. 9 mm L/Bal. 9 mmD.O.A. 2/3/21 D.O.I. 5/3/2021

Survey held at _____

Des. of Damages: Frt / Rear / O/S / N/S / UIC / Rooftop or

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time Action / Instruction

5/3 Parts needs to order over sea, need about 3 weeks.22/7/21 Final fig \$8420.82 confirmed by email (Red 635, 7%)

Date/Time, File Pass to?

☐ : Prel. ReportDays Of Repair: 10

1)

☐ : Final ReportResurvey No. of Trlp: 1

Date/Time, File Return to?

Survey Fee:

Add Fee: ☐ : Site Insp (\$ _____)☐ : Interview (\$ _____)☐ : Tech Invs (\$ _____)☐ : Weekend (\$ _____)

Transportation:

S + RS. \$ _____

Fees

Others

TOTAL

Report Format: Merimen

Lump Sum / I.B.I: (\$ 8420.82)

Lai Huat (Meng Kee) Motor Pte Ltd
160 Sin Ming Drive, #04-01, #04-02 &
#07-03, Sin Ming Autocity
575722

Insurer Reference:

Repairer Reference: 71905

Date calculated: 04/03/2021 1:26 PM

Full Report
Registration: GBK 8070M
Printed: 04/03/2021 1:31 PM

Summary Information

Claim

Location:

Singapore (SG)

Work Provider:

China Taiping Insurance
(Singapore) Pte Ltd

Printed by:

Jenny Lim

Currency:

SGD

Claim Reference:

Date of Incident:

02/03/21

Estimated Repair Time:

12

Hire Car Start:

Hire Car End:

Actual Repair Days:

Vehicle Details

Vehicle

Manufacturer:

FIAT

Model:

FIORINO (225)

Sub Model:

SX

Model Sheet Number:

08 AF 02

Registration:

GBK 8070M

VIN number:

ZFA22500006S40638

Odometer:

6758

Model Specs

AIR CONDITIONING

COOLANT R1234YF

ELEC/HEAT DR MIRROR

RADIO WITH LCD DISP

REAR WIPER

DR/SEAT LUMBAR SUPP

VAN WITH TRUCK REG

START & STOP SYSTEM

1248CCM 59KW

SEQUENT 6-SP GEARBOX

TYRES 185/65 TR 15

WHEELS 6J X 15 ALLOY

ESP

EMISSION STD EURO 6

PART GLAZED BOX VAN

PREPARE OFF VEHICLE

CENTRAL LOCKING/RC

S-WHEEL RADIO CONT

SEAT HEIGHT ADJUST

FRONT ARMREST

ADJ STRG COLUMN

FROM 03/2020

L/GLAZED SLDG DOOR

PAINTED BUMPER

FRT ELECTRIC WINDOWS

FOG LAMPS

ADJ PASS S/BACKREST

DOUBLE DOOR GLAZED

ABS

CO2 REDUCED

R/GLAZED SLDG DOOR

BASECOAT CLEAR

Not Authorised
Repairing By Jim
10 days

LKK Auto Consultants hence notify
the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and
is subject to final approval from Insurance Company

Acknowledged by Repairer
Signature:
Date:

Vehicle Condition


Vehicle Status

Pre-Accident Damage:

Date of Inspection:

Damage Areas

All ☐
Underbody ☐

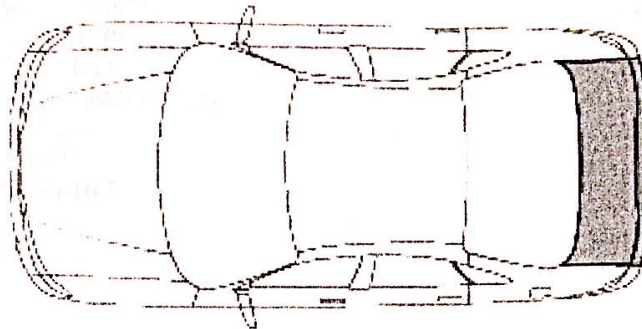

Labour

Code	Description	Time Base 10 WU/h	Price = 42.00 SGD/h	
			WU	Price SGD
7604A02	VEHICLE PREPARATION TIME		2.0	8.40
7660C02	R + R REAR BUMPER		5.5	23.10
	INCLUDES: R + R TAILLAMPS			
7660C33	R + R REAR BUMPER ABSORBER		1.0	4.20
7660C35	R + R REAR BUMPER CARRIER		1.0	4.20
7210L27	R + R L/R LOAD COMPARTMENT DOOR		5.0	21.00
7210L27	R + R R/R LOAD COMPARTMENT DOOR		5.0	21.00
NO NUMBER	R + R ATTACHED PARTS OF THE L/R DOOR		6.0	25.20
NO NUMBER	R + R ATTACHED PARTS OF THE R/R DOOR		6.0	25.20
7205B55	R + R REAR FLOOR PANEL ATTACHED PARTS		27.5	115.50
7035B24	R + R L/WING DOOR WINDOW		12.0	50.40
7035B24	R + R R/WING DOOR WINDOW		12.0	50.40
7210B55	RENEW BOOT FLOOR		105.0	441.00
7210B70	RENEW REAR END PANEL		57.0	239.40
5050C42)	R + R REAR WIPER MOTOR		2.0	8.40
	INCLUDES: R + R WIPER ARM			
5050C10	R + R REAR WASHER NOZZLE		1.0	4.20
7040H66	R + R LEFT REAR SIDE TRIM		6.5	27.30
7040H66	R + R RIGHT REAR SIDE TRIM		6.5	27.30
2741	RR FLOOR RR C-MEMBER REPAIR		20 30.0*	126.00
3580	R/R LAMP FRAME REPAIR		15 20.0*	84.00
3961	RR CTR REAR C-MEMBER REPAIR		20 30.0*	126.00
Labour Cost		Hrs	WU	
Panel / Mechanical Labour		34.10	341.0	1,432.20
Total of Labour				1,432.20

Paint

Paint Work

SYSTEM AZT

Time Basis 10 WU/h

Code	Description - BASECOAT CLEAR	WU	Price SGD
	REAR PANEL NEW PART PAINTING	12.0	
	L/R LOADING DOOR NEW PART PAINTING	15.0	
	R/R LOADING DOOR NEW PART PAINTING	12.0	
	FLOOR REINFORCEMENT SURFACE PAINT	8.0	
	REAR BUMPER NEW PART PAINT K1R	10.0	
	REAR BUMPER COVER NEW PART PAINT K1R	3.0	
	L/R LAMP FRAME SURFACE PAINT	5.0	
	R/R LAMP FRAME SURFACE PAINT	5.0	
	REAR FLOOR PANEL SURFACE PAINT	14.0	

Paint Material Per Part

Code	Description	Price SGD
2711	REAR PANEL NEW PART PAINTING	8.25
2933	L/R LOADING DOOR NEW PART PAINTING	40.25
2934	R/R LOADING DOOR NEW PART PAINTING	26.83
3903	FLOOR REINFORCEMENT SURFACE PAINT	19.92
2581	REAR BUMPER NEW PART PAINT K1R	48.22
2645	REAR BUMPER COVER NEW PART PAINT K1R	0.49
3579	L/R LAMP FRAME SURFACE PAINT	4.98
3580	R/R LAMP FRAME SURFACE PAINT	4.98
3901	REAR FLOOR PANEL SURFACE PAINT	50.30

Labour Cost - Paint

	Hrs	WU	Price SGD
Factor			42.00 SGD/h
Time Paint		84.0	
Preparation Main Work Metal	2.50	25.0	105.00
Preparation Comp. Work Plastic	0.50	5.0	21.00
Total	10 WU/h	11.40	114.0

Material Cost - Paint

	Price SGD
New Part Painting	75.33
New Part Painting - Plastic K1R	48.71
Surface-/Blend Paint	80.18
Material-constant Metal Preparation	28.60
Material-constant Plastic	9.00
Total	241.82

Spare Parts

Code	Description	Part Number	Part Source	prices as at 2001-01-01	Price SGD
3017	BADGE MODEL	0000052043106	Original	✓	65.00
3903	FLOOR REINFORCEMENT	0000051781361	Original	✓	550.00
2933	L/R LOADING DOOR	0001389334080	Original	✓	1,050.00
3165	L/R SCREEN BRKT	0001361173080			0.00
3163	L/R WINDOW MNTG KIT	0001360834080			0.00

Code	Description	Part Number	Part Source	Price SGD
2982	LOWER WING DOOR LOCK	0001385998080	Original <i>nd</i> ✓	75.00
4986	LUGGAGE COMPART TRIM	0000735649023	Original <i>nd</i>	300.00
2934	R/R LOADING DOOR	0001393312080	Original <i>nd</i> ✓	1,050.00
3166	R/R SCREEN BRKT	0001361173080		0.00
3164	R/R WINDOW MNTG KIT	0001360834080		0.00
2581	REAR BUMPER	0000735662858	Original <i>nd</i> ✓	450.00
2645	REAR BUMPER COVER	0000735482370	Original <i>nd</i> ✓	28.00
2585	REAR BUMPER DAMPER	0001355231080	Original <i>nd</i> ✓	280.00
3921	REAR FLOOR PANEL	0000052060459	Original <i>nd</i> ✓	950.00
2711	REAR PANEL	0000052091984	Original <i>nd</i> ✓	750.00
3160	REAR SCREEN BOND KIT	0000071730189		0.00
3227	REAR WIPER ARM	0001353225080	Original <i>nd</i> ✓	95.00
f: OEM Parts				0.00
n: Non-OEM Parts				5,643.00
u: Used parts				
Savings				0.00
Subtotal				5,643.00
Total				5,643.00

Extras

Code	Description	Price SGD
1000	SUNDRIES SUNDRIES	100.00*
1001	CHK/CLR FAULT CODES DIAGNOSTIC	120.00*
1002	UNDERBODY COATING RR FLOOR PANEL	350.00*
1003	PARKING SENSORS REAR	200.00*
1004	70 KM/H DECAL	5.00*
1005	4 PAX DECAL	5.00*
1006	GLASS SEALANT X 2 RR GLASS X 2	80.00*
1007	COMPANY LETTERING DECAL	200.00*
Total Extras		1,060.00

Final Calculation

	SGD	SGD
Parts	5,643.00	
Total Parts		5,643.00
Labour Time Base 10 WU/h		
Total 341.0 WU X 42.00 SGD/h	1,432.20	
Total of Labour		1,432.20
Total Of Extras		1,060.00
Paint Work Time Base 10 WU/h		
Labour Cost 114.0 WU X 42.00 SGD/h	478.80	
Material Cost	241.82	
Total Paint Including Material		720.62
Repair Cost Excludes GST		8,855.82
GST (+7.0%)		619.91
Repair Cost Included GST		9,475.73