



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

CHINA TAIPING INSURANCE (S) PTE LTD	INV No.	AC2107196
3 ANSON ROAD #16-00	INV Date	18/10/2021
SPRINGLEAF TOWER	Reference	CC6/CTI21003069/Ara3q2
SINGAPORE 079909	Code	CTI

PROFESSIONAL SERVICE FEE

Vehicle No.	SMC 8521R
Insured Veh.	GBH 7157U
Claim No.	SNM21D201275/LKKDS
Policy No.	DMCVSNA00024252101
Accident Date	04/03/2021
Inspection Date	05/03/2021

Description	Total
Third Party Express Settlement	400.00
Subtotal	400.00
GST (7%)	28.00
Grand Total	428.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile			
CHINA TAIPING INSURANCE (S) PTE LTD 3 ANSON ROAD #16-00 SPRINGLEAF TOWERSINGAPORE 079909		Ref: CC6/CTI21003069/Ara3q2 Date: 18/10/2021 Code: CTI	
1. Policy Particulars :- THIRD PARTY CLAIM			
Insured Veh.	GBH 7157U	Veh. Inspected	SMC 8521R
Policy No.	DMCVSNA00024252101	Coverage (\$)	0.00
Claim No.	SNM21D201275/LKKDS	Excess (\$)	0.00
Assign From		Assign Date	05/03/2021
2. Vehicle Particulars & Condition			
Make & Model	HYUNDAI ELANTRA	c.c	1591
Engine No.	HIDDEN	Year of Reg.	2018
Chassis No.	KMHD841CMJU727824	Colour	GREY
Odometer	57816 KM	Steering	IN ORDER
Brakes	IN ORDER	Modification	SPORTS RIM
General	GOOD		
3. Conditions of Tyres			
	Size	Make	Balance
R/H Front Tyre	195/65 R15	YOKOHAMA	6 mm
L/H Front Tyre	195/65 R15	YOKOHAMA	6 mm
R/H Rear Tyre	195/65 R15	YOKOHAMA	6 mm
L/H Rear Tyre	195/65 R15	YOKOHAMA	6 mm
4. Description of Damages			
THE VEHICLE SUSTAINED DAMAGES AT THE REAR PORTION. DAMAGES SEE DETAILS.			
5. General Information			
Accident Date	04/03/2021	Inspection Date	05/03/2021
Survey held at	MG SOLUTION PTE LTD 23 KAKI BUKIT AVE 4 (SOUTH WING) #02-03B VICOM INSPECTION CENTRE, SINGAPORE 415933		
5a. Remarks			
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.			
5b. Estimate Days of Repair			
ESTIMATED NORMAL PERIOD FOR REPAIR:		6 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SMC 8521R

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
<u>REPLACEMENT OF PARTS</u>				
1	BOOTLID	DENTED	1,589.75	1,589.75
1	BOOTLID LOGO	NECESSARY	58.60	58.60
1	BOOTLID EMBLEM 'S'	NECESSARY	56.40	56.40
1	BOOTLID EMBLEM 'ELANTRA'	NECESSARY	86.90	86.90
2	BOOTLID HINGE @\$120.80	NOT NECESSARY	241.60	-
1	BOOTLID TOP LOCK	DAMAGED	198.60	118.00
1	BOOTLID LOWER CATCH	NOT NECESSARY	56.80	-
1	BOOTLID DETECTOR	CRACKED	180.50	85.00
1	BOOTLID WEATHERSTRIP	NOT NECESSARY	169.80	-
1	REAR BUMPER	DEFORMED	820.00	474.00
1	REAR BUMPER LOWER LID	DEFORMED	450.00	385.00
3	REAR BUMPER TOP BRACKET @\$33.50	NOT NECESSARY	100.50	-
2	REAR BUMPER BELOW BRACKET @\$33.50	NOT NECESSARY	67.00	-
2	REAR BUMPER REFLECTOR @\$68.60	O/S CUT	137.20	68.60
2	REAR BUMPER SIDE RETAINER @\$78.00	NECESSARY	156.00	68.00
1	REAR BUMPER REINFORCEMENT	BENT	565.60	339.00
2	REAR BUMPER REINFORCEMENT BRACKET @\$69.20	NOT NECESSARY	138.40	-
2	REAR NUMBER PLATE LAMP @\$89.60	NOT NECESSARY	179.20	-
2	TAILLAMP @\$468.20	CRACKED	936.40	936.40
2	TAILLAMP PANEL @\$188.90	NOT NECESSARY	377.80	-
1	REAR END PANEL	DENTED	576.30	576.30
1	REAR END PANEL TOP GARNISH	DEFORMED	124.00	124.00
	LESS 20% DISCOUNT		-1,453.47	-993.19
			5,813.88	3,972.76
<u>SPECIAL NETT ITEMS</u>				
1	REAR NUMBER PLATE (SN)	NOT NECESSARY	50.00	-
1	SET REAR BUMPER CLIP (SN)	NECESSARY	20.00	20.00
1	SET TAIL LAMP CLIP (SN)	NECESSARY	20.00	20.00
2	TAIL LAMP PANEL SEALANT @\$80.00 (SN)	NOT NECESSARY	160.00	-
1	SET REAR END PANEL TOP GARNISH CLIPS (SN)	NECESSARY	20.00	20.00

Report Ref No. CC6/CTI21003069/Ara3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	REAR END PANEL INSULATION SEAL (SN)	NECESSARY	150.00	60.00
1	REAR REVERSE CAMERA (SN)	DAMAGED	550.00	400.00
1	REVERSE SENSOR (SN)	DAMAGED	220.00	200.00
			1,190.00	720.00
	LABOUR			
	PANEL BEATING,REMOVAL & REPLACING PANEL.		1,800.00	800.00
	TO SPRAY PAINT AFFECTED AREAS .		1,600.00	800.00
	TO APPLY RUST PROOFING & TUFF COAT.		350.00	60.00
	WIRING CHECK .		60.00	30.00
	REMOVE AND REFIX UPHOLSTERY AND ROOF LINING TO FACILITATE REPAIR .		180.00	60.00
	REMOVE AND REFIX REVERSE SENSOR AND DISTANCE SETTING .		80.00	50.00
	TRANSFER BOOTLID MECHANISM .		80.00	60.00
			4,150.00	1,860.00
	GRAND TOTAL		11,153.88	6,552.76
	RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)			5,200.00

Report Ref No. CC6/CT121003069/Ara3q2

ADRIAN LING WAI PING

B.Eng,AMSOE,AMIRTE,AMSAE-A,M.MATAI

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd


51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SMC 8521R

INSPECTION

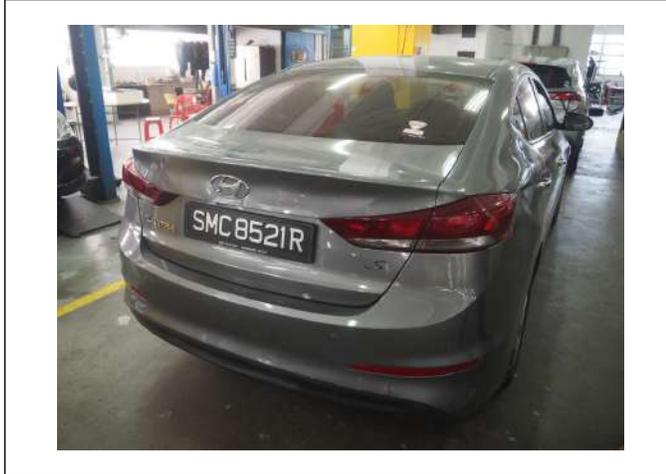



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

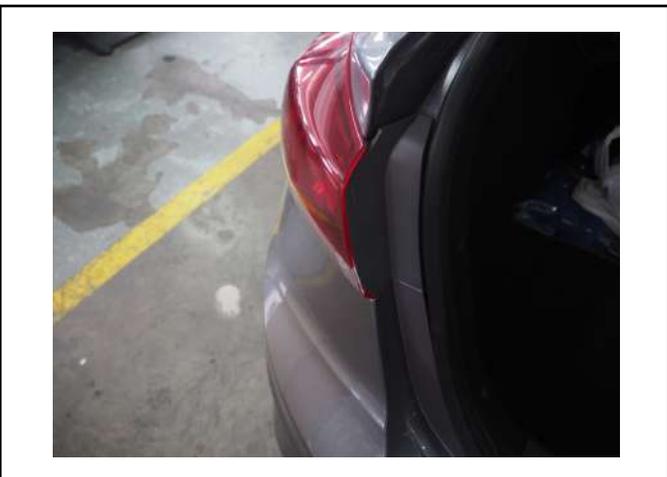



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SMC 8521R

RE-INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R








LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

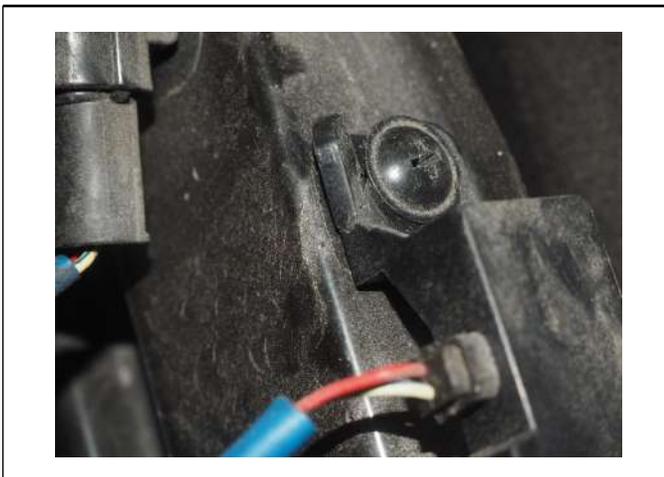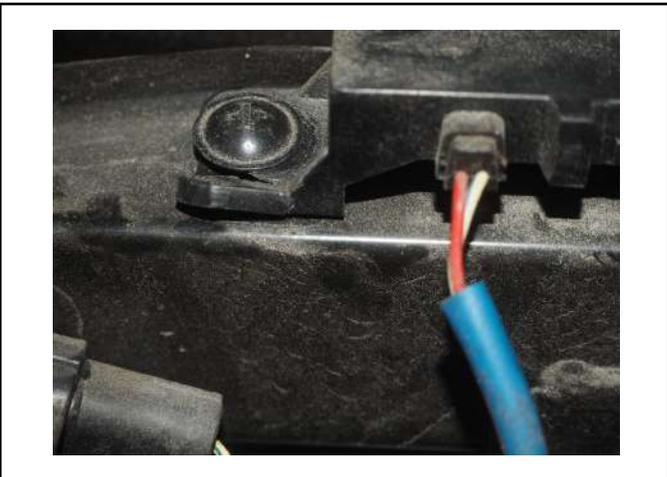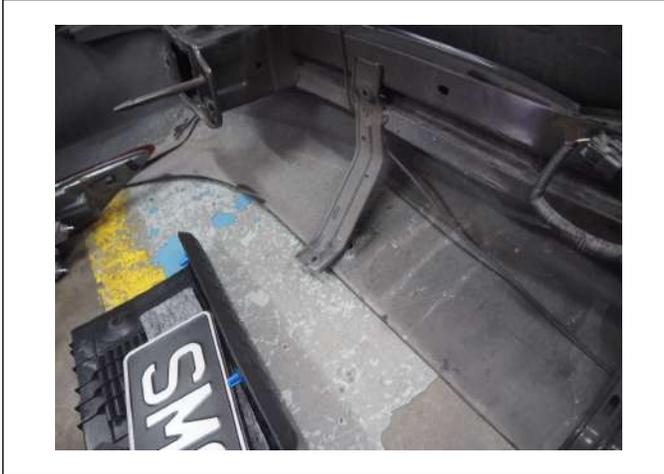







LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

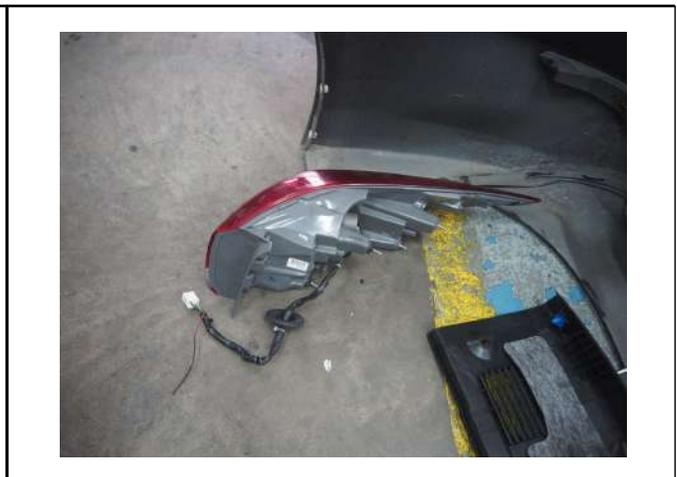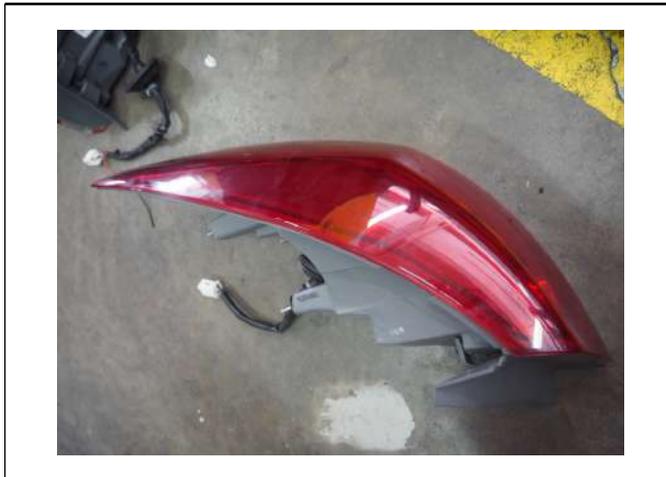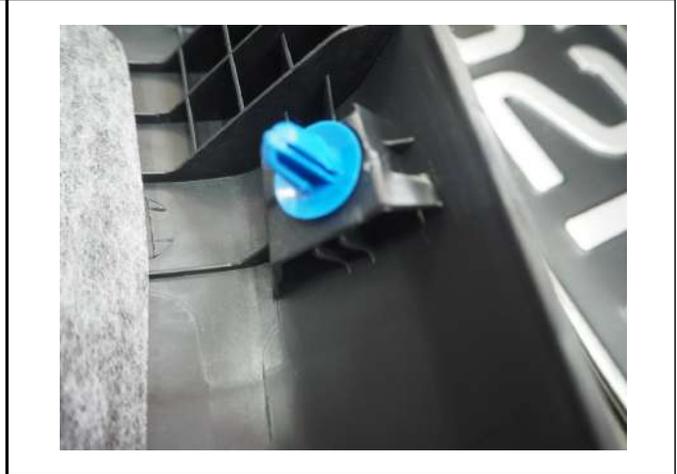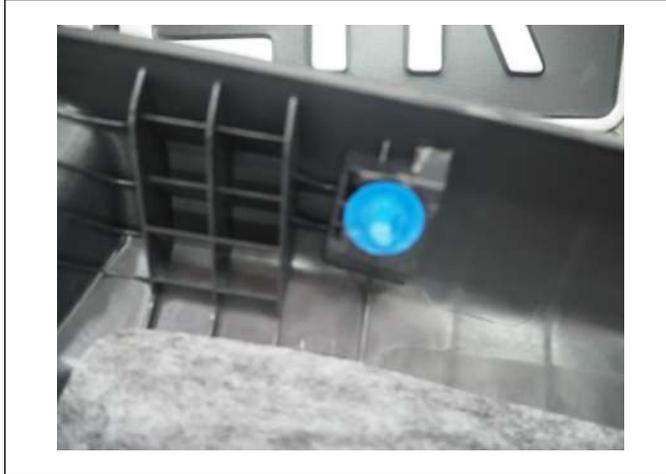



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

