

OH APPRAISAL SERVICES

BLK 34, #02-309, TOA PAYOH, LORONG 5
SINGAPORE (310034)

Mobile : 97982959 Fax : 63975857 email : oh3434@yahoo.com.sg

VEHICLE DAMAGE INSPECTION REPORT

Mr. Muhammad Hafiz Bin Latif
Blk 274 A Compassvale Bow
#03-531
Singapore 541274

Our Ref : SLM5022T /TP5008
Date : 16 February 2021

REFERENCES

Claim Type	: Third Party	Date of Accident	: 25 November 2020
Vehicle No.	: SLM5022T	Date of Assignment	: 25 November 2020
Make	: Mitsubishi	Date of Inspection	: 25 November 2020
Model	: Lancer Ex 1.6 At Led	Date of Re-inspn.	: 02 December 2020
Reg. Date	: 31 March 2017	Chassis No	: JMYSRCY1AGU006635
Color	: Grey	Engine No	: Blocked
Odometer	: 059919 km		

TYRE CONDITION

	<u>Front near side</u>	<u>Front off side</u>	<u>Rear near side</u>	<u>Rear off side</u>
Make	Yokohama	Yokohama	Yokohama	Yokohama
Size	205/60 R16	205/60 R16	205/60 R16	205/60 R16
Thread Balance	5 mm	5 mm	6 mm	6 mm

GENERAL DESCRIPTION OF DAMAGE (PHOTOGRAPHS ATTACHED)

The vehicle sustained damage at Front and Rear portion

INSPECTION AND ADJUSTMENT

Original Quotation : \$23,316.30 Revised Assessment \$14,100.00 Lump sum

In accordance to your instruction, we have not authorized repairs.

In normal circumstances, repairs to the vehicle would take approximately
(14) days to complete.(Survey at Hiap Lek Automobile Trading.)

This survey was conducted on a "WITHOUT PREJUDICE" basis.

S/N	Description	Qty	Condition	Original Quotation	Revised Quotation
	<u>Material</u>				
1	Front bumper	1	Deformed	850.00	850.00
2	Front bumper reinforcement	1	Bent	313.00	313.00
3	Front bumper centre bracket	1	Bent	110.00	110.00
4	Front bumper side retainer@16.00	2	Dislodge	32.00	32.00
5	Front bumper tow cover	1	Missing	35.00	35.00
6	Front bumper centre grille	1	Cracked	140.00	140.00
7	Front bumper top rubber	1	Cut	25.00	25.00
8	Front bumper side grille cover (black)@\$75.00	2	Grazed	150.00	150.00
9	Headlamp@\$503.00	2	Grazed	1,006.00	1,006.00
10	Front grille	1	Cracked	247.00	247.00
11	Front grille emblem	1	Necessary	43.00	43.00
12	Front grille chrome	1	Grazed	95.00	95.00
13	Bonnet	1	Bent	610.00	610.00
14	Bonnet lock	1	Bent	85.00	85.00
15	Bonnet hinge@\$28.50	2	Bent	57.00	57.00
16	Horn	1	Faulty	45.00	45.00
17	Radiator suport panel	1	Bent	725.00	725.00
18	Radiator suport panel top garnish	1	Deformed	185.00	185.00
19	Air con condenser	1	Bent/Dented	1,016.00	1,016.00
20	Front fender@\$486.00	2	Repair	972.00	0.00
21	Rear bumper	1	Deformed	724.00	724.00
22	Rear bumper reinforcement	1	Bent	172.00	172.00
23	Rear bumper bracket (centre beam)	1	Bent	177.10	177.10
24	Rear bumper side retainer @\$32.00	2	Bent	64.00	64.00
25	Rear bumper reflector @\$27.00	2	Cracked/grazed	54.00	54.00
26	Rear bumper tow cover	1	Cut/grazed	32.50	32.50
27	Rear boot lid	1	Buckled	640.20	640.20
28	Rear boot inner trim board	1	Deformed	175.00	175.00
29	Rear boot top lock	1	Bent	59.00	59.00
30	Rear boot lower lock catch	1	Bent	19.00	19.00
31	Rear boot hinge @\$69.90	2	Bent	139.80	139.80
32	Rear boot damper @\$51.00	2	Bent	102.00	102.00
33	Rear boot third brake lamp	1	Grazed	298.00	298.00
34	Rear boot reflector lamp @\$159.00	2	Cracked/grazed	318.00	318.00
35	Rear boot weatherstrip	1	Necessary	139.00	139.00
36	Rear boot centre logo	1	Necessary	41.80	41.80
37	Rear boot 'Lancer' emblem	1	Necessary	38.50	38.50
38	Rear boot 'Ex' emblem	1	Necessary	28.50	28.50
39	Rear boot 'Mivec' emblem	1	Necessary	31.50	31.50
40	Rear boot sensor lock	1	Faulty	220.00	220.00
41	Rear number plate lamp	1 set	Grazed	95.00	95.00
42	Rear number plate bracket@\$38.00	2	Bent	76.00	76.00
43	Taillamp @\$356.00	2	Cracked/grazed	712.00	712.00
44	Taillamp panel @\$125.00	2	Bent	250.00	250.00
45	Rear end panel	1	Bent	341.00	341.00
46	Rear end panel top garnish	1	Cut	166.70	166.70
47	Rear spare tyre top board	1	Cut	128.00	128.00
48	Rear fender @\$668.00	2	Repair	1,336.00	0.00
49	Rear fender inner side trim @\$196.00	2	Deformed	392.00	392.00
50	Rear fender air duct	1	Deformed	38.00	38.00
51	Rear spare tyre panel	1	Repair	976.00	0.00
52	Rear exhaust mounting @\$24.00	2	Necessary	48.00	48.00
53	Rear exhaust silencer	1	Bent	550.00	550.00
				15,323.60	12,039.60
0% and 10 % discount				0.00	1,203.96
				15,323.60	10,835.64

<u>Special nett items</u>				
54	Front number plate w/casing	1	Bent	45.00 45.00
55	Front bumper clip	1 set	Necessary	35.00 35.00
56	Front grille clip	1	Necessary	22.00 22.00
57	Radiator suport panel top garnish clip	1 set	Necessary	24.00 24.00
58	Rear number plate w/casing	1	Grazed	45.00 45.00
59	Rear bumper clip	1 set	Necessary	35.00 35.00
60	Rear bumper reverse sensor	1 set	Malfunction	300.00 280.00
61	Rear boot 'C & C' emblem	1	Necessary	40.70 40.70
62	Rear boot inner trim board clip	1 set	Necessary	30.00 30.00
63	Rear boot top spoiler	1	Cracked	350.00 350.00
64	Rear camera	1	Faulty	500.00 400.00
65	Rear fender inner side trim clip @\$28.00	2 set	Necessary	56.00 56.00
66	Rear end panel top garnish clip	1 set	Necessary	20.00 20.00
67	Rear end panel sealant	1	Necessary	50.00 50.00
68	Rear spare tyre panel insulation	1	Necessary	150.00 150.00
			Parts Total	17,026.30 12,418.34
<u>Labour & Misc.</u>				
1)	Labour charge to remove-refit, panel beat, straighten, re-align and repair of front bumper, headlamps, bonnet, radiator support panel, front fenders, rear bumper rear bootlid, rear fenders, rear end panel, rear spare tyre compartment and others relevant accident damages.			2,600.00 2,200.00
2)	To check wirings, lightings and remove/refix rear bumper reverse sensor			100.00 80.00
3)	To remove rear bootlid compartment upholstery, garnish, accessories etc....., in order to faciliate repair			120.00 100.00
4)	To remove and rear fix rear exhaust silencer			100.00 60.00
5)	To mount vehicle on chassis bench, to straighten, re-align and repair of rear chassis members.			300.00 250.00
6)	Towing charges			80.00 60.00
7)	To supplied and applied anti rust treatment to affected panels.			240.00 180.00
8)	To remove-refit air con condenser, air con pipings/hoses, radiator etc....., including vacuum and refill air con gas.			150.00 120.00
9)	To putty and spray painting charges.			2,600.00 2,200.00
			Total	23,316.30 17,668.34
Lump sum repair adjustment				14,100.00

OH APPRAISAL SERVICES

Vehicle No: SLM5022T

Our Ref: SLM5022T/TP5008

ADJUSTMENT ON REPAIR COST AND REPLACEMENT OF PARTS

The information contained in this document is privileged and confidential and is intended for the exclusive use of the addressee designation. If you are not the addressee; any enclosure, reproduction, distribution or other dissemination or use of this communication is strictly prohibited. If you have received this document not meant for you, please contact us immediately to arrange for it to return.






For Oh Appraisal Services



SARVA
KOH KPERE

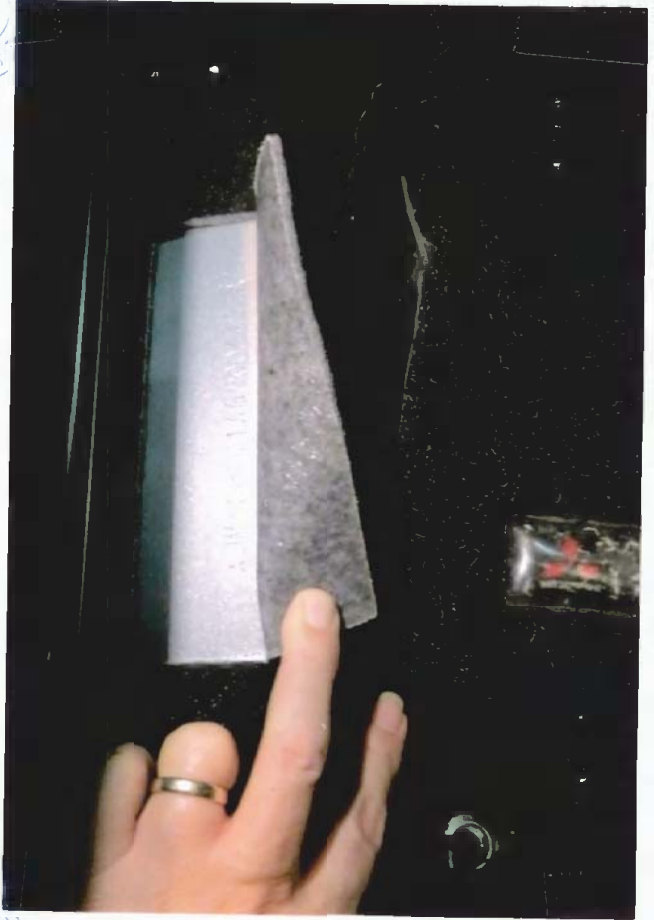

SARVA
KOH KPERE



SARVA
KOH KPERE



SERVICE
OH APPRAISAL



SERVICE
OH APPRAISAL



SERVICE
OH APPRAISAL

OH K&F R&S
L SERVICE
CES *



OH K&F R&S
L SERVICE
CES *



OH K&F R&S
L SERVICE
CES *

ES*OH



ES*OH



ES*OH

CES * OH * SAL




CES * OH * SAL




CES * OH * SAL







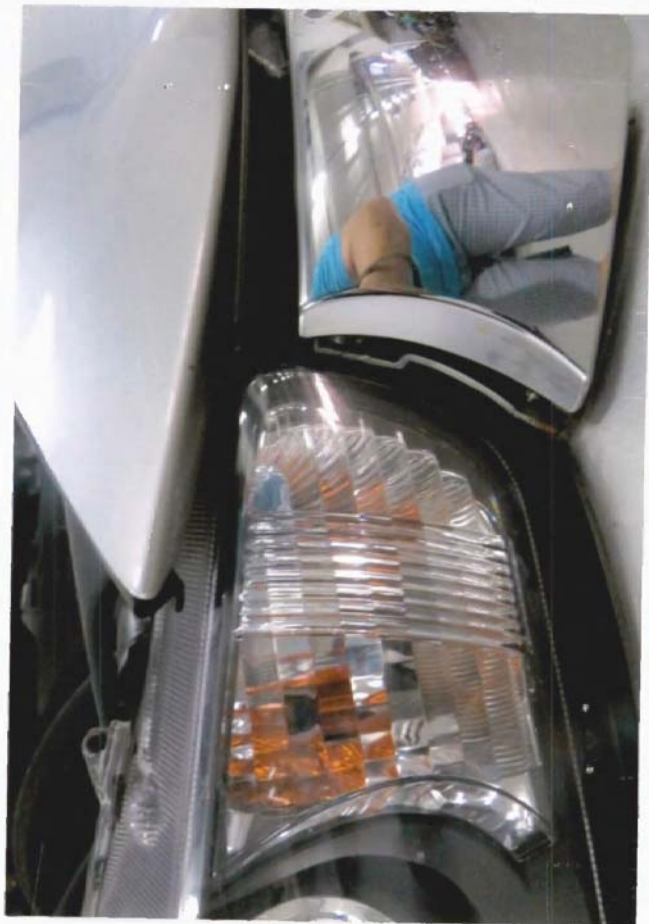







PHOTOGRAPHED BY
SERVICES * OH *



PHOTOGRAPHED BY
SERVICES * OH *



PHOTOGRAPHED BY
SERVICES * OH *



PHOTOGRAPHED BY
SERVICES * OH *

SERVICES * OH



SERVICES * OH



SERVICES * OH



SALES
* HO



SALES
* HO
SERVICE



SALES
* HO
SERVICE







SERVICES
TRAFFIC



SERVICES
TRAFFIC



SERVICES
TRAFFIC

RAISAT SERVICES



RAISAT SERVICES



RAISAT SERVICES





U.S. SERVICES * OH *
KOPRA



U.S. SERVICES * OH *
KOPRA



U.S. SERVICES * OH *
KOPRA