

Precise Appraiser Pte Ltd

VEHICLE DAMAGE ASSESSMENT REPORT

Reg no. 201924041Z

To: Kwek Chen Slang (Guo Chengxlang)

CC: Team Autopro Pte Ltd
160 Sin Ming Drive #02-12
Sin Ming Auto City
Singapore 575722

REFERENCES

Ref No	: 2020/0140	Date of Report	: 13/8/2020
Claim Type	: Third Party	Date of Request	: 13/8/2020
Third party vehicle	: SMC8312C	Date of Accident	: 12/8/2020
Insured Vehicle	:	Date of Inspection	: 13/8/2020
Your Reference No	: -		

DAMAGED VEHICAL PARTICULARS

Registration Plate No	: SMC8312C	Engine Modification	: NIL
Model / Make	: Mercedes CLA180	Pre-accident damage	: NIL
Colour	: White	General Condition	: Good
Manufacturing Year	: 2018	General Paint Work	: Good
Engine No	: 27091031670614	Steering	: Serviceable
Engine Capacity	: 1600cc	Handbrake	: Serviceable
Chassis No	: WDD1173422N681563	Footbrake	: Serviceable
Odometer No	: 14732		
Transmission	: Auto		

TYRES CONDITION

Front Right		Rear Left	
Make	: Bridgestone	Make	: Bridgestone
Size	: 225/40 r18	Size	: 225/40 r18
	6		6
Front Left		Rear Right	
Make	: Bridgestone	Make	: Bridgestone
Size	: 225/40 r18	Size	: 225/40 r18
	6		6

The above millimetres represent the remaining life of tyre treads

VEHICAL REPAIR COST

<u>Descriptions</u>	<u>Repairer (\$\$)</u>	<u>Difference (\$\$)</u>	<u>Adjuster (\$\$)</u>
Parts	11,728.92		8,825.56
Labour	3,930.00		1,880.00
Calculated Cost (\$\$) :	15,658.92	4,953.36	10,705.56


Recommended Lump Sum Repair Cost (\$\$)	: 10,705.56
Estimate Repair Duration	: 5
Survey Inspection At	: Team Autopro Pte Ltd
Survey Inspection Address	: 160 Sin Ming Drive #02-12 Sin Ming Auto City Singapore 575722

DESCRIPTION OF DAMAGE

At the time of inspection, this vehicle sustained damages to the **Front Rh Portion**.

Front bumper deformed/ deep cut, front rh fender warp, bonnet dented, rh headlamp grazed etc.


Please see attached scheduled details.

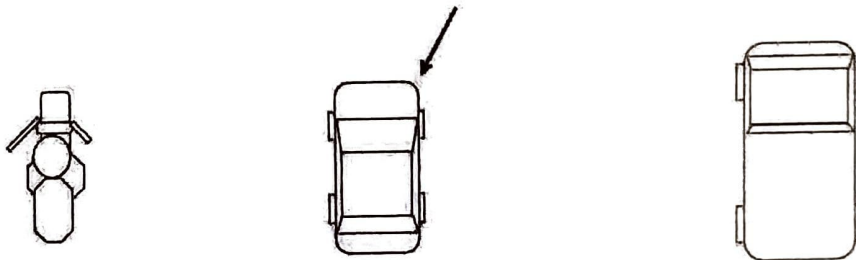

SPECIAL REMARKS

We have not authorised repair. Under normal circumstances, estimated 5 working days are required to repair the vehicle.

We are pleased to advise that the inspection work was carried out accordingly, and hereby submit our Inspection Report and photographs.

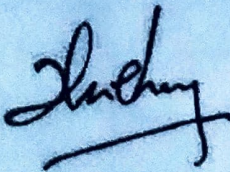

Anthony
Automotive Appraiser
MSAAA

Disclaimer:

This survey was conducted by Precise Appraiser Pte Ltd without prejudice basis and we do not authorized repair. Report by Precise Appraiser Pte Ltd is deemed as confidential and provided for the use of clients and appointed agent. *We have inspected thoroughly each and every item on the repairer's estimate against the actual damages found on the vehicle.* All findings and recommendations are listed accordingly and final decision of settlement to your good selves parts thereof accordingly and final. No liability shall be attached to Precise Appraiser Pte Ltd therefore.

Our Reference : 2020/0140

Your Reference:

Vehicle Number : SMC8312C

S/N	Qty	Description	Condition	Repairer Estimate (\$)	Our Assessment (\$)
Parts					
1	1pcs	Front bumper	Deep Cut / Deformed	1698.2	1698.2
2	1pcs	Front bumper inner sponge	Torn	325	325
3	2pcs	Front bumper side retainer @98.6/pcs	Rh Torn	197.2	98.6
4	1pcs	Front bumper fog lamp garnish	Serviceable	78.6	0
5	1pcs	Front bumper outer chrome garnish	Grazed	485.45	485.45
6	2pcs	Front bumper parking sensor @310.5/pcs	Shorted	621	310.5
7	1pcs	Bonnet (Aluminium)	Dented	2580	2580
8	2pcs	Front support panel	Repair	952.89	0
9	1pcs	Front support panel top garnish	Serviceable	345	0
10	2pcs	Front fender RH (Aluminium)	Crack	1084.52	1084.52
11	3pcs	Front fender moulding	Warp	298.2	298.2
12	2pcs	Front fender inner cowling RH	Serviceable	485	0
13	2pcs	Headlamp RH (LED)	Grazed	2814.6	2814.6
14	1pcs	Headlamp lower bracket RH	Serviceable	378.2	0
15	1pcs	Headlamp panel RH	Repair	510.5	0
Total				12854.36	9695.07
Less 10%				1285.436	969.507
Parts Sub Total				11568.924	8725.563

Special Nett

16	1set	Front rh fender sealant	Necessary	80.00	50.00
17	1set	Bonnet sealant	Necessary	80.00	50.00
Total				160.00	100.00

Labour				
1	To check wiring system	80	50	✓
2	To re-programme and reset after repair.	200	150	80
3	To R&R front bumper, front rh fender, bonnet, support panel and other attachments.	2000	600	✓
4	To putty and respray front bumper, front rh fenders, bonnet and accident affected area.	1500	1000	600
5	Rustproofing	150	80	✓
Labour Total		3930	1880	1410
Sub Total (labour and parts)		15,658.92	10,705.56	

Adjustment / Recommendations

Note: For Part by Part Repair

The workshop has agreed to undertake the repair at our adjusted amount is \$10,705.56.

Under normal circumstances, the repair period would be about 5 working days.

7631.36

5 Days.