



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

CHINA TAIPING INSURANCE (S) PTE LTD

INV No. AC2200411

3 ANSON ROAD #16-00
SPRINGLEAF TOWER
SINGAPORE 079909

INV Date 18/01/2022
Reference CC3/CTI21003494/Qrs3q2
Code CTI

PROFESSIONAL SERVICE FEE

Vehicle No. SHB 817E
Insured Veh. SMM 9502L
Claim No. SNM21D201456/LKKDS
Policy No. DMPCSNW00156302003
Accident Date 14/03/2021
Inspection Date 16/03/2021

Description	Total
Third Party Express Settlement	400.00
Subtotal	400.00
GST (7%)	28.00
Grand Total	428.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
CHINA TAIPING INSURANCE (S) PTE LTD 3 ANSON ROAD #16-00 SPRINGLEAF TOWERSINGAPORE 079909			Ref: CC3/CTI21003494/Qrs3q2 Date: 18/01/2022 Code: CTI	
1. Policy Particulars :- THIRD PARTY CLAIM				
	Insured Veh.	SMM 9502L	Veh. Inspected	SHB 817E
	Policy No.	DMPCSNW00156302003	Coverage (\$)	0.00
	Claim No.	SNM21D201456/LKKDS	Excess (\$)	0.00
	Assign From		Assign Date	16/03/2021
2. Vehicle Particulars & Condition				
	Make & Model	TOYOTA PRIUS 4	c.c	1798
	Engine No.	HIDDEN	Year of Reg.	2017
	Chassis No.	JTDKB3FU903572309	Colour	MAROON
	Odometer	534872 KM	Steering	IN ORDER
	Brakes	IN ORDER	Modification	SPORTS RIM
	General	FAIR		
3. Conditions of Tyres				
		Size	Make	Balance
	R/H Front Tyre	195/65 R15	SAILUN	6 mm
	L/H Front Tyre	195/65 R15	SAILUN	6 mm
	R/H Rear Tyre	195/65 R15	SAILUN	6 mm
	L/H Rear Tyre	195/65 R15	SAILUN	6 mm
4. Description of Damages				
	THE VEHICLE SUSTAINED DAMAGES AT THE O/S BODY. DAMAGES SEE DETAILS			
5. General Information				
	Accident Date	14/03/2021	Inspection Date	16/03/2021
	Survey held at	SMRT AUTOMOTIVE SERVICES PTE LTD 60 WOODLANDS INDUSTRIAL PARK E4 SINGAPORE 757705		
5a. Remarks				
	A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.			
5b. Estimate Days of Repair				
	ESTIMATED NORMAL PERIOD FOR REPAIR:		3 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SHB 817E

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	RETAINER ,RR BUMPER RH (DISC 25%)	BROKEN	112.70	84.53
2	PAD ,RR BUMPER ,RH & LH 3 @\$3.80 (DISC 25%)	NECESSARY	7.60	5.70
2	PAD ,RR BUMPER ,RH & LH 2 @\$3.80 (DISC 25%)	NECESSARY	7.60	5.70
2	PAD ,RR BUMPER ,RH & LH 1 @\$3.80 (DISC 25%)	NECESSARY	7.60	5.70
10	CLIPS PIECE ,FRT & RR BUMPER @\$1.50 (DISC 25%)	NECESSARY	15.00	11.25
1	COVER ,RR BUMPER ASSY (DISC 25%)	CRUMPLED	423.90	317.93
1	CAP SUB-ASSY WHEEL (DISC 25%)	SCRATCHED	175.80	131.85
1	FILLER RR BUMPER RH (DISC 25%)	CUT	119.90	89.93
2	PIXEL STICKER @\$60.00 (SN)	NECESSARY	120.00	120.00
1	PANEL SUB-ASSY ,REAR DOOR ,RH	SERVICEABLE	1,243.90	-
1	SENSOR REVERSE	SERVICEABLE	180.00	-
1	MOULDING ASSY ,BODY ROCKER PANEL ,RH	SERVICEABLE	576.00	-
1	SPOILER SUB-ASSY ,REAR	SERVICEABLE	1,322.10	-
1	STICKER DECAL 65555 8888	SERVICEABLE	21.60	-
1	SMRT LOGO	SERVICEABLE	7.80	-
1	EMBLEM SUB-ASSY REAR	SERVICEABLE	46.30	-
1	NAME PLATE (PRIUS) LUGGAGE COMPARTMENT	SERVICEABLE	52.30	-
1	NAME PLATE (HYBRID) LUGGAGE COMPARTMENT	SERVICEABLE	52.30	-
1	TAIL GATE BACK DOOR OUTSIDE GARNISH SUB	SERVICEABLE	891.20	-
1	TAIL GATE PANEL SUB-ASSY ,BACK DOOR	SERVICEABLE	929.60	-
1	COVER ,REAR COMBINATION LAMP RH	SERVICEABLE	54.00	-
1	LENS & BODY ,REAR COMBINATION LAMP RH	SERVICEABLE	438.10	-
1	COVER ,REAR FLOOR UNDER RH	SERVICEABLE	169.50	-
1	LENS & BODY ASSY ,RR BUMPER ,RH	SERVICEABLE	486.80	-
1	PAD ,RR BUMPER ,CTR	SERVICEABLE	2.20	-
1	GUARD ,RR BUMPER LOWER	SERVICEABLE	558.30	-
1	SEAL ,RR BUMPER ,RH	SERVICEABLE	85.20	-
1	FILLER ,RR BUMPER ,RH	SERVICEABLE	119.90	-
2	SEAL ,RR BUMPER ARM ,RH & LH	SERVICEABLE	11.00	-
2	DUCT ASSY ,QUARTER VENT ,RH & LH	SERVICEABLE	65.00	-
1	TYRE	SERVICEABLE	126.74	-

Report Ref No. CC3/CTI21003494/Qrs3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	WHEEL ,DISC	SERVICEABLE	1,555.10	-
1	LINER ,REAR FENDER ,RH	SERVICEABLE	135.80	-
1	PANEL SUB-ASSY ,FENDER REAR RH	TO REPAIR SEE LABOUR	824.80	-
			10,945.64	772.59
	<u>LABOUR</u>			
	PANEL BEATING & BODY WORK .INCLUSIVE OF THE REPAIR OF PANEL SUB-ASSY ,FENDER REAR RH.		845.00	400.00
	SPRAY PAINT.		2,772.00	500.00
	TO CHECK WIRING AND SYSTEM FUNCTION .		80.00	30.00
	TO APPLY RUST-PROOFING ON AFFECTED AREA.		100.00	30.00
	TO DO WHEEL ALIGNMENT /TYRE BALANCING .		120.00	60.00
	TO REMOVE AND REFIT TYRE RIM (SPRAYING PURPOSE).	NOT NECESSARY	120.00	-
	TO TEST AND REFIX REVERSE SENSOR SYSTEM.	NOT NECESSARY	120.00	-
	TO REMOVE AND REFIT WIRE HARDESS .	NOT NECESSARY	150.00	-
	TO REPLACE SUNDRY PARTS.	NOT NECESSARY	100.00	-
	TO WASH AND VACUUM.	NOT NECESSARY	60.00	-
			4,467.00	1,020.00
GRAND TOTAL			15,412.64	1,792.59
RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)				1,650.00

Report Ref No. CC3/CTI21003494/Qrs3q2

OI SUN PIN

Asst. Automotive Assessor

HO LEONG CHUAN

Automotive Assessor

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SHB 817E

INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R







LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

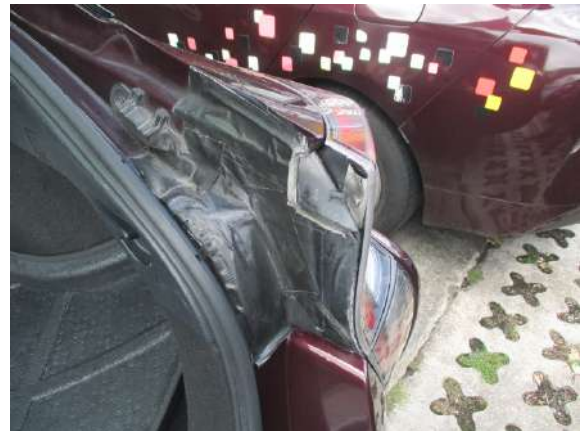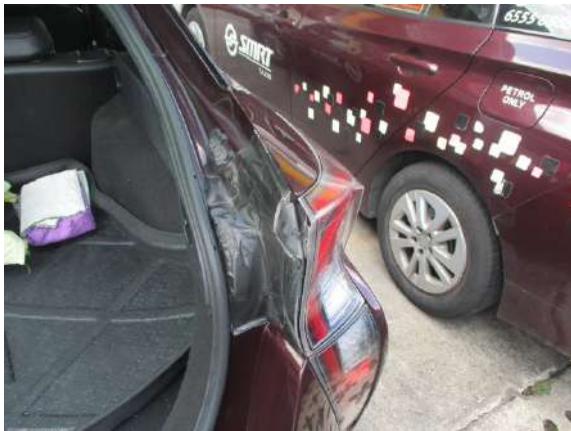



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SHB 817E

RE-INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

