



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

CHINA TAIPING INSURANCE (S) PTE LTD

INV No. AC2105242

3 ANSON ROAD #16-00
SPRINGLEAF TOWER
SINGAPORE 079909

INV Date 27/07/2021
Reference CC3/CTI21003509/Qra3q2
Code CTI

PROFESSIONAL SERVICE FEE

Vehicle No. SHB 5808Z
Insured Veh. GBF 3154P
Claim No. SNM21D201450
Policy No. DMCVSNW00024732100
Accident Date 14/03/2021
Inspection Date 16/03/2021

Description	Total
Third Party Express Settlement	400.00
Subtotal	400.00
GST (7%)	28.00
Grand Total	428.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
CHINA TAIPING INSURANCE (S) PTE LTD			Ref:	CC3/CTI21003509/Qra3q2
3 ANSON ROAD #16-00			Date:	27/07/2021
SPRINGLEAF TOWERSINGAPORE 079909			Code:	CTI
1. Policy Particulars :- THIRD PARTY CLAIM				
Insured Veh.	GBF 3154P	Veh. Inspected	SHB 5808Z	
Policy No.	DMCVSNW00024732100	Coverage (\$)	0.00	
Claim No.	SNM21D201450	Excess (\$)	0.00	
Assign From		Assign Date	16/03/2021	
2. Vehicle Particulars & Condition				
Make & Model	TOYOTA PRIUS 4FL	c.c	1798	
Engine No.	HIDDEN	Year of Reg.	2019	
Chassis No.	JTDKB3FU703089241	Colour	MAROON	
Odometer	75481 KM	Steering	IN ORDER	
Brakes	IN ORDER	Modification	SPORTS RIM	
General	FAIR			
3. Conditions of Tyres				
	Size	Make	Balance	
R/H Front Tyre	195/65 R15	TOURING	6 mm	
L/H Front Tyre	195/65 R15	TOURING	6 mm	
R/H Rear Tyre	195/65 R15	TOURING	6 mm	
L/H Rear Tyre	195/65 R15	TOURING	6 mm	
4. Description of Damages				
THE VEHICLE SUSTAINED DAMAGES AT THE FRONT PORTION AND O/S BODY.				
DAMAGES SEE DETAILS.				
5. General Information				
Accident Date	14/03/2021	Inspection Date	16/03/2021	
Survey held at	SMRT AUTOMOTIVE SERVICES PTE LTD 60 WOODLANDS INDUSTRIAL PARK E4 SINGAPORE 757705			
5a. Remarks				
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.				
5b. Estimate Days of Repair				
ESTIMATED NORMAL PERIOD FOR REPAIR:			3 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SHB 5808Z

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	EMBLEM,SIDE PANEL (HYBRID) (DISC 25%)	NECESSARY	54.60	40.95
1	LINER ,FR FENDER ,RH (DISC 25%)	DEFORMED	202.50	151.88
1	FENDER SUB-ASSY ,FR ,RH (DISC 25%)	CRUMPLED	977.80	733.35
1	WIPER WASHER JAR (DISC 25%)	CRUMPLED	219.10	164.33
1	MOULDING ,FRONT BUMPER SIDE ,RH (DISC 25%)	SCRATCHED	95.60	71.70
1	COVER ,FR BUMPER RH (DISC 25%)	MISSING	30.20	22.65
10	CLIPS PIECE ,FRT & RR BUMPER @\$4.50 (DISC 25%)	NECESSARY	45.00	33.75
1	COVER ,FR BUMPER (DISC 25%)	CRUMPLED	521.00	390.75
1	UNIT ,HEADLAMP ,RH (DISC 10%)	CRUMPLED	2,637.60	2,373.84
1	PAD ,FR WHEEL RH	SERVICEABLE	59.60	-
1	MOTOR AND PUMP ASSY ,WINDSHIELD WASHER .	SERVICEABLE	292.40	-
1	HOSE ,WINDSHIELD WASHER	SERVICEABLE	16.80	-
1	WIPER WASHER INLET	SERVICEABLE	67.00	-
1	COMPUTER SUB-ASSY ,HEADLAMP ,RH NO.1	SERVICEABLE	3,772.50	-
1	SUPPORT S/A RH	SERVICEABLE	245.10	-
1	SUPPORT ,RADIATOR UPPER RH	SERVICEABLE	78.90	-
1	CABLE ASSY ,HOOD	SERVICEABLE	54.90	-
1	HINGE ASSY ,HOOD ,LH	SERVICEABLE	58.90	-
1	HINGE ASSY ,HOOD ,RH	SERVICEABLE	58.90	-
1	HOOD SUB-ASSY	SERVICEABLE	983.10	-
1	COVER ASSY ,ENGINE	SERVICEABLE	241.90	-
1	GRILLE SUB-ASSY	SERVICEABLE	422.50	-
1	EXTENSION SUB-ASSY ,RH	SERVICEABLE	120.10	-
1	REINFORCEMENT FRONT LOWER	SERVICEABLE	246.10	-
1	ABSORBER ,FR BUMPER LOWER	SERVICEABLE	132.70	-
1	REINFORCEMENT FRONT UPPER	SERVICEABLE	716.60	-
1	ABSORBER ,FR BUMPER	SERVICEABLE	80.20	-
1	SUPPORT ,FR BUMPER RH	SERVICEABLE	80.10	-
1	SEAL ,HOOD TO FR END	SERVICEABLE	85.50	-
1	LAMP ASSY ,FOG RH	SERVICEABLE	237.10	-
1	GRILLE ,RADIATOR	SERVICEABLE	178.60	-

Report Ref No. CC3/CTI21003509/Qra3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	PROTECTOR ,FR FENDER RH	SERVICEABLE	93.90	-
1	STICKER DECAL SMRT (DOOR)	SERVICEABLE	60.00	-
1	PANEL SUB-ASSY ,FRONT DOOR RH	SERVICEABLE	1,300.70	-
1	TYRE	SERVICEABLE	126.74	-
1	APRON SUB-ASSY ,FRONT FENDER RH	SERVICEABLE	979.40	-
1	WHEEL DISC FRONT	TO REPAIR SEE LABOUR	1,879.40	-
			17,453.04	3,983.20
	LABOUR			
	PANEL BEATING & BODY WORK .INCLUSIVE OF THE REPAIR OF WHEEL DISC FRONT .		1,014.00	400.00
	SPRAY PAINT .		2,052.00	450.00
	TOWING CHARGE.	NOT NECESSARY	56.00	-
	TO CHECK WIRING AND SYSTEM FUNCTION .		80.00	20.00
	TO APPLY RUST-PROOFING ON AFFECTED AREA.		100.00	30.00
	TO DO WHEEL ALIGNMENT /TYRE BALANCING .		120.00	60.00
	TO REMOVE AND REFIT TYRE RIM (SPRAYING PURPOSE).		120.00	20.00
	TO REMOVE AND REFIT WIRE HARDESS.	NOT NECESSARY	200.00	-
	TO REPLACE SUNDRY PARTS.	NOT NECESSARY	100.00	-
	TO WASH AND VACUUM .	NOT NECESSARY	60.00	-
			3,902.00	980.00
GRAND TOTAL			21,355.04	4,963.20

RECOMMENDED COST OF REPAIRS			4,963.20
------------------------------------	--	--	-----------------

Report Ref No. CC3/CTI21003509/Qra3q2

OI SUN PIN

Asst. Automotive Assessor

HO LEONG CHUAN

Automotive Assessor

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or replying on this Report, in whole or in part, does so at his or her own risk.






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

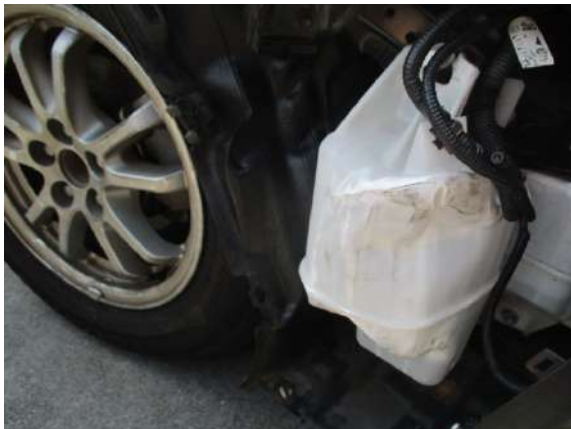



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

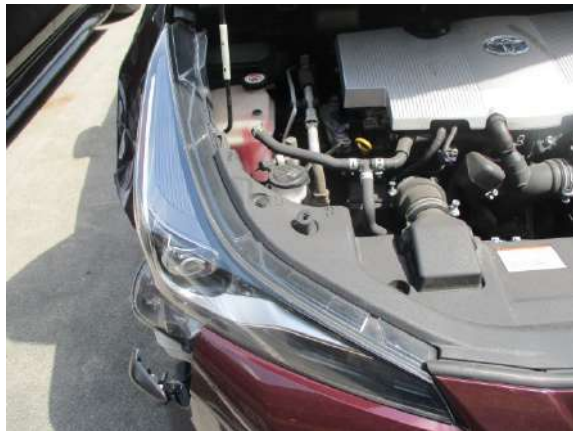



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SHB 5808Z

RE-INSPECTION

