

**ACCIDENT DAMAGED VEHICLE INSPECTION REPORT**

M/S : Car Cove Leasing Pte Ltd  
C/O Wahyu Automotive Body Work  
Blk 176 Sin Ming Drive #05-09  
Sin Ming Autocare Singapore 575721

Date : 29 March 2018  
Our Ref : TP/WYU/SLD8228U/7857

**REFERENCE PARTICULARS**

Date of Accident : 13 March 2018  
Date of Inspection : 19 March 2018

Type of Inspection : Third Party Claim  
Date of Re-Inspn : 22 March 2018

**VEHICLE PARTICULARS**

Registration No : SLD 8228 U  
Make : Audi  
Model : A6 2.0 TFSI MU  
Year : 2011

Engine No : CDN213454  
Chassis No : WAUZZZ4G3CN028064  
Odometer : 99225 km  
Colour : Black

**CONDITION OF VEHICLE (STATIC CHECKS AT TIME OF INSPECTION ONLY)**

Engine condition : Good  
Foot Brake : Serviceable  
Hand Brake : Serviceable

General Body Work : Good  
Steering : Serviceable  
Lightings : Serviceable

**TYRE CONDITION (Remaining estimated life of tyre in mm)**

	<u>Make</u>	<u>Size</u>	<u>Thread Balance</u>
Front Near side	: Continental	235/55R19	5 mm
Front Off Side	: Continental	235/55R19	5 mm
Rear Near Side	: Continental	235/55R19	5 mm
Rear off Side	: Continental	235/55R19	5 mm

**GENERAL DESCRIPTION OF DAMAGES**

The vehicle sustained damage at the front portion.  
For details, refer to assessment for repairs and photographs attached.

**ASSESSMENT SUMMARY**

Our assessment of the repair costs to pre-accident condition was **\$8,500.00 nett** at lump sum basis. (Subject to GST if applicable)

Under normal circumstances, estimated period required for repairs : Four (4) working days.

Enclosed Forty-Four (44) photographs depicting damage to the vehicle and after repair.

Inspection conducted at : 176 Sin Ming Drive, #05-09 Sin Ming Autocare Singapore 575721.  
Name of Workshop : WAHYU AUTOMOTIVE BODY WORK.

In accordance to your instruction, we have **not authorise** repairs and inspection was conducted strictly on a "**WITHOUT PREJUDICE BASIS**".

## ASSESSMENT OF REPAIRS AND SPARE PARTS COSTS

### DESCRIPTION OF PARTS AND NATURE OF REPAIRS

SPARE PARTS	QTY PC/SET	ASSESSED CONDITION	ORIGINAL QUOTATION	REVISED QUOTATION
1 Front bumper <i>X Repair</i>	1	Deformed/Torn	\$ 3,361.00	\$ 3,361.00 X
2 Front bumper side retainer L/R @ 68.50 <i>X SVC</i>	2	Damaged	\$ 137.00	\$ 137.00 X
3 Front bumper reinforcement	1	Serviceable	\$ 459.80	~
4 Front bumper energy absorber <i>X SVC</i>	1	Damaged	\$ 176.00	\$ 176.00 X
5 Front radiator side air guard LH /	1	Cracked	\$ 115.00	\$ 115.00 ✓
6 Front radiator grille	1	Serviceable	\$ 2,259.00	~
7 Front radiator grille gold trim <i>X SVC</i>	1	Scraped	\$ 415.00	\$ 415.00 X
8 Front headlamp assy L/R @ \$2,138.00 ✓	2	Hld Cracked/Faulty	\$ 4,276.00	\$ 4,276.00 ✓
10 Front lower fog lamp grille trim L/R @ \$321.00	2	Serviceable	\$ 642.00	~
11 Front radiator grille emblem <i>X SVC</i>	1	Necessary	\$ 150.00	\$ 150.00 X
12 Front bumper clips <i>X SVC</i>	1 set	Necessary	\$ 45.00	\$ 45.00 X
13 Front sensor @ \$351.00 <i>X</i>	2	1 pcs only (Malfunction)	\$ 702.00	\$ 351.00 X
14 Front bumper license plate with casing /	1 set	Cracked	\$ 120.00	\$ 120.00
<b>Parts Total :</b>			<b>\$ 12,857.80</b>	<b>\$ 9,146.00</b> <i>4391</i>
<b>LABOUR CHARGES &amp; MISC</b>				
15 Spray painting on above new & repaired parts including supply of paint materials.			\$ 800.00	\$ 600.00 <i>250</i>
16 Remove front fittings, dismantle and renew front damaged parts. Re-organize front affected management components.			\$ 900.00	\$ 650.00 <i>200</i>
17 To carry out diagnostic checks, focus headlight & centre locking system for proper function			\$ 250.00	\$ 180.00 <i>30</i>
18 To remove & reinstall front sensor and check for proper function.			\$ 120.00	\$ 80.00 <i>40</i>
<b>Labour Total :</b>			<b>\$ 2,070.00</b>	<b>\$ 1,510.00</b> <i>520</i>
<b>Total Parts and Labour</b>			<b>\$ 14,927.80</b>	<b>\$ 10,656.00</b>

### FINAL LUMP SUM ADJUSTMENT

**\$ 8,500.00**

### **POINT OF IMPACT**

The impact was confined to the front portion of the vehicle.  
The damages appeared to be consistent as per the accident report statement.  
Please refer the attached schedule and photographs for details.


#### ADJUSTMENT/RECOMMENDATIONS

We have thoroughly inspected each and every item on the repairer's estimates against the actual damaged found on the vehicle. We have listed the breakdown of our findings and recommendations as per assessment above.

#### CONCLUSION

The repairer has agreed to undertake repair the vehicle at a lump sum basis of **\$8,500.00 nett** corresponding to replacement of parts, spray painting and labour charges. We now revert for your decision on the above claim.

Yours faithfully  
KTO Automobile Assessors

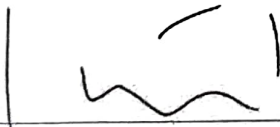

Ong Ah Keng (CAE, AMIMI, MSAAA)  
Automotive Appraiser